

Drainage Services Department

Contract No. CM 12/2019

**Expansion of Sha Tau Kok Sewage
Treatment Works
Environmental Team Services for
Construction Phase (2020-2021)**

Monthly EM&A Report for June 2021

[July 2021]

	Name	Signature
Prepared & Checked:	Lemon Lam	
Reviewed, Approved & Certified:	Y W Fung	

Version:0

Date: 13 July 2021

Disclaimer

This Environmental Monitoring and Audit Report is prepared for Drainage Services Department and is given for its sole benefit in relation to and pursuant to Contract No. CM 12/2019 and may not be disclosed to, quoted to or relied upon by any person other than Drainage Services Department without our prior written consent. No person (other than Drainage Services Department into whose possession a copy of this report comes may rely on this plan without our express written consent and Drainage Services Department may not rely on it for any purpose other than as described above.

AECOM Asia Co. Ltd.

12/F, Grand Central Plaza, Tower 2, 138 Shatin Rural Committee Road, Shatin, NT, Hong Kong

Tel: (852) 3922 9000 Fax: (852) 3922 9797 www.aecom.com



Drainage Services Department
42/F, Revenue Tower
5 Gloucester Road
Wan Chai
Hong Kong

Your reference:

Our reference: HKDSD206/50/107420

Date: 13 July 2021

Attention: Mr Alvin Ho

BY EMAIL & POST
(email: acmho@dsd.gov.hk)

Dear Sirs

Agreement No.: CM 14/2018
Independent Environmental Checker Services for
Expansion of Sha Tau Kok Sewage Treatment Works
Environmental Monitoring and Audit Monthly Report (June 2021)

We refer to emails of 12 and 13 July 2021 from AECOM Asia Co. Ltd attaching the Monthly Environmental Monitoring and Audit Report (June 2021).

We have no further comment and hereby verify the captioned Report in accordance with Clause 3.4 of the Environmental Permit no. EP-517/2017/A.

Should you have any queries, please do not hesitate to contact the undersigned or our Ms Karen Po at 2618 2831.

Yours faithfully
ANEWR CONSULTING LIMITED

James Choi
Independent Environmental Checker

CPSJ/LCCR/PKWK/lsm

cc DSD – Mr Alex Leung (email: alexleung_dsd@dc1803.com.hk)
Binnies – Mr Alaster Chan (email: are_em2@dc1803.com.hk)
AECOM – Mr YW Fung (email: yw.fung@aecom.com)
AECOM – Ms Lemon Lam (email: lemon.lam@aecom.com)

TABLE OF CONTENTS

EXECUTIVE SUMMARY	2
1 INTRODUCTION	4
1.1 Background	4
1.2 Scope of Report	5
1.3 Project Organization	5
1.4 Construction Programme and Activities	5
1.5 Status of Environmental Licenses, Notification and Permits	5
2 ENVIRONMENTAL MONITORING REQUIREMENTS	6
2.1 Odour Monitoring (Operation Phase for TSTP)	6
2.2 Noise Monitoring	7
2.3 Water Quality Monitoring	9
2.4 Waste Management Status	12
2.5 Landscape and Visual	13
3 IMPLEMENTATION STATUS ON ENVIRONMENTAL PROTECTION REQUIREMENTS	13
4 ENVIRONMENTAL SITE INSPECTION AND AUDIT	13
4.1 Site Inspection	13
4.2 Summary of Complaints, Notification of Summons, Successful Prosecutions and Public Engagement Activities	13
5 ON-SITE TIME FOR ET AND IEC TEAM	14
6 FUTURE KEY ISSUES	14
6.1 Construction Programme for the Coming Month	14
6.2 Key Issues for the Coming Month	14
6.3 Monitoring Schedule for the Coming Month	14
7 CONCLUSIONS	14

Figures

Figure 1	General Layout Plan
Figure 2	Locations of Odour monitoring for 1-Year Operation of TSTP
Figure 3	Location of Noise Monitoring Stations
Figure 4	Location of Marine Water Quality Monitoring Stations

List of Appendices

Appendix A	Project Organization Structure
Appendix B	Construction Programme
Appendix C	Calibration Certificates of Monitoring Equipment
Appendix D	EM&A Monitoring Schedules
Appendix E	Action and Limit Levels
Appendix F	Noise Monitoring Results and their Graphical Presentations
Appendix G	Water Quality Monitoring Results & their Graphical Presentations and QAQC Reports
Appendix H	Event and Action Plan
Appendix I	Waste Flow Table
Appendix J	Environmental Mitigation Implementation Schedule
Appendix K	Proactive Environmental Protection Proforma
Appendix L	Cumulative Statistics on Complaints, Notifications of Summons, Successful Prosecutions and Public Engagement Activities
Appendix M	On-site Time & duties for the Team of ET and IEC

EXECUTIVE SUMMARY

(i) Introduction

This is the 25th EM&A Report prepared by AECOM for the Expansion of Sha Tau Kok Sewage Treatment Works. This report summarized the monitoring results and audits findings of the EM&A programme under the issued EP (EP No.: EP-517/2017/A) and in accordance with the EM&A Manual during the reporting period from 01/06/2021 to 30/06/2021.

(ii) Summary of Main Works Undertaken and Key Measures Implemented

The main works undertaken during the reporting period are as follows:

- Excavation and formwork
- Submarine Outfall pilot hole drilling (Land)
- Submarine Outfall pilot hole drilling (Sea)
- Sewer laying works in Shun Hing Street and Tong To Village

Implementation of the key mitigation measures during the reporting period are as follow:

- All construction plants / machineries will be checked / serviced on a regular basis during the courses of construction to minimize the emission of noise generation and eliminate dark smoke emission.
- All C&D materials generated will be transported and stored at temporary storage area. Cover will be provided during transportation of dusty materials. Suitable materials will be sorted for reuse on-site. Only non-inert C&D material will be disposed off-site to NENT Landfill.
- All dump trucks will be equipped with mechanical covers to prevent the dust emission during transportation when necessary.
- Dust control measures, such as water spraying, will be provided during demolition works when necessary.
- Maintaining of wet surface on access road and keep slow speed in the site.
- Wastewater to be treated by wastewater treatment facilities before discharge.
- Conditions in the Environmental Permit and Discharge License should be followed.
- Fueling of equipment will be conducted carefully on-site by mobile tanker to avoid storage of fuel and oil spillage.
- Provision of drip trays for equipment likely cause spillage of chemical / fuel, and provide routine maintenance.
- Predict required quantity of concrete accurately and collect the unused fresh concrete at designated locations in the site for subsequent disposal.
- Application of silent plant.
- Provide sufficient mitigation measures as recommended in approved EM&A Manual requirement.
- Floating single silt curtain shall be deployed to fully enclose the works area at sea side prior to the installation of pipe piles for temporary scaffold and remove the silt curtain after the completion of steel casing installation.

(iii) Summary of Exceedances, Investigation and Follow-up

No Action or Limit Level exceedance of construction noise was recorded in the reporting period. No noise complaint related to 0700 to 1900 hours on normal weekdays was received in the reporting period.

Seven (7) Action Level exceedances of SS and one (1) Action Level exceedance of TP were recorded in the reporting period. Eight (8) Limit Level exceedances of SS, two (2) Limit Level exceedances of TP and three (3) Limit Level exceedances of E.Coli of marine water quality were recorded in the reporting period.

Based on the investigation findings, the exceedances of SS recorded on 7 and 30 June 2021 were similar to baseline and exceedances of SS, TP and E.Coli record on 28 June 2021 might considered due to external factor (i.e. heavy rainstorm in the morning). Therefore, the exceedances were considered not related to the Project.

Two (2) non-compliances (Limit Level exceedances) of E.Coli of effluent quality was recorded on 27 and 30 June 2021. According to the plant operator, no abnormalities were observed from the UV disinfection system on 27 and 30 June 2021. The plant operator was reminded to check the plant operation properly and voice out to the engineer immediately in case of any issues observed.

No complaints related to 0700 to 1900 hours on normal weekdays, notification of summons and successful prosecution was received in the reporting period.

(iv) Complaint Handling, Prosecution and Public Engagement

No complaint related to 0700 to 1900 hours on normal weekdays, notification of summons and successful prosecution was received in the reporting period.

No public engagement activity was conducted in the reporting period.

(v) Reporting Change

There was no reporting change in the reporting period.

(vi) Future Key Issues

The main works will be anticipated in the next reporting period are as follows:

- Formwork erection and rebar fixing
- Submarine Outfall pilot hole drilling (Land)
- Submarine Outfall pilot hole drilling (Sea)
- Sewer laying works in Shun Hing Street and Tong To Village

The corresponding mitigation measures to be implemented in the next reporting period are as follow:

- All construction plants / machineries will be checked / serviced on a regular basis during the courses of construction to minimize the emission of noise generation and eliminate dark smoke emission.
- All C&D materials generated will be transported and stored at temporary storage area. Cover will be provided during transportation of dusty materials. Suitable materials will be sorted for reuse on-site. Only non-inert C&D material will be disposed off-site to NENT Landfill.
- All dump trucks will be equipped with mechanical covers to prevent the dust emission during transportation when necessary.
- Dust control measures, such as water spraying, will be provided during demolition works when necessary.
- Maintaining of wet surface on access road and keep slow speed in the site.
- Wastewater to be treated by wastewater treatment facilities before discharge.
- Conditions in the Environmental Permit and Discharge License should be followed.
- Fueling of equipment will be conducted carefully on-site by mobile tanker to avoid storage of fuel and oil spillage.
- Provision of drip trays for equipment likely cause spillage of chemical / fuel, and provide routine maintenance.
- Predict required quantity of concrete accurately and collect the unused fresh concrete at designated locations in the site for subsequent disposal.
- Application of silent plant.
- Provide sufficient mitigation measures as recommended in approved EM&A Manual requirement.
- Floating single silt curtain shall be deployed to fully enclose the works area at sea side prior to the installation of pipe piles for temporary scaffold and remove the silt curtain after the completion of steel casing installation.

The following EP submission (EP No.: EP-517/2017/A) was submitted during the reporting period:

The Condition 3.4:

The 24th Monthly EM&A Report (May 2021) was submitted to EPD on 11 June 2021.

1 INTRODUCTION

1.1 Background

- 1.1.1. The Project in Sha Tau Kok mainly comprises of the following items:
- i) Increase the treatment capacity of Sha Tau Kok Sewage Treatment Works (STKSTW) to 5,000 m³/day at Average Dry Weather Flow (ADWF) in Phase 1, with suitable allowance to cater for a further increase of treatment capacity to 10,000 m³/day at ADWF in Phase 2;
 - ii) Construct a Temporary Sewage Treatment Plant (TSTP);
 - iii) Demolish the existing Sha Tau Kok Sewage Pumping Station (STKSPS) and decommission the rising main between STKSPS and STKSTW;
 - iv) Construct a new gravity sewer; and
 - v) Decommission the existing submarine outfall and construct a new one.
- 1.1.2. The Project site will be within the existing STKSTW while the construction of the gravity sewers and demolition of STKSPS will be carried out in Sha Tau Kok Town. The proposed submarine outfall will be constructed by Horizontal Directional Drilling (HDD) method under the seabed of Starling Inlet.
- 1.1.3. The Environmental Impact Assessment (EIA) Report for Expansion of Sha Tau Kok Sewage Treatment Works (Register No: AEIAR-207/2017) was approved on 14 February 2017. A Variation of an Environmental Permit (EP) EP-517/2017/A was issued on 18 October 2019 and it is the current permit for the Project.
- 1.1.4. Fugro Technical Services Limited (FTS) has been appointed to work as the additional services for Environmental Team (ET) services at early stage of construction phase (27 May 2019 to 26 February 2020) to implement the EM&A programme for the Project.
- 1.1.5. Since 27 February 2020, AECOM Asia Co. Ltd (AECOM) has been appointed as the ET to undertake the EM&A programme during construction phase (2020 – 2021) of the Project.
- 1.1.6. The EM&A programme of this Project shall be implemented in accordance with the requirements and procedures set out in the EM&A Manual and the EP No. EP-517/2017/A.
- 1.1.7. A baseline noise monitoring work was conducted between 25 February 2019 and 11 March 2019 and an Environmental Monitoring Report (Noise) Report (Report No.: 0118/18/ED/0259D) had submitted to EPD on 2 April 2019 and was approved by EPD on 21 June 2019.
- 1.1.8. A baseline water quality monitoring was conducted between 26 February 2019 and 23 Mar 2019 and an Environmental Monitoring Report (Water) Report (Report No.: 0118/18/ED/0307E) had submitted to EPD on 14 Jun 2019 and comments of report were received from EPD on 21 November 2019. An updated Environmental Monitoring Report (Water) Report (Report No.: 0118/18/ED/0307F) had submitted to EPD on 6 January 2020 and the report was approved by EPD on 2 March 2020.
- 1.1.9. A pre-construction survey on night roosting site for great egret was conducted in October 2019 and a Pre-construction Survey Report (Report No.: 0118/18/ED/0382 03) had submitted to EPD on 12 December 2019 and the report was found in order by Agriculture, Fisheries and Conservation Department on 30 December 2019.
- 1.1.10. A proposal for changes of the environmental monitoring methodology and requirement (Operation Phase of Odour Monitoring) had submitted to EPD on 29 April 2020 and comments from EPD were received on 26 May 2020. A revised proposal was submitted on 28 May 2020 and approved by EPD on 4 June 2020.
- 1.1.11. The construction phase and EM&A programme of the Project commenced on 27 May 2019. The operation of TSTP was commenced on 22 July 2020.

1.2 Scope of Report

1.2.1 This is the 25th EM&A Report prepared by AECOM for the Expansion of Sha Tau Kok Sewage Treatment Works. This report summarized the monitoring results and audits findings of the EM&A programme under the issued EP (Condition 3.4 of EP No.: EP-517/2017/A) and in accordance with the EM&A Manual during the reporting period from 01/06/2021 to 30/06/2021.

1.3 Project Organization

1.3.1 The project organization structure is shown in **Appendix A**. The key personnel contact names and numbers are summarized in **Table 1.1**.

Table 1.1 Contact Information of Key Personnel

Party	Position	Name	Telephone
DSD Drainage Services Department	Engineer	Alvin Ho	2594 7269
ER Binnies Hong Kong Limited	Resident Engineer	Kendrick Wong	2946 8708
IEC ANewR Consulting Limited	Independent Environmental Checker	James Choi	2618 2836
Contractor Build King – Kum Shing J.V.	Environmental Officer	Ping Ngan	9516 9431
ET AECOM Asia Company Limited	ET Leader	Y W Fung	3922 9393

1.4 Construction Programme and Activities

1.4.1 The construction phase of the Project under the EP commenced on 27 May 2019. The operation of TSTP was commenced on 22 July 2020.

1.4.2 Details of the construction works undertaken during the reporting period are listed below:

- Excavation and formwork
- Submarine Outfall pilot hole drilling (Land)
- Submarine Outfall pilot hole drilling (Sea)
- Sewer laying works in Shun Hing Street and Tong To Village

1.4.3 The Construction Programme is shown in **Appendix B**.

1.4.4 The general layout plan of the Project site is shown in **Figure 1**.

1.5 Status of Environmental Licenses, Notification and Permits

1.5.1 The environmental licenses and permits for the Project and valid in the reporting period are summarized in **Table 1.2**.

Table 1.2 Summary Status of Environmental License, Notification and Permit

License/ Notification/ Permit	Reference No.	Valid Period	
		From	To
Environmental Permit	EP-517/2017/A	18/10/2019	N/A
Wastewater Discharge License	WT00033567-2019	02/05/2019	31/05/2024
	WT00035755-2020	12/06/2020	30/06/2022
	WT00037838-2021	21/04/2021	30/04/2026
Chemical Waste Producer Registration	5213-652-B2548-01	14/12/2018	N/A
Billing Account	WFG19965	02/01/2019	N/A
Construction Noise Permit	GW-RN0169-21	14/03/2021	13/06/2021
	GW-RN0266-21	16/04/2020	30/06/2021
	GW-RN0273-21	09/05/2021	02/11/2021
	GW-RN0355-21	14/06/2020	13/09/2021

2 ENVIRONMENTAL MONITORING REQUIREMENTS

2.1 Odour Monitoring (Operation Phase for TSTP)

2.1.1 In accordance with the EM&A Manual, a commissioning test for the deodorization facilities of the TSTP was performed on 12 June 2020, exhaust air flow rate, temperature of exhaust and H₂S concentration were recorded during the measurement. The measurement details were presented in the odour commissioning test report. The odour commissioning test report was submitted to EPD on 16 June and re-submitted on 30 September 2020. Further comments from EPD was received on 9 December 2020 and the revised report was submitted on 12 May 2021.

Impact Monitoring Requirement

2.1.2 In accordance with the EM&A Manual, as there is no non-compliance was recorded during the weekly odour monitoring in the first two months (i.e. August and September 2020), monitoring frequency is recommended to reduce from weekly to monthly in the subsequent four months (i.e. October 2020 to January 2021) and further reduce to quarterly in the remaining six months (i.e. February to July 2021) of the first year of the TSTP operation if no non-compliance is found.

2.1.3 Quarterly monitoring of odour emission at the exhausts of deodorization facilities (TSTP No.1 and TSTP No.2) will be conducted in the period of February to July 2021. Odour monitoring will be performed at the exhaust of operating deodorization facility at TSTP. The approved alternative method for odour monitoring is presented in **Table 2.1**

Table 2.1 Approved Alternative Odour Monitoring Methodology

Measurement Locations	Parameter	Equipment
At the Exhaust of TSTP No.1 and TSTP No.2	<ul style="list-style-type: none"> ▪ Exhaust air flow rate ▪ Temperature of exhaust ▪ H₂S Concentration (ppm) 	H ₂ S Analyzer Anemometer

Monitoring Equipment

2.1.4 The details of monitoring equipment are presented in **Table 2.2**.

Table 2.2 Details of Odour Monitoring Equipment

Equipment	Equipment Model
H ₂ S Analyzer	Jerome 631X
Air Velocity Meter	TSI 9555-P

Monitoring Locations

2.1.5 As the operation mode of the deodorization system at TSTP shall be one in operation and one in standby. Odour monitoring will be undertaken at the exhaust of operating facility. The odour monitoring locations is presented in **Table 2.3** and shown in **Figure 2**.

Table 2.3 Location of Odour Monitoring

ID	Monitoring Location	Operation mode
TSTP No.1	At the exhaust of TSTP No.1	Operation / Standby
TSTP No.2	At the exhaust of TSTP No.2	Operation / Standby

Monitoring Parameters and Frequency

2.1.6 **Table 2.4** summarizes the monitoring parameters, frequency and duration of odour monitoring.

Table 2.4 Monitoring Parameters, Frequency (1st year of TSTP operation)

Measurement Parameters	Frequency
15-minute H ₂ S Measurement (every 5 minutes measure one reading) - Average value of the three 5-minute readings will be used. Exhaust air flow rate, ambient temperature, temperature of exhaust, weather condition and wind speed will be recorded.	<ul style="list-style-type: none"> • At least once per week in the first two months. (i.e. Aug and Sep 2020) • Monthly in the subsequent four months. (i.e. Oct 2020 to Jan 2021) • Quarterly in the remaining six months. (i.e. in between Feb to Jul 2021)

Results and Observation

- 2.1.7 The 1st quarterly for the remaining six months monitoring of odour emission was conducted in April 2021. The 2nd quarterly monitoring of odour emission will be conducted in July 2021 tentatively. No odour monitoring was conducted in the reporting month.

2.2 Noise Monitoring

Monitoring Requirements

- 2.2.1 In accordance with the EM&A Manual, impact noise monitoring was conducted for at least once per week during the construction phase of the Project. The Action and Limit levels for construction noise is provided in **Table 2.5**.

Table 2.5 Action and Limit Levels for Construction Noise

Station ID	Noise Sensitive Receivers	Description	Action Level [^]	Limit Level
NM1	NSR 6	Block 45, Sha Tau Kok Chuen	When one documented complaint is received from any one of the noise sensitive receivers	75 dB(A)*
NM2	NSR 8	Building along Shun Lung Street		

Note: [^] Between 07:00-19:00 hours in normal weekdays.
*75 dB(A) for residential premises.

Monitoring Equipment

- 2.2.2 Noise monitoring was performed using sound level meter at each designated monitoring station. The sound level meters deployed comply with the International Electrotechnical Commission Publications (IEC) 651:1979 (Type 1) and 804:1985 (Type 1) specifications. Acoustic calibrator was deployed to check the sound level meters at a known sound pressure level. Brand and model of the equipment is given in **Table 2.6**.

Table 2.6 Noise Monitoring Equipment

Equipment	Brand and Model
Integrated Sound Level Meter	B&K 2238
Acoustic Calibrator	B&K 4231

Monitoring Locations

- 2.2.3 Monitoring stations NM1 and NM2 were set up at the proposed locations in accordance with EM&A Manual. **Figure 3** shows the location of the monitoring stations. **Table 2.8** describes the details of the monitoring stations.

Table 2.7 Location of Impact Noise Monitoring Stations

Station ID	Noise Sensitive Receivers	Description	Type of measurement
NM1	NSR 6	Block 45, Sha Tau Kok Chuen	Free-field
NM2	NSR 8	Building along Shun Lung Street	Free-field

Note: For Free-field measurement, a correction of +3dB(A) should be made to the measured results.

Monitoring Parameters and Frequency

- 2.2.4 **Table 2.8** summarizes the monitoring parameters, frequency and duration of impact noise monitoring.

Table 2.8 Noise Monitoring Parameters, Frequency and Duration

Parameter and Duration	Frequency
30-mins measurement at each monitoring station between 0700 and 1900 on normal weekdays. L _{eq} , L ₁₀ and L ₉₀ would be recorded.	At least once per week

Monitoring Methodology

2.2.5 Monitoring Procedure

- (a) Free-field measurement was made at monitoring stations NM1 and NM2. For free-field measurement, a correction factor of +3 dB (A) would be applied.
- (b) The sound level meter was set on a tripod at a point 1m from the exterior of the façade of the sensitive receivers building and at a height of 1.2 m above the ground for free-field measurements at monitoring stations.
- (c) The battery condition was checked to ensure the correct functioning of the meter.
- (d) Parameters such as frequency weighting, the time weighting and the measurement time were set as follows:
 - (i) frequency weighting: A
 - (ii) time weighting: Fast
 - (iii) time measurement: $L_{eq(30\text{-minutes})}$ during 07:00 – 1900 on normal weekdays
- (e) Prior to and after each noise measurement, the meter was calibrated using the acoustic calibrator for 94dB(A) at 1000 Hz. If the difference in the calibration level before and after measurement was more than 1 dB(A), the measurement would be considered invalid and repeat of noise measurement would be required after re-calibration or repair of the equipment.
- (f) During the monitoring period, the L_{eq} , L_{10} and L_{90} were recorded. In addition, site conditions and noise sources were recorded on a standard record sheet.
- (g) Noise measurement would be paused during periods of high intrusive noise (e.g. dog barking, helicopter noise) if possible. Observations would be recorded when intrusive noise was unavoidable.
- (h) The wind speed at the monitoring station was checked with the portable wind speed meter. Noise monitoring would be cancelled in the presence of fog, rain, wind with a steady speed exceeding 5m/s, or wind with gusts exceeding 10m/s.

2.2.6 Maintenance and Calibration

- (a) The microphone head of the sound level meter was cleaned with soft cloth at regular intervals.
- (b) The meter and calibrator were sent to the supplier or HOKLAS laboratory to check and calibrate at yearly intervals.
- (c) Calibration certificates of the sound level meters and acoustic calibrators are provided in **Appendix C**.

Monitoring Results and Observations

2.2.7 The schedule for environmental monitoring in the reporting period is provided in **Appendix D**.

2.2.8 The monitoring results for construction noise are summarized in **Table 2.9** and the monitoring data is provided in **Appendix F**.

Table 2.9 Summary of Construction Noise Monitoring Results in the Reporting Period

Station ID	Construction Noise Level, dB(A)*, L_{eq} (30 min)	Baseline Level, dB(A)	Limit Level, dB(A)
NM1	57.4 – 62.2	65	75
NM2	57.1 – 62.0	65	75

Note: *A correction of +3 dB(A) was made to the free field measurements.
 L_{eq} (30min) was measured at 0700-1900 hours on normal weekdays.

2.2.9 No Action or Limit Level exceedance of construction noise was recorded in the reporting period. No noise complaint related to 0700 to 1900 hours on normal weekdays was received in the reporting period.

2.2.10 The event and action plan is annexed in **Appendix H**.

Other factor influencing the monitoring results

2.2.11 Major noise sources during noise monitoring in the reporting period were mainly road traffic noise, human activities and construction equipment noise.

2.3 Water Quality Monitoring

Monitoring Requirements (Construction Phase)

2.3.1 In accordance with the recommendations of the EIA, water quality monitoring is required during the installation, maintenance and removal of sheetpiles and sediment removal works for construction of diffuser.

2.3.2 Water quality monitoring programme for marine construction works was commenced on 9 November 2020. As informed by DSD, no marine construction work was conducted and the marine water quality monitoring for marine construction works was suspended since 21 December 2020. The marine water quality monitoring was resumed on 20 January 2021.

Monitoring Requirements (1-year Operation phase for TSTP)

2.3.3 In accordance with the EM&A Manual, marine water quality and continuous effluent quality monitoring for first year operation of TSTP were conducted in the reporting period. The Action and Limit levels for marine water quality and effluent quality is presented in **Appendix E**.

2.3.4 Water quality monitoring programme for operation phase of TSTP was commenced on 22 July 2020.

Monitoring Equipment

2.3.5 Equipment used in the marine water quality and effluent quality monitoring programme are summarized in **Table 2.10**.

Table 2.10 Marine Water Quality & Effluent Quality Monitoring Equipment

Monitoring Equipment	Equipment Model
Multifunctional Meter (measurement of Dissolved Oxygen, pH, temperature, salinity and turbidity)	YSI 6820V2
Water Depth	Lowrance x-4
Positioning Equipment	Garmin GPS72H
Multifunctional Meter (measurement of Dissolved Oxygen, temperature and salinity)	YSI 85D
pH meter	WTW pH 3210
Turbidimeter	WTW Turb 430T

Monitoring Locations

2.3.6 In accordance with the EM&A Manual, marine water quality and effluent quality monitoring stations are summarized in **Table 2.11** and shown in **Figure 4**.

Table 2.11 Location of Water Quality Monitoring Stations for 1-Year TSTP Operation and Construction Phase

Station	Description	Easting	Northing	1-Year TSTP Operation	Construction Phase
FCZ1A	Sha Tau Kok Fish Culture Zone – West	841565	844299	-	✓
FCZ1B	Sha Tau Kok Fish Culture Zone – West	841565	844299	✓	
FCZ7*	Temporary Relocation Site for Fish Rafts of the Sha Tau Kok Fish Culture Zone	842282	844451	✓	✓
FCZ8*	Temporary Relocation Site for Fish Rafts of the Sha Tau Kok Fish Culture Zone	841511	843959	✓	✓
SGA	Seagrass Colony	841064	844580	✓	✓
M1A	Mangrove Stand	840744	844853	✓	✓
H1A	Horseshoe Crab	840645	844398	✓	✓

Station	Description	Easting	Northing	1-Year TSTP Operation	Construction Phase
H4A	Horseshoe Crab	840304	843546	✓	✓
N1	Impact Station of the Expanded STKSTW (Ebb Tide)	842863	845378	✓	✓
N2	Impact Station of the Expanded STKSTW (Flood Tide)	842109	844631	✓	✓
C	Control Station	844690	845886	✓	✓
Effluent	At the effluent discharge point of TSTP	-	-	✓	-

Note:

Due to accessibility and safety concern during the baseline period, alternative water quality monitoring stations of SGA, M1A, H1A and H4A were proposed and adopted.

* No sediment dredging was conducted at Sha Tau Kok Fish Culture Zone, Approach Channel, Boat Shelter, etc in the reporting period. Therefore, no relocation for FCZ1 and monitoring at FCZ7 and FCZ8 is not required.

Monitoring Parameters and Frequency

2.3.7 **Table 2.12** summarizes the monitoring parameters, frequency of water quality monitoring.

Table 2.12 Marine Water and Effluent Quality Monitoring Parameters, Frequency

Monitoring Parameters, unit	Frequency
In-situ Measurement: <ul style="list-style-type: none"> • Temperature, °C • pH • Salinity, ppt • Dissolved Oxygen (DO), mg/L • Turbidity, NTU Laboratory Analysis: <ul style="list-style-type: none"> • Suspended Solids (SS), mg/L • Biochemical Oxygen Demand (BOD₅), mg/L • Total Phosphorus (TP) mg/L • Total Nitrogen (TN), mg/L • Ammonia Nitrogen (NH₃-N), mg/L • Total Inorganic Nitrogen, (TIN), mg/L • <i>E.coli</i>, cfu/100mL 	For Marine Water Quality: 1-year Operation phase for TSTP Once per day for 3 days per week for 1-year (the interval between two sets of monitoring should not be less than 36 hours) For Continuous Effluent Quality Monitoring: Daily for 1-year
In-situ Measurement: <ul style="list-style-type: none"> • Temperature, °C • pH • Salinity, ppt • Dissolved Oxygen (DO), mg/L • Turbidity, NTU Laboratory Analysis: <ul style="list-style-type: none"> • Suspended Solids (SS), mg/L 	For Marine Water Quality: <ul style="list-style-type: none"> • Construction Phase Both Mid-Ebb and Mid-Flood tides on the same day (the interval between two sets of monitoring should not be less than 36 hours)

Monitoring Methodology

2.3.8 In-situ measurement

For marine water quality monitoring

- (a) The in-situ marine water quality parameters, viz. dissolved oxygen, pH, temperature, salinity and turbidity were measured by YSI multifunctional meter.
- (b) Digital Differential Global Positioning System (DGPS) was used to ensure that the correct location was selected prior to sample collection. Portable battery-operated echo sounder was used for the determination of water depth at each designated monitoring station.
- (c) All in-situ measurements were taken at 3 water depths, 1 m below water surface, mid-depth and 1 m above sea bed, except where the water depth was less than 6 m, in which case the mid-depth station was omitted. Should the water depth be less than 3 m, only the mid-depth station was monitored. Duplicate water samples were collected using the water sampler at the monitoring stations. Other relevant data were recorded, including

monitoring location, time, water depth, tidal stages, weather conditions, sea conditions and any special phenomena or work undertaken in the field log sheet for information.

For effluent quality monitoring

- (a) Effluent sub-samples at bi-hourly interval over a 24-hour period were collected by refrigerated autosampler. Flow record of the project for the 24-hour sampling period was obtained to calculate the volume of each sub-sample. All of measured volume sub-samples were mixed in a clean container act as a flow-weighted composite effluent sample.
- (b) The in-situ effluent quality parameters, viz. dissolved oxygen, pH, temperature, salinity and turbidity were measured by YSI multifunctional meter, pH meter and Turbidimeter.

2.3.9 Laboratory Analysis

- (a) The collected samples were stored in high-density polythene bottles and/or preservatives added bottles and packed in cool-boxes (cooled at 4°C without being frozen) and delivered to a HOKLAS laboratory for laboratory analysis. The analysis will be commenced in a HOKLAS accredited laboratory, ALS Technichem (HK) Pty Ltd. (HOKLAS Registration No. 066) within 24 hours after collection of the samples.
- (b) The QAQC laboratory reports are attached in **Appendix G**.

2.3.10 Maintenance and Calibration

- (a) Before monitoring, the dissolved oxygen probe of multifunction meter was calibrated by the wet bulb method. A zero check in distilled water was performed with the turbidity probe once per monitoring day. The probe was then calibrated with a solution of known NTU.
- (b) The monitoring instruments were checked, calibrated and certified by a laboratory accredited under HOKLAS before use and subsequently re-calibrated at 3-monthly intervals throughout all stages of the water quality monitoring. Calibration details are provided in **Appendix C**.

Monitoring Results and Observations

2.3.11 The schedule for environmental monitoring in the reporting period is provided in **Appendix D**.

2.3.12 Construction and operation phases water quality monitoring was conducted at all designated monitoring stations and continuous effluent quality monitoring was conducted in the reporting period. No emergency discharge was happened in the reporting period.

2.3.13 All monitoring data and graphical presentation of the monitoring results are provided in **Appendix G**.

2.3.14 Exceedances of marine water quality and effluent quality was recorded in the reporting period. Number of exceedances recorded in the reporting period at each monitoring station are summarised in **Table 2.13**.

Table 2.13 Summary of Water Quality Exceedances

Station	Exceedance Level	DO (S&M)	DO (Bottom)	Salinity	Turbidity	SS	NH ₃ -N	TN	TIN	TP	BOD ₅	E.Coli	Total
N1	Action	0	0	0	0	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	1	0	0	0	1	0	0	2
N2	Action	0	0	0	0	1	0	0	0	0	0	0	1
	Limit	0	0	0	0	1	0	0	0	0	0	0	1
FCZ1A	Action	0	0	0	0	2	0	0	0	0	0	0	2
	Limit	0	0	0	0	0	0	0	0	0	0	0	0
FCZ1B	Action	0	0	0	0	1	0	0	0	0	0	0	1
	Limit	0	0	0	0	0	0	0	0	0	0	0	0
H4A	Action	0	0	0	0	1	0	0	0	0	0	0	1
	Limit	0	0	0	0	2	0	0	0	0	0	1	3
H1A	Action	0	0	0	0	1	0	0	0	0	0	0	1

Station	Exceedance Level	DO (S&M)	DO (Bottom)	Salinity	Turbidity	SS	NH ₃ -N	TN	TIN	TP	BOD ₅	<i>E.Coli</i>	Total
M1A	Limit	0	0	0	0	0	0	0	0	1	0	1	2
	Action	0	0	0	0	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	2	0	0	0	0	0	0	2
SGA	Action	0	0	0	0	1	0	0	0	1	0	0	2
	Limit	0	0	0	0	2	0	0	0	0	0	1	3
Effluent	Action	0	0	0	0	0	0	0	0	0	0	0	0
	Limit	0	0	0	0	0	0	0	0	0	0	2	2
Total	Action	0	0	0	0	7	0	0	0	1	0	0	8
	Limit	0	0	0	0	8	0	0	0	2	0	5	15

2.3.15 Seven (7) Action Level exceedances of SS and one (1) Action Level exceedance of TP were recorded in the reporting period. Eight (8) Limit Level exceedances of SS, two (2) Limit Level exceedances of TP and three (3) Limit Level exceedances of *E.Coli* of marine water quality were recorded in the reporting period.

2.3.16 The investigation findings on marine water quality exceedances were summarized on below:

2.3.17 For exceedances on 7 June 2021, Action Level exceedances (120% of Control Station) of SS at N2, FCZ1A and H4A and Limit Level exceedances (130% of Control Station) of SS at M1A and SGA were recorded. With reference to the baseline monitoring results, the SS values measured at N2, FCZ1A, H4A, M1A and SGA on 7 June 2021 were within the baseline results and well below the mean of baseline. The SS measured at effluent quality was 3mg/L and well below the effluent quality's Action/Limit Level.

2.3.18 For exceedances on 28 June 2021, Action Level exceedance at FCZ1A and Limit Level exceedances of SS at N1, FCZ1B, H4A and SGA; Action Level exceedance of TP at SGA and Limit Level exceedances of TP at N1 and H1A and Limit Level exceedances of *E.Coli* at H4A, H1A and SGA were recorded. The SS, TP and *E.Coli* measured at H4A (as upstream station) was recorded similar high value with N1, FCZ1A, FCZ1B, H1A and SGA. The SS, TP and *E.Coli* measured at effluent quality was 4mg/L, 1.15mg/L and 350cfu/100ml respectively which were well below the effluent quality's Action/Limit Level.

2.3.19 For exceedances on 30 June 2021, Action Level exceedances (120% of Control Station) of SS at H1A and SGA and Limit Level exceedances (130% of Control Station) of SS at N2, M1A and H4A were recorded. With reference to the baseline monitoring results, the SS values measured at N2, H4A, H1A, M1A and SGA on 30 June 2021 were within the baseline results and similar with the mean of baseline.

2.3.20 Based on the investigation findings, the exceedances of SS recorded on 7 and 30 June 2021 were similar to baseline and exceedances of SS, TP and *E.Coli* record on 28 June 2021 might considered due to external factor (i.e. heavy rainstorm in the morning). Therefore, the exceedances were considered not related to the Project.

2.3.21 Two (2) non-compliances (Limit Level exceedances) of *E.Coli* of effluent quality was recorded on 27 and 30 June 2021. According to the plant operator, no abnormalities were observed from the UV disinfection system on 27 and 30 June 2021. The plant operator was reminded to check the plant operation properly and voice out to the engineer immediately in case of any issues observed.

2.3.22 The event and action plan is annexed in **Appendix H**.

2.4 Waste Management Status

2.4.1 Auditing of waste management practices during regular site inspections will confirm that the waste generated during construction are properly, stored, handled and disposed of. The construction Contractor(s) will be responsible for the implementation of any mitigation measures to reduce waste or redress issues arising from the waste materials.

2.4.2 The C&D waste under this contract should be disposal of at North East New Territories (NENT) Landfill and Tseung Kwan O Area 137 Fill Bank (TKO137FB).

2.4.3 Monthly summary of waste flow table is detailed in **Appendix I**.

2.5 Landscape and Visual

2.5.1 Inspections of the implementation of landscape and visual mitigation measures were conducted on 2, 16 and 30 June 2021. The observations and recommendations made during the audit sessions are summarized in **Table 4.1**. A summary of the mitigation measures implementation schedule is provided in **Appendix J**. The event and action plan is annexed in **Appendix H**.

3 IMPLEMENTATION STATUS ON ENVIRONMENTAL PROTECTION REQUIREMENTS

3.1.1 The Contractor has implemented environmental mitigation measures and requirements as stated in the EIA Report, the EP and EM&A Manual. The implementation status of the environmental mitigation measures of the reporting period is summarized in **Appendix J**. The implementation of the key mitigation measures during the reporting period is presented in **Appendix K**.

4 ENVIRONMENTAL SITE INSPECTION AND AUDIT

4.1 Site Inspection

4.1.1 Site Inspections were carried out on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures for the Project. A summary of the mitigation measures implementation schedule is provided in **Appendix J**.

4.1.2 In the reporting period, 5 site inspections were carried out on 2, 9, 16, 23 and 30 June 2021. A joint site inspection with IEC was carried out on 30 June 2021. No non-compliance was recorded during the site inspections. Details of observations recorded during the site inspections are presented in **Table 4.1**.

Table 4.1 Observations and Recommendations of Site Inspection

Parameters	Date	Observations and Recommendations	Follow up
Water Quality	23 Jun 21	Silty water was observed at the outlet of wastewater treatment facility. The Contractor should well maintain and check the facility more frequently to ensure the wastewater is treated properly.	The item was rectified by Contractor on 24 Jun 2021.
Air Quality	N/A	N/A	N/A
Noise	N/A	N/A	N/A
Waste/ Chemical Management	16 Jun 21	A temporary waste skip provided for storage construction waste was observed. However, the Contractor was reminded to segregate the construction waste before disposal properly	The item was rectified by Contractor on 21 Jun 2021.
Landscape & Visual	N/A	N/A	N/A
Permits/ Licenses	N/A	N/A	N/A

4.2 Summary of Complaints, Notification of Summons, Successful Prosecutions and Public Engagement Activities

4.2.1 No noise complaint related to 0700 to 1900 hours on normal weekdays, notification of summons and successful prosecution was received in the reporting period.

- 4.2.2 No public engagement activities were conducted in the reporting period.
- 4.2.3 Statistics on complaints, notifications of summons, successful prosecutions and public engagement activities are summarized in **Appendix L**.

5 ON-SITE TIME FOR ET AND IEC TEAM

- 5.1.1 According to the EP Condition 2.1 and 2.4, the minimum on-site time of at least 8 hours per week during office hours were proposed by the ET and IEC and their teams respectively in order to discharge the duties of the team of ET and IEC as stipulated in the EP and EM&A requirements of the project. The on-site time & duties of ET and IEC are summarized in **Appendix M**.

6 FUTURE KEY ISSUES

6.1 Construction Programme for the Coming Month

- 6.1.1 The major construction works for the Project in the coming month will be:

- Submarine Outfall pilot hole drilling (Land)
- Submarine Outfall pilot hole drilling (Sea)
- Sewer laying works in Shun Hing Street and Tong To Village
- Formwork erection and rebar fixing

6.2 Key Issues for the Coming Month

- 6.2.1 Potential environmental impacts due to the construction activities, including air quality, noise, water quality, waste, landscape and visual, will be monitored or reviewed. The ET will continue to implement the environmental monitoring & audit programme in accordance with the EM&A Manual and Environmental Permit requirement. The recommended environmental mitigation measures shall be implemented on site and regular inspections as required will be carried out to ensure that the environmental conditions are acceptable.
- 6.2.2 The anticipated impact of major work activities within the site and the recommended mitigation measures are shown in **Appendix K**.

6.3 Monitoring Schedule for the Coming Month

- 6.3.1 The tentative schedule for environmental monitoring in July 2021 is provided in **Appendix D**.

7 CONCLUSIONS

- 7.1.1 No Action or Limit Level exceedance of construction noise was recorded in the reporting period. No noise complaint related to 0700 to 1900 hours on normal weekdays was received in the reporting period.
- 7.1.2 Seven (7) Action Level exceedances of SS and one (1) Action Level exceedance of TP were recorded in the reporting period. Eight (8) Limit Level exceedances of SS, two (2) Limit Level exceedances of TP and three (3) Limit Level exceedances of *E.Coli* of marine water quality were recorded in the reporting period.
- 7.1.3 Based on the investigation findings, the exceedances of SS recorded on 7 and 30 June 2021 were similar to baseline and exceedances of SS, TP and *E.Coli* record on 28 June 2021 might considered due to external factor (i.e. heavy rainstorm in the morning). Therefore, the exceedances were considered not related to the Project.
- 7.1.4 Two (2) non-compliances (Limit Level exceedances) of *E.Coli* of effluent quality was recorded on 27 and 30 June 2021. According to the plant operator, no abnormalities were observed from the UV disinfection system on 27 and 30 June 2021. The plant operator was reminded to check

the plant operation properly and voice out to the engineer immediately in case of any issues observed.

- 7.1.5 No complaints related to 0700 to 1900 hours on normal weekdays, notification of summons and successful prosecution was received in the reporting period.

FIGURES



Figure 1 General Layout Plan

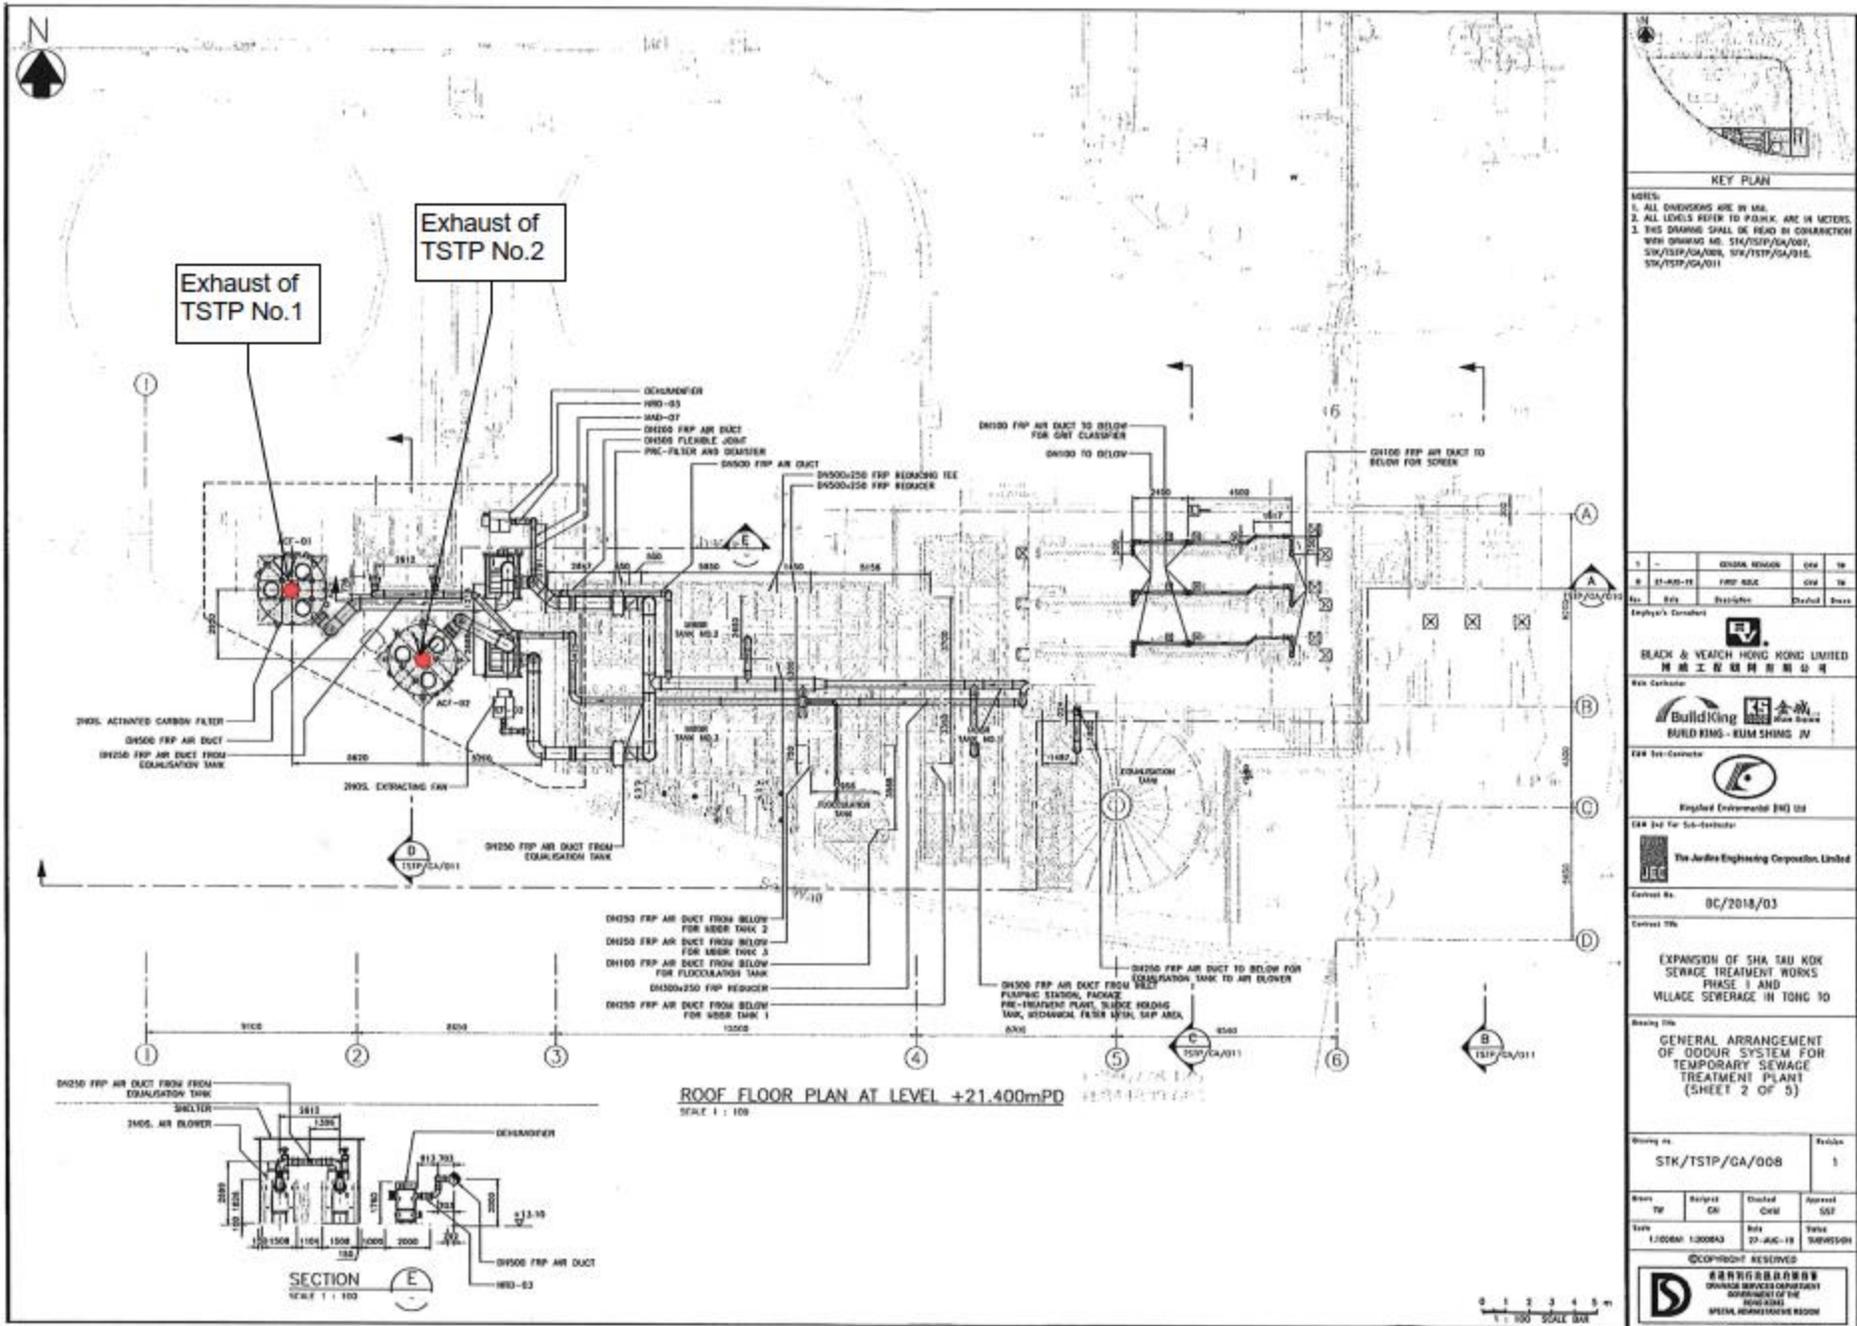


Figure 2 Locations of Odour monitoring for 1-Year Operation of TSTP

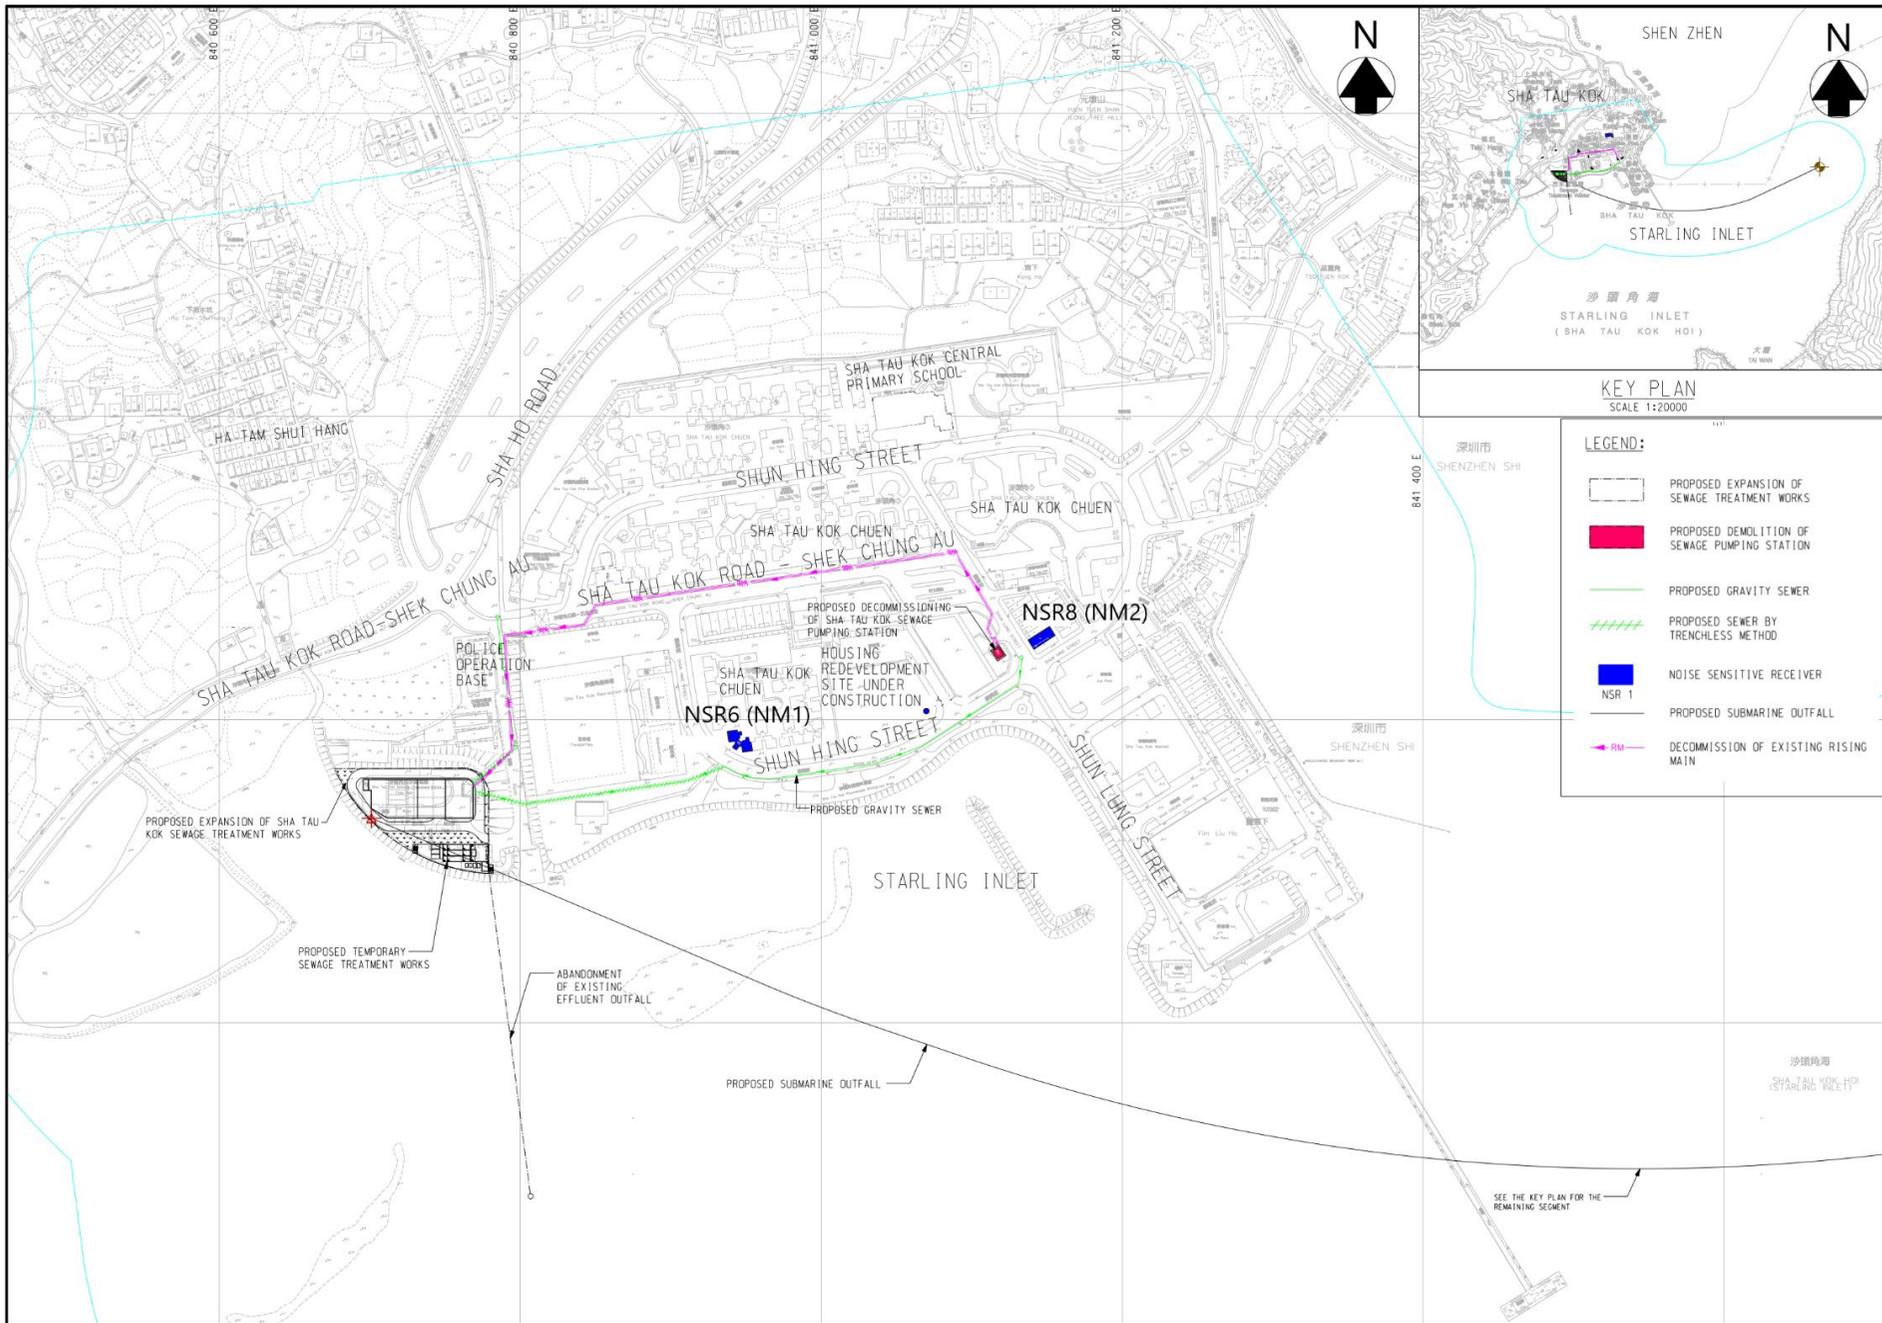


Figure 3 Location of Noise Monitoring Stations


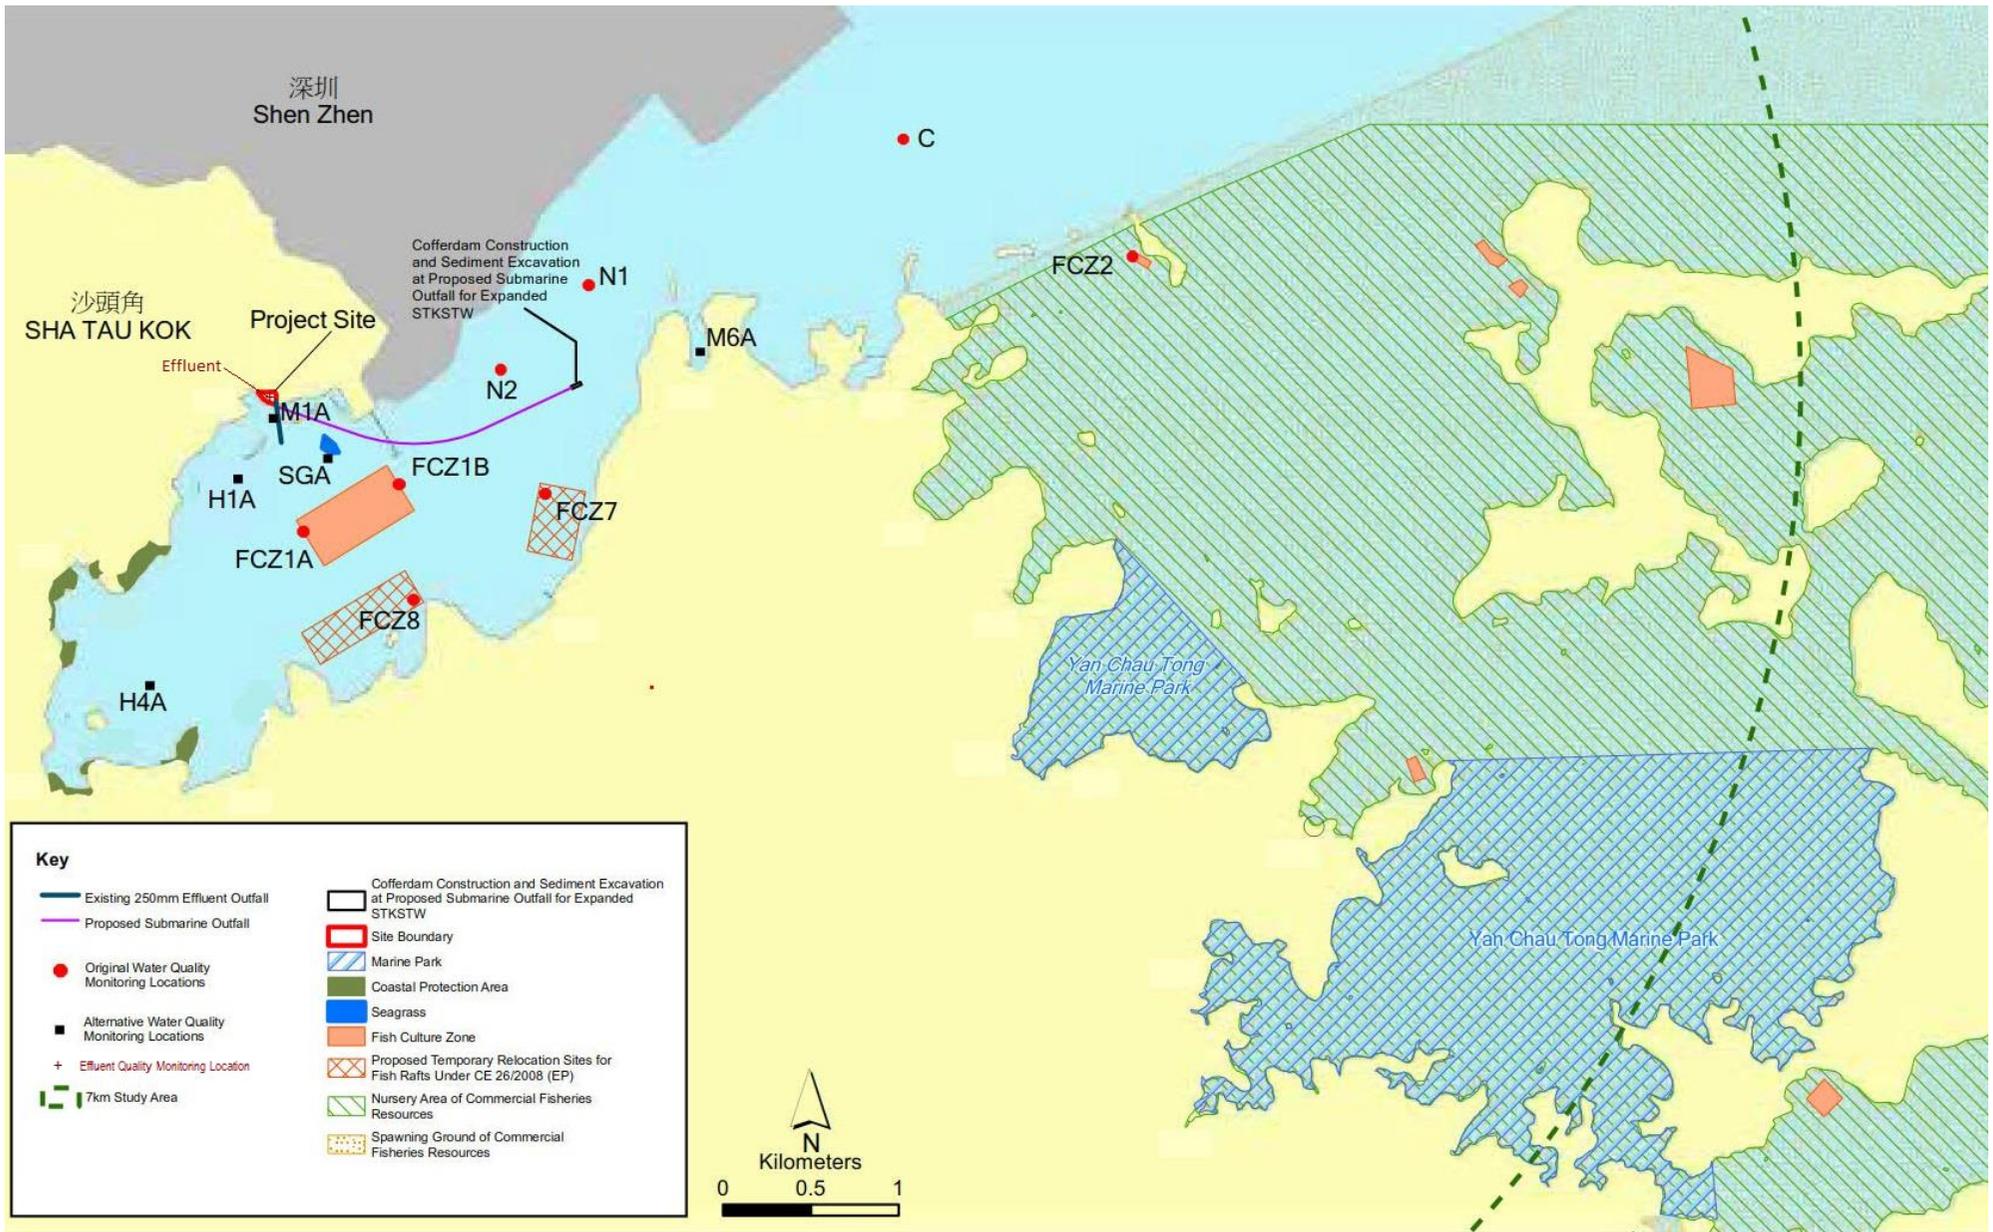


Figure 4 Location of Marine Water Quality Monitoring Stations

APPENDIX A

Project Organization Structure

Appendix A Project Organization Structure

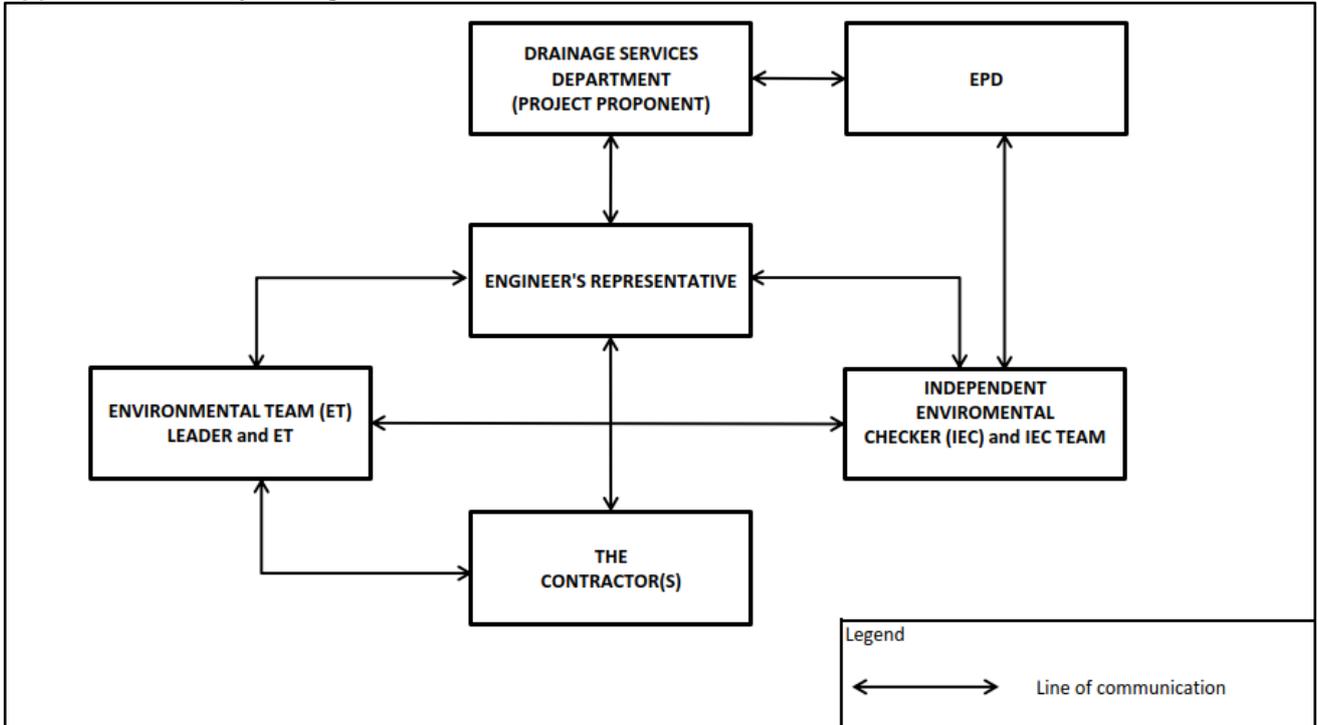

Note: Detailed key personnel contact names and telephone numbers refer to Table 1.1.

APPENDIX B

Construction Programme

APPENDIX C

Calibration Certificates of Monitoring Equipment



綜合試驗有限公司
SOILS & MATERIALS ENGINEERING CO., LTD.
 香港新界葵涌永基路22-24號好爸爸創科大廈
 Good Ba Ba Hitech Building, Nos. 22-24 Wing Kei Road, Kwai Chung, New Territories, Hong Kong
 Tel: (852) 2873 6860 Fax: (852) 2555 7533 E-mail: smec@cigismec.com Website: www.cigismec.com



CERTIFICATE OF CALIBRATION

Certificate No.: 20CA0914 02 Page 1 of 2

Item tested

Description:	Sound Level Meter (Type 1)	Microphone
Manufacturer:	B & K	B & K
Type/Model No.:	2238	4188
Serial/Equipment No.:	2800927	2250455
Adaptors used:	-	-

Item submitted by

Customer Name: AECOM ASIA CO., LTD.
 Address of Customer: -
 Request No.: -
 Date of receipt: 14-Sep-2020

Date of test: 19-Sep-2020

Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable to:
Multifunction sound calibrator	B&K 4226	2288444	23-Aug-2021	CIGISMEC
Signal generator	DS 360	81227	24-Dec-2020	CEPREI

Ambient conditions

Temperature: 22 ± 1 °C
 Relative humidity: 55 ± 10 %
 Air pressure: 1000 ± 5 hPa

Test specifications

- The Sound Level Meter has been calibrated in accordance with the requirements as specified in BS 7580: Part 1: 1997 and the lab calibration procedure SMTP004-CA-152.
- The electrical tests were performed using an electrical signal substituted for the microphone which was removed and replaced by an equivalent capacitance within a tolerance of ±20%.
- The acoustic calibration was performed using an B&K 4226 sound calibrator and corrections was applied for the difference between the free-field and pressure responses of the Sound Level Meter.

Test results

This is to certify that the Sound Level Meter conforms to BS 7580: Part 1: 1997 for the conditions under which the test was performed.

Details of the performed measurements are presented on page 2 of this certificate.

Actual Measurement data are documented on worksheets.

Approved Signatory:

Feng Junqi

Date: 20-Sep-2020

Company Chop:



Comments: The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long-term stability of the instrument. The results apply to the item as received.



綜合試驗有限公司

SOILS & MATERIALS ENGINEERING CO., LTD.

香港新界葵涌永基路22-24號好爸爸創科大廈

Good Ba Ba Hitech Building, Nos. 22-24 Wing Kai Road, Kwai Chung, New Territories, Hong Kong

Tel: (852) 2873 6860 Fax: (852) 2555 7533 E-mail: smec@ciglsmec.com Website: www.ciglsmec.com



CERTIFICATE OF CALIBRATION

(Continuation Page)

Certificate No.: 20CA0914 02

Page 2 of 2

1, Electrical Tests

The electrical tests were performed using an equivalent capacitance substituted for the microphone. The results are given in below with test status and the estimated uncertainties. The "Pass" means the result of the test is inside the tolerances stated in the test specifications. The "-" means the result of test is outside these tolerances.

Test:	Subtest:	Status:	Expanded Uncertainty (dB)	Coverage Factor
Self-generated noise	A	Pass	0.3	
	C	Pass	1.0	2.1
	Lin	Pass	2.0	2.2
Linearity range for Leq	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
	Reference SPL on all other ranges	Pass	0.3	
	2 dB below upper limit of each range	Pass	0.3	
	2 dB above lower limit of each range	Pass	0.3	
Linearity range for SPL	At reference range, Step 5 dB at 4 kHz	Pass	0.3	
	A	Pass	0.3	
	C	Pass	0.3	
Frequency weightings	Lin	Pass	0.3	
	Time weightings	Single Burst Fast	Pass	0.3
	Single Burst Slow	Pass	0.3	
Peak response	Single 100µs rectangular pulse	Pass	0.3	
	R.M.S. accuracy	Crest factor of 3	Pass	0.3
Time weighting I	Single burst 5 ms at 2000 Hz	Pass	0.3	
	Repeated at frequency of 100 Hz	Pass	0.3	
Time averaging	1 ms burst duty factor 1/10 ³ at 4kHz	Pass	0.3	
	1 ms burst duty factor 1/10 ⁴ at 4kHz	Pass	0.3	
Pulse range	Single burst 10 ms at 4 kHz	Pass	0.4	
Sound exposure level	Single burst 10 ms at 4 kHz	Pass	0.4	
Overload indication	SPL	Pass	0.3	
	Leq	Pass	0.4	

2, Acoustic tests

The complete sound level meter was calibrated on the reference range using a B&K 4226 acoustic calibrator with 1000Hz and SPL 94 dB. The sensitivity of the sound level meter was adjusted. The test result at 125 Hz and 8000 Hz are given in below with test status and the estimated uncertainties.


Test:	Subtest	Status	Expanded Uncertainty (dB)	Coverage Factor
Acoustic response	Weighting A at 125 Hz	Pass	0.3	
	Weighting A at 8000 Hz	Pass	0.5	

3, Response to associated sound calibrator

N/A

The expanded uncertainties have been calculated in accordance with the ISO Publication "Guide to the expression of uncertainty in measurement", and gives an interval estimated to have a level of confidence of 95%. A coverage factor of 2 is assumed unless explicitly stated.

End -

Calibrated by:  Checked by: 

Date: 19-Sep-2020 Date: 20-Sep-2020

The standard(s) and equipment used in the calibration are traceable to national or international recognised standards and are calibrated on a schedule to maintain the required accuracy level.



綜合試驗有限公司

SOILS & MATERIALS ENGINEERING CO., LTD.

香港新界葵涌永基路22-24號好爸爸創科大廈
Good Ba Ba Hitech Building, Nos. 22-24 Wing Kei Road, Kwai Chung, New Territories, Hong Kong
Tel: (852) 2873 6860 Fax: (852) 2555 7533 E-mail: smec@cigismec.com Website: www.cigismec.com



CERTIFICATE OF CALIBRATION

Certificate No.: 21CA0401 02

Page: 1 of 2

Item tested

Description: Acoustical Calibrator (Class 1)
Manufacturer: B & K
Type/Model No.: 4231
Serial/Equipment No.: 3006428
Adaptors used: -

Item submitted by

Customer: AECOM
Address of Customer: -
Request No.: -
Date of receipt: 01-Apr-2021

Date of test: 05-Apr-2021

Reference equipment used in the calibration

Description:	Model:	Serial No.	Expiry Date:	Traceable to:
Lab standard microphone	B&K 4180	2412857	11-May-2021	SCL
Preamplifier	B&K 2673	2743150	03-Jun-2021	CEPREI
Measuring amplifier	B&K 2610	2346941	03-Jun-2021	CEPREI
Signal generator	DS 360	33873	19-May-2021	CEPREI
Digital multi-meter	34401A	US36087050	19-May-2021	CEPREI
Audio analyzer	8903B	GB41300350	18-May-2021	CEPREI
Universal counter	53132A	MY40003662	18-May-2021	CEPREI

Ambient conditions

Temperature: 22 ± 1 °C
Relative humidity: 55 ± 10 %
Air pressure: 1010 ± 5 hPa

Test specifications


- The Sound Calibrator has been calibrated in accordance with the requirements as specified in IEC 60942 1997 Annex B and the lab calibration procedure SMTP004-CA-156.
- The calibrator was tested with its axis vertical facing downwards at the specific frequency using insert voltage technique.
- The results are rounded to the nearest 0.01 dB and 0.1 Hz and have not been corrected for variations from a reference pressure of 1013.25 hectoPascals as the maker's information indicates that the instrument is insensitive to pressure changes.

Test results

This is to certify that the sound calibrator conforms to the requirements of annex B of IEC 60942: 1997 for the conditions under which the test was performed. This does not imply that the sound calibrator meets IEC 60942 under any other conditions.

Details of the performed measurements are presented on page 2 of this certificate.

Approved Signatory:


Feng Junqi

Date: 07-Apr-2021

Company Chop:



Comments: The results reported in this certificate refer to the condition of the instrument on the date of calibration and carry no implication regarding the long term stability of the instrument. The results apply to the item as received.



ALS Technichem (HK) Pty Ltd
11/F, Chung Shun Knitting Centre
1-3 Wing Yip Street, Kwai Chung
N.T., Hong Kong
T: +852 2610 1044 | F: +852 2610 2021

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT:	MR MIKE SHEK	WORK ORDER:	HK2113295
CLIENT:	AECOM ASIA COMPANY LIMITED	SUB- BATCH:	0
ADDRESS:	13/F, TOWER 2, GRAND CENTRAL PLAZA, 138 SHATIN RURAL COMMITTEE ROAD, SHATIN, HONG KONG	LABORATORY:	HONG KONG
		DATE RECEIVED:	08- Apr- 2021
		DATE OF ISSUE:	10- Apr- 2021

SPECIFIC COMMENTS

Equipment information (Brand name, Model No., Serial No. and Equipment No.) is provided by client. The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

The "Tolerance Limit" quoted is the acceptance criteria applicable for similar equipment used by the laboratory or quoted from relevant international standards.

The "Next Calibration Date" is recommended according to best practice principle as practised by the laboratory or quoted from relevant international standards.

The validity of equipment/ meter performance only applies to the result(s) stated in the report.

Equipment Type:	Multifunctional Meter
Service Nature:	Performance Check
Scope:	Conductivity, Dissolved Oxygen, pH Value, Turbidity, Salinity and Temperature
Brand Name/ Model No.:	[YSI]/ [6820 V2]
Serial No./ Equipment No.:	[12A101545]/ [W.026.35]
Date of Calibration:	08- April- 2021

GENERAL COMMENTS

This is the Final Report and supersedes any preliminary report with this batch number.

Mr Chan Siu Ming, Vico
Manager - Inorganic

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION



WORK ORDER: HK2113295
SUB-BATCH: 0
DATE OF ISSUE: 10-Apr-2021
CLIENT: AECOM ASIA COMPANY LIMITED

Equipment Type: Multifunctional Meter
Brand Name/ Model No.: [YSI]/ [6820 V2]
Serial No./ Equipment No.: [12A101545]/ [W.026.35]
Date of Calibration: 08-April-2021 Date of Next Calibration: 08-July-2021

PARAMETERS:

Conductivity Method Ref: APHA (21st edition), 2510B

Expected Reading ($\mu\text{S}/\text{cm}$)	Displayed Reading ($\mu\text{S}/\text{cm}$)	Tolerance (%)
146.9	156.0	+6.2
6667	6672	+0.1
12890	13003	+0.9
58670	58886	+0.4
	Tolerance Limit (%)	± 10.0

Dissolved Oxygen Method Ref: APHA (21st edition), 4500O: G

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)
2.90	2.96	+0.06
5.05	5.19	+0.14
7.55	7.60	+0.05
	Tolerance Limit (mg/L)	± 0.20

pH Value Method Ref: APHA (21st edition), 4500H: B

Expected Reading (pH unit)	Displayed Reading (pH unit)	Tolerance (pH unit)
4.0	4.07	+0.07
7.0	7.04	+0.04
10.0	9.98	-0.02
	Tolerance Limit (pH unit)	± 0.20

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

Mr Chan Siu Ming, Vico
Manager - Inorganic

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION



WORK ORDER: HK2113295
SUB- BATCH: 0
DATE OF ISSUE: 10- Apr- 2021
CLIENT: AECOM ASIA COMPANY LIMITED

Equipment Type: Multifunctional Meter
Brand Name/ Model No.: [YSI]/ [6820 V2]
Serial No./ Equipment No.: [12A101545]/ [W.026.35]
Date of Calibration: 08- April- 2021 Date of Next Calibration: 08- July- 2021

PARAMETERS:

Turbidity

Method Ref: APHA (21st edition), 2130B

Expected Reading (NTU)	Displayed Reading (NTU)	Tolerance (%)
0	0.1	--
4	4.0	+0.0
10	10.4	+4.0
20	20.6	+3.0
50	50.5	+1.0
100	97.5	-2.5
	Tolerance Limit (%)	±10.0

Salinity

Method Ref: APHA (21st edition), 2520B

Expected Reading (ppt)	Displayed Reading (ppt)	Tolerance (%)
0	0.00	--
10	10.01	+0.1
20	19.38	-3.1
30	29.86	-0.5
	Tolerance Limit (%)	±10.0

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

Mr Chan Siu Ming, Vico
Manager - Inorganic

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION



WORK ORDER: HK2113295
SUB- BATCH: 0
DATE OF ISSUE: 10- Apr- 2021
CLIENT: AECOM ASIA COMPANY LIMITED

Equipment Type: Multifunctional Meter
Brand Name/ Model No.: [YSI]/ [6820 V2]
Serial No.: [12A101545]/ [W.026.35]
Equipment No.: [12A101545]/ [W.026.35]
Date of Calibration: 08- April- 2021 **Date of Next Calibration:** 08- July- 2021

PARAMETERS:

Temperature

Method Ref: Section 6 of International Accreditation New Zealand Technical Guide No. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

Expected Reading (°C)	Displayed Reading (°C)	Tolerance (°C)
10.5	10.25	- 0.3
20.0	19.97	- 0.0
40.0	40.04	+ 0.0
	Tolerance Limit (°C)	± 2.0

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

Mr Chan Siu Ming, Vico
Manager - Inorganic



ALS Technichem (HK) Pty Ltd
11/F, Chung Shun Knitting Centre
1-3 Wing Yip Street, Kwai Chung
N.T., Hong Kong
T: +852 2610 1044 | F: +852 2610 2021

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT:	MIKE SHEK	WORK ORDER:	HK2112651
CLIENT:	AECOM ASIA COMPANY LIMITED	SUB- BATCH:	0
ADDRESS:	1501- 10, 15/F, TOWER 1, GRAND CENTRAL PLAZA, 138 SHATIN RURAL COMMITTEE ROAD, SHATIN, NEW TERRITORIES, HONG KONG	LABORATORY:	HONG KONG
		DATE RECEIVED:	31- Mar- 2021
		DATE OF ISSUE:	10- Apr- 2021

SPECIFIC COMMENTS

Equipment information (Brand name, Model No., Serial No. and Equipment No.) is provided by client. The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

The "Tolerance Limit" quoted is the acceptance criteria applicable for similar equipment used by the laboratory or quoted from relevant international standards.

The "Next Calibration Date" is recommended according to best practice principle as practised by the laboratory or quoted from relevant international standards.

The validity of equipment/ meter performance only applies to the result(s) stated in the report.

Equipment Type:	Multifunctional Meter
Service Nature:	Performance Check
Scope:	Conductivity, Dissolved Oxygen, Salinity and Temperature
Brand Name/ Model No.:	[YSI]/ [85D]
Serial No./ Equipment No.:	[04G12690 AB]/ [N/A]
Date of Calibration:	09- April- 2021

GENERAL COMMENTS

This is the Final Report and supersedes any preliminary report with this batch number.

Mr Chan Siu Ming, Vico
Manager - Inorganic

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION



WORK ORDER: HK2112651
SUB- BATCH: 0
DATE OF ISSUE: 10- Apr- 2021
CLIENT: AECOM ASIA COMPANY LIMITED

Equipment Type: Multifunctional Meter
Brand Name/ Model No.: [YSI]/ [85D]
Serial No./ Equipment No.: [04G12690 AB]/ [N/A]
Date of Calibration: 09- April- 2021 Date of Next Calibration: 09- July- 2021

PARAMETERS:

Conductivity Method Ref: APHA (21st edition), 2510B

Expected Reading ($\mu\text{S}/\text{cm}$)	Displayed Reading ($\mu\text{S}/\text{cm}$)	Tolerance (%)
146.9	141.0	- 4.0
6667	6610	- 0.9
12890	12600	- 2.2
58670	57800	- 1.5
	Tolerance Limit (%)	± 10.0

Dissolved Oxygen Method Ref: APHA (21st edition), 4500O: G

Expected Reading (mg/L)	Displayed Reading (mg/L)	Tolerance (mg/L)
2.54	2.49	- 0.05
5.45	5.52	+ 0.07
7.92	7.79	- 0.13
	Tolerance Limit (mg/L)	± 0.20

Salinity Method Ref: APHA (21st edition), 2520B

Expected Reading (ppt)	Displayed Reading (ppt)	Tolerance (%)
0	0.0	--
10	9.9	- 1.0
20	19.2	- 4.0
30	29.4	- 2.0
	Tolerance Limit (%)	± 10.0

Remark: "Displayed Reading" presents the figures shown on Item under calibration / checking regardless of equipment precision or significant figures.

Mr Chan Siu Ming, Vico
Manager - Inorganic

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION



WORK ORDER: HK2112651
SUB- BATCH: 0
DATE OF ISSUE: 10- Apr- 2021
CLIENT: AECOM ASIA COMPANY LIMITED

Equipment Type: Multifunctional Meter
Brand Name/ [YSI]/ [85D]
Model No.:
Serial No./ [04G12690 AB]/ [N/A]
Equipment No.:
Date of Calibration: 09- April- 2021

Date of Next Calibration: 09- July- 2021

PARAMETERS:

Temperature

Method Ref: Section 6 of International Accreditation New Zealand Technical Guide No. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

Expected Reading (°C)	Displayed Reading (°C)	Tolerance (°C)
9.8	9.8	+ 0.0
21.6	21.3	- 0.3
39.6	40.1	+ 0.5
	Tolerance Limit (°C)	± 2.0

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

Mr Chan Siu Ming, Vico
Manager - Inorganic



ALS Technichem (HK) Pty Ltd
11/F, Chung Shun Knitting Centre
1-3 Wing Yip Street, Kwai Chung
N.T., Hong Kong
T: +852 2610 1044 | F: +852 2610 2021

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT:	MIKE SHEK	WORK ORDER:	HK2112654
CLIENT:	AECOM ASIA COMPANY LIMITED	SUB- BATCH:	0
ADDRESS:	1501- 10, 15/F, TOWER 1, GRAND CENTRAL PLAZA, 138 SHATIN RURAL COMMITTEE ROAD, SHATIN, NEW TERRITORIES, HONG KONG	LABORATORY:	HONG KONG
		DATE RECEIVED:	31- Mar- 2021
		DATE OF ISSUE:	10- Apr- 2021

SPECIFIC COMMENTS

Equipment information (Brand name, Model No., Serial No. and Equipment No.) is provided by client. The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source.

The "Tolerance Limit" quoted is the acceptance criteria applicable for similar equipment used by the laboratory or quoted from relevant international standards.

The "Next Calibration Date" is recommended according to best practice principle as practised by the laboratory or quoted from relevant international standards.

The validity of equipment/ meter performance only applies to the result(s) stated in the report.

Equipment Type:	Turbidimeter
Service Nature:	Performance Check
Scope:	Turbidity
Brand Name/ Model No.:	[WTW]/ [Turb 430T]
Serial No./ Equipment No.:	[13451648]/ [N/A]
Date of Calibration:	09- April- 2021

GENERAL COMMENTS

This is the Final Report and supersedes any preliminary report with this batch number.

**Mr Chan Slu Ming, Vico
Manager - Inorganic**

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION



WORK ORDER: HK2112654
SUB- BATCH: 0
DATE OF ISSUE: 10- Apr- 2021
CLIENT: AECOM ASIA COMPANY LIMITED

Equipment Type: Turbidimeter
Brand Name/ Model No.: [WTW]/ [Turb 430T]
Serial No./ Equipment No.: [13451648]/ [N/A]
Date of Calibration: 09- April- 2021 **Date of Next Calibration:** 09- July- 2021

PARAMETERS:

Turbidity

Method Ref: APHA (21st edition), 2130B

Expected Reading (NTU)	Displayed Reading (NTU)	Tolerance (%)
0	0.22	--
4	4.21	+ 5.3
40	39.1	- 2.3
80	77.9	- 2.6
400	387	- 3.3
800	796	- 0.5
	Tolerance Limit (%)	± 10.0

Remark: "Displayed Reading" presents the figures shown on Item under calibration / checking regardless of equipment precision or significant figures.

Mr Chan Siu Ming, Vico
Manager - Inorganic



ALS Technichem (HK) Pty Ltd
11/F, Chung Shun Knitting Centre
1-3 Wing Yip Street, Kwai Chung
N.T., Hong Kong
T: +852 2610 1044 | F: +852 2610 2021

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION

CONTACT:	MIKE SHEK	WORK ORDER:	HK2112653
CLIENT:	AECOM ASIA COMPANY LIMITED	SUB- BATCH:	0
ADDRESS:	1501- 10, 15/F, TOWER 1, GRAND CENTRAL PLAZA, 138 SHATIN RURAL COMMITTEE ROAD, SHATIN, NEW TERRITORIES, HONG KONG	LABORATORY:	HONG KONG
		DATE RECEIVED:	31- Mar- 2021
		DATE OF ISSUE:	10- Apr- 2021

SPECIFIC COMMENTS

Equipment information (Brand name, Model No., Serial No. and Equipment No.) is provided by client. The performance of the equipment stated in this report is checked with independent reference material and results compared against a calibrated secondary source. The "Tolerance Limit" quoted is the acceptance criteria applicable for similar equipment used by the laboratory or quoted from relevant international standards. The "Next Calibration Date" is recommended according to best practice principle as practised by the laboratory or quoted from relevant international standards. The validity of equipment/ meter performance only applies to the result(s) stated in the report.

Equipment Type:	pH meter
Service Nature:	Performance Check
Scope:	pH Value and Temperature
Brand Name/ Model No.:	[WTW]/ [pH 3210]
Serial No./ Equipment No.:	[11300362]/ [W.039.07]
Date of Calibration:	09- April- 2021

GENERAL COMMENTS

This is the Final Report and supersedes any preliminary report with this batch number.

Mr Chan Siu Ming, Vico
Manager - Inorganic

This report may not be reproduced except with prior written approval from ALS Technichem (HK) Pty Ltd.

REPORT OF EQUIPMENT PERFORMANCE CHECK/CALIBRATION



WORK ORDER: HK2112653
SUB- BATCH: 0
DATE OF ISSUE: 10- Apr- 2021
CLIENT: AECOM ASIA COMPANY LIMITED

Equipment Type: pH meter
Brand Name/ Model No.: [WTW]/ [pH 3210]
Serial No./ Equipment No.: [11300362]/ [W.039.07]
Date of Calibration: 09- April- 2021
Date of Next Calibration: 09- July- 2021

PARAMETERS:

pH Value

Method Ref: APHA (21st edition), 4500H: B

Expected Reading (pH unit)	Displayed Reading (pH unit)	Tolerance (pH unit)
4.0	4.073	+0.07
7.0	7.083	+0.08
10.0	10.047	+0.05
	Tolerance Limit (pH unit)	±0.20

Temperature

Method Ref: Section 6 of International Accreditation New Zealand Technical Guide No. 3 Second edition March 2008: Working Thermometer Calibration Procedure.

Expected Reading (°C)	Displayed Reading (°C)	Tolerance (°C)
10.0	10.2	+0.2
22.0	21.6	-0.4
40.0	39.7	-0.3
	Tolerance Limit (°C)	±2.0

Remark: "Displayed Reading" presents the figures shown on item under calibration / checking regardless of equipment precision or significant figures.

Mr Chan Siu Ming, Vico
Manager - Inorganic

APPENDIX D

EM&A Monitoring Schedules

Appendix D EM&A Monitoring Schedules

**Expansion of Sha Tau Kok Sewage Treatment Works
Environmental Monitoring Schedule for June 2021**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
		1-Jun	2-Jun	3-Jun	4-Jun	5-Jun
		Noise	Water Quality Mid-flood 5:44 Mid-Ebb 18:15		Water Quality Mid-flood 8:18 Mid-Ebb 13:52	
		Effluent Quality	Effluent Quality	Effluent Quality	Effluent Quality	Effluent Quality
6-Jun	7-Jun	8-Jun	9-Jun	10-Jun	11-Jun	12-Jun
	Water Quality Mid-Ebb 10:47 Mid-flood 16:59		Water Quality Mid-flood 5:12 Mid-Ebb 12:01		Water Quality Mid-flood 6:01 Mid-Ebb 13:11 Noise	
Effluent Quality	Effluent Quality	Effluent Quality	Effluent Quality	Effluent Quality	Effluent Quality	Effluent Quality
13-Jun	14-Jun	15-Jun	16-Jun	17-Jun	18-Jun	19-Jun
	Water Quality Mid-flood 5:52 Mid-Ebb 13:25	Noise	Water Quality Mid-flood 7:15 Mid-Ebb 15:25		Water Quality Mid-flood 11:31 Mid-Ebb 18:25	
Effluent Quality	Effluent Quality	Effluent Quality	Effluent Quality	Effluent Quality	Effluent Quality	Effluent Quality
20-Jun	21-Jun	22-Jun	23-Jun	24-Jun	25-Jun	26-Jun
	Water Quality Mid-Ebb 9:16 Mid-flood 15:36 Noise		Water Quality Mid-Ebb 11:04 Mid-flood 17:40		Water Quality Mid-flood 5:55 Mid-Ebb 12:46	
Effluent Quality	Effluent Quality	Effluent Quality	Effluent Quality	Effluent Quality	Effluent Quality	Effluent Quality
27-Jun	28-Jun	29-Jun	30-Jun			
	Water Quality Mid-flood 8:04 Mid-Ebb 15:09		Water Quality Mid-flood 9:40 Mid-Ebb 16:41			
Effluent Quality	Effluent Quality	Effluent Quality	Effluent Quality			

Marine water quality at mid-flood on 28 Jun 21 was cancelled due to Black rainstorm warning was hoisted.

**Expansion of Sha Tau Kok Sewage Treatment Works
Tentative Environmental Monitoring Schedule for July 2021**

Sunday	Monday	Tuesday	Wednesday	Thursday	Friday	Saturday
				1-Jul	2-Jul	3-Jul
				Effluent Quality	Mid-Ebb 6:15 Mid-flood 11:49 Noise Effluent Quality	Effluent Quality
4-Jul	5-Jul	6-Jul	7-Jul	8-Jul	9-Jul	10-Jul
Effluent Quality	Water Quality Mid-Ebb 9:40 Mid-flood 15:58 Effluent Quality	Effluent Quality	Water Quality Mid-Ebb 11:03 Mid-flood 17:39 Effluent Quality	Noise Effluent Quality	Water Quality Mid-flood 4:52 Mid-Ebb 12:16 Effluent Quality	Effluent Quality
11-Jul	12-Jul	13-Jul	14-Jul	15-Jul	16-Jul	17-Jul
Effluent Quality	Water Quality Mid-flood 5:17 Mid-Ebb 12:35 Effluent Quality	Noise Effluent Quality	Water Quality Mid-flood 8:20 Mid-Ebb 15:32 Effluent Quality	Effluent Quality	Water Quality Mid-flood 10:20 Mid-Ebb 17:01 Effluent Quality	Effluent Quality
18-Jul	19-Jul	20-Jul	21-Jul	22-Jul	23-Jul	24-Jul
Effluent Quality	Water Quality Mid-Ebb 7:45 Mid-flood 14:10 Noise Odour Effluent Quality	Effluent Quality	Water Quality Mid-Ebb 9:52 Mid-flood 16:42 Effluent Quality		Water Quality Mid-flood 4:45 Mid-Ebb 11:44	
25-Jul	26-Jul	27-Jul	28-Jul	29-Jul	30-Jul	31-Jul
	Water Quality Mid-flood 7:15 Mid-Ebb 14:06		Water Quality Mid-flood 8:45 Mid-Ebb 15:25		Water Quality Mid-flood 10:17 Mid-Ebb 16:38 Noise	

* 1-year monitoring for Effluent Quality and Marine Water Quality for TSSTP will be completed on 21 July 2021.
The schedule is subject to change due to unforeseeable circumstances (e.g. adverse weather, etc)

APPENDIX E

Action and Limit Levels

Appendix E Action and Limit Levels

Action and Limit Levels for Marine Water Monitoring for First-year Operation of TSTP and Construction Phase

Monitoring Location	Depth Level	DO (mg/L)		Turbidity (NTU)		Salinity (ppt)		Total Suspended Solids (mg/L)		BOD ₅ (mg/L)		Total Phosphorus (mg/L)		Total Nitrogen (mg/L-N)		Ammonia Nitrogen (mg/L-N)		Total Inorganic Nitrogen (mg/L-N)		E.coli (cfu/100mL)	
		AL	LL	AL	LL	AL ^c	LL ^c	AL	LL	AL	LL	AL	LL	AL	LL	AL	LL	AL	LL	AL	LL
N1	S & M	5.36	5.34	7.5*	13.1 [^]	31.49	31.44	5*	8 [^]	3*	4 [^]	0.02*	0.02 [^]	0.50*	0.60 [^]	0.20*	0.21 [^]	0.33	0.36	536	707
	B	5.06	5.05																		
N2	S & M	5.95	5.71	4.7*	5.9 [^]	31.29	31.28	5*	6 [^]	3*	4 [^]	0.04*	0.04 [^]	0.60*	0.72 [^]	0.21*	0.26 [^]	0.35	0.48	495	529
	B	5.56	5.53																		
FCZ1B	S & M	5.10 [#]	5.00 [#]	4.5*	5.5 [^]	30.93	30.92	8*	12 [^]	6*	8 [^]	0.07*	0.08 [^]	0.60*	0.73 [^]	0.22*	0.25 [^]	0.36	0.39	600	610
	B	5.10 [#]	5.00 [#]																		
H4A	M	5.94	5.86	4.7*	4.8 [^]	30.42	30.42	8*	9 [^]	3*	3 [^]	0.06*	0.06 [^]	0.60*	0.60 [^]	0.23*	0.26 [^]	0.44	0.57	78	91
H1A	M	6.01	5.97	6.5*	6.6 [^]	30.39	30.39	14*	15 [^]	3*	3 [^]	0.03*	0.04 [^]	2.32*	2.60 [^]	0.97*	1.10 [^]	2.31	2.50	127	153
M1A	M	5.63	5.54	5.8*	6.1 [^]	30.43	30.42	9*	10 [^]	3*	3 [^]	0.04*	0.04 [^]	0.69*	0.70 [^]	1.49*	1.70 [^]	1.58	1.80	864	1385
SGA	M	6.00	5.90	6.0*	6.2 [^]	30.82	30.81	10*	11 [^]	3*	3 [^]	0.03*	0.04 [^]	0.60*	0.68 [^]	1.06*	1.20 [^]	1.08	1.26	129	138
FCZ7@	S & M	5.10 [#]	5.00 [#]	6.0*	6.4 [^]	31.13	31.1	5*	5 [^]	3*	3 [^]	0.02*	0.03 [^]	0.50*	0.56 [^]	0.21*	0.22 [^]	0.34	0.36	600	610
	B	5.10 [#]	5.00 [#]																		
FCZ8	S	5.10 [#]	5.00 [#]	5.2*	9.1 [^]	31.14	31.13	6*	7 [^]	5*	6 [^]	0.04*	0.04 [^]	0.60*	0.80 [^]	0.32*	0.62 [^]	0.41	0.70	600	610
	B	5.10 [#]	5.00 [#]																		

Remarks:

AL: Action Level; LL: Limit Level

According to the EM&A Manual, for FCZ: AL of DO is 5.1 mg/L or level at control station at same tide of the same day (whichever lower) and LL of DO is 5.0 mg/L or level at control station at same tide of the same day (whichever lower);

* Or 120% of control station's level at the same tide of the same day;

[^] Or 130% of control station's level at the same tide of the same day.

^c According to the EM&A Manual, AL of Salinity is Below 91% of baseline level or 9% less than value at any impact station compared with corresponding data from control station and LL of Salinity is Below 90% of baseline level or 10% less than value at any impact station compared with corresponding data from control station

Action and Limit Levels for Continuous Effluent Quality Monitoring for First-year Operation of TSTP

Parameter	Action Level	Limit Level
SS in mg/L	<u>TSTP</u> 20 mg/L	<u>TSTP</u> 40 mg/L
Biochemical Oxygen Demand in mg/L	<u>TSTP</u> 13.3 mg/L	<u>TSTP</u> 26.6 mg/L
Total Nitrogen in mg/L	<u>TSTP</u> 28.6 mg/L	<u>TSTP</u> 57.1 mg/L
Total Phosphorus in mg/L	<u>TSTP</u> 3.3 mg/L	<u>TSTP</u> 6.6 mg/L
E.coli in cfu/100 mL	<u>TSTP</u> 664 cfu/100ml	<u>TSTP</u> 996 cfu/100ml

APPENDIX F

Noise Monitoring Results and their Graphical Presentations

Appendix F Noise Monitoring Results and their Graphical Presentations

Construction Noise Monitoring Results

Daytime Noise Monitoring Results at NM 1 (Block 45, Sha Tau Kok Chuen)

Date	Weather Condition	Measured Noise Level for 30-min			Baseline Noise Level [BNL],	Construction Noise Level [CNL] [#] , dB(A)	Limit Level, dB(A)	Exceedance (Y/N)	
		Time	L90	L10					Leq
1-Jun-21	Fine	10:52	64.0	67.5	66.2	65	60.0	75	N
11-Jun-21	Fine	10:20	58.7	63.9	62.2	65	62.2 Measured<Baseline	75	N
15-Jun-21	Sunny	10:15	55.8	60.0	59.2	65	59.2 Measured<Baseline	75	N
21-Jun-21	Sunny	10:40	53.0	58.0	57.4	65	57.4 Measured<Baseline	75	N



Daytime Noise Monitoring Results at NM 2 (Building along Shun Lung Street)

Date	Weather Condition	Measured Noise Level for 30-min			Baseline Noise Level [BNL],	Construction Noise Level [CNL] [#] , dB(A)	Limit Level, dB(A)	Exceedance (Y/N)	
		Time	L90	L10					Leq
1-Jun-21	Fine	11:30	59.1	63.7	62.0	65	62.0 Measured<Baseline	75	N
11-Jun-21	Fine	11:05	56.5	62.4	60.8	65	60.8 Measured<Baseline	75	N
15-Jun-21	Sunny	10:25	54.5	58.0	57.1	65	57.1 Measured<Baseline	75	N
21-Jun-21	Sunny	10:05	55.7	60.1	59.0	65	59.0 Measured<Baseline	75	N

*A correction of +3 dB(A) was made to the free field measurements.

[#] CNL = $10 \log (10^{\text{MNL}/10} - 10^{\text{BNL}/10})$

Graphical Presentations of Construction Noise Monitoring Results

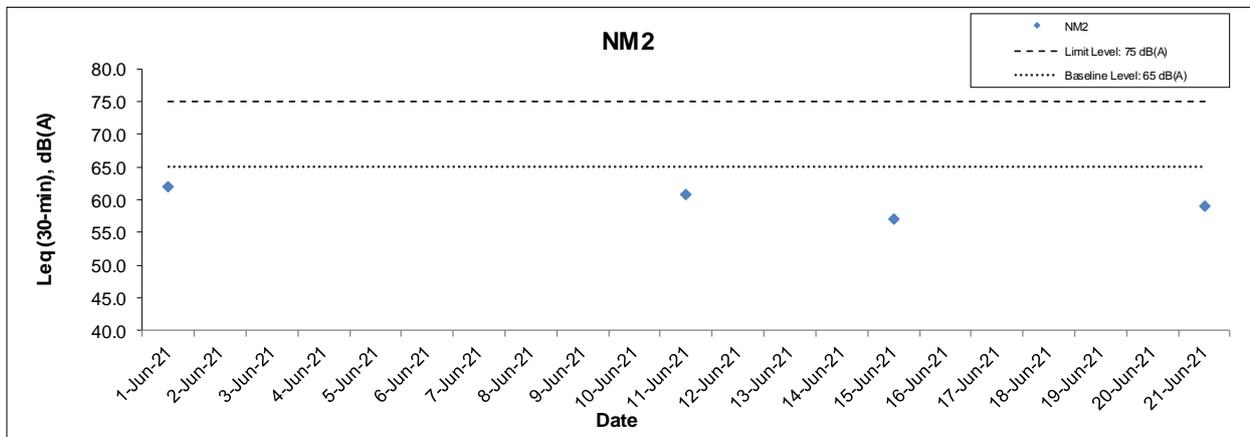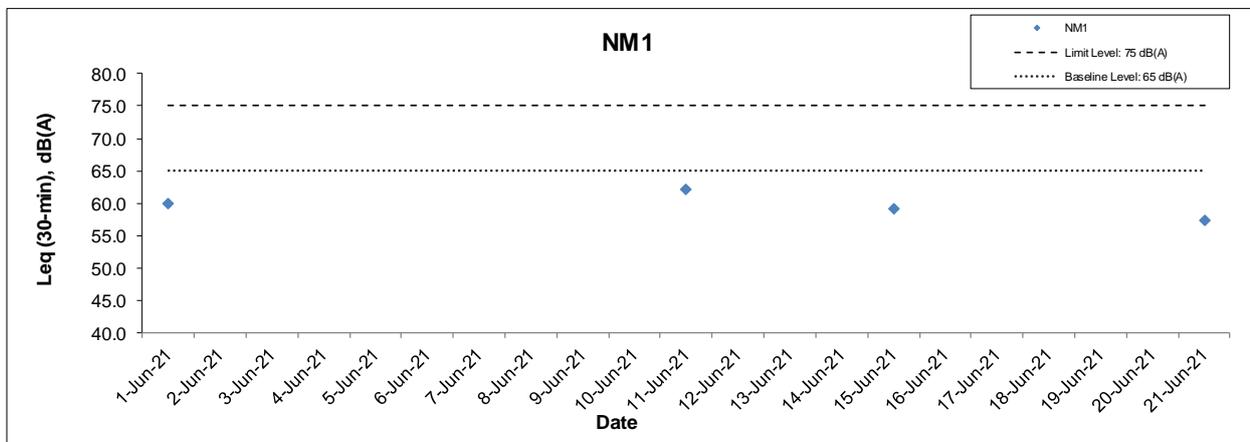

APPENDIX G

**Water Quality Monitoring Results and their Graphical
Presentations and QAQC Report**

Appendix G Water Quality Monitoring Results & their Graphical Presentations and QAQC Reports

Marine Water Quality Monitoring Results on 2-Jun-21 at Mid-Ebb tide

Date	Tidal	Weather Condition	Sea Condition	Monitoring Station	Time	Water Depth, m	Water Level	Replicate	Sampling Depth	Temperature, °C	pH	DO Saturation, %	DO, mg/L		Salinity, ppt		Turbidity, NTU		Suspended Solid, mg/L		Ammonia Nitrogen, mg/L		Total Nitrogen, mg/L		Total Inorganic Nitrogen, mg/L		Total Phosphorus, mg/L		Biochemical Oxygen Demand, mg/L		E. Coli, Cfu/100ml	
													Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA
6/2/2021	Mid-Ebb	Sunny	Moderate	C	18:51	9.5	Surface	1	1.0	27.2	8.0	98.4	7.11	7.00	36.77	37.27	1.9	2.1	3.5	3.6	<0.02	<0.02	0.42	0.39	<0.05	<0.05	0.01	0.01	1.5	1.6	4*	3
6/2/2021	Mid-Ebb	Sunny	Moderate	C			Surface	2	1.0	27.5	8.0	97.9	7.04	-	36.47	-	2.0	-	4.6	-	<0.02	-	0.41	-	<0.05	-	0.01	-	1.5	-	2*	-
6/2/2021	Mid-Ebb	Sunny	Moderate	C			Middle	1	4.8	26.0	7.9	95.9	6.89	-	37.52	-	2.0	-	3.4	-	<0.02	-	0.30	-	<0.05	-	0.01	-	1.8	-	1*	-
6/2/2021	Mid-Ebb	Sunny	Moderate	C			Middle	2	4.8	26.0	7.9	96.4	6.95	-	37.53	-	2.0	-	3.2	-	<0.02	-	0.31	-	<0.05	-	0.01	-	1.5	-	1*	-
6/2/2021	Mid-Ebb	Sunny	Moderate	C			Bottom	1	8.5	25.7	8.0	94.8	6.85	6.88	37.50	-	2.3	-	3.4	-	<0.02	-	0.46	-	<0.05	-	0.02	-	1.7	-	5*	-
6/2/2021	Mid-Ebb	Sunny	Moderate	C			Bottom	2	8.5	25.4	8.0	95.4	6.90	-	37.80	-	1.5	-	3.4	-	<0.02	-	0.44	-	<0.05	-	0.02	-	1.7	-	7*	-
6/2/2021	Mid-Ebb	Sunny	Moderate	N1	18:37	6.7	Surface	1	1.0	27.5	8.0	103.2	7.43	7.28	36.55	37.24	1.5	1.5	5.4	4.4	<0.02	<0.02	0.45	0.40	<0.05	<0.05	0.01	0.02	1.7	1.6	2*	2
6/2/2021	Mid-Ebb	Sunny	Moderate	N1			Surface	2	1.0	27.3	8.0	101.4	7.26	-	36.81	-	1.3	-	5.9	-	<0.02	-	0.44	-	<0.05	-	0.01	-	1.6	-	1*	-
6/2/2021	Mid-Ebb	Sunny	Moderate	N1			Middle	1	3.4	26.8	8.0	100.4	7.18	-	37.34	-	1.6	-	3.9	-	<0.02	-	0.30	-	<0.05	-	0.02	-	1.5	-	3*	-
6/2/2021	Mid-Ebb	Sunny	Moderate	N1			Middle	2	3.4	26.5	8.0	100.2	7.23	-	37.45	-	1.4	-	4.0	-	<0.02	-	0.32	-	<0.05	-	0.02	-	1.8	-	2*	-
6/2/2021	Mid-Ebb	Sunny	Moderate	N1			Bottom	1	5.7	25.5	8.0	96.4	6.96	7.00	37.71	-	1.6	-	3.8	-	<0.02	-	0.43	-	<0.05	-	0.01	-	1.5	-	2*	-
6/2/2021	Mid-Ebb	Sunny	Moderate	N1			Bottom	2	5.7	25.7	8.0	97.7	7.04	-	37.60	-	1.4	-	3.4	-	<0.02	-	0.44	-	<0.05	-	0.02	-	1.6	-	4*	-
6/2/2021	Mid-Ebb	Sunny	Moderate	FCZ1A	17:42	3.3	Surface	1	1.0	27.5	8.1	111.4	7.96	7.98	36.60	36.89	1.7	1.7	3.0	2.6	-	-	-	-	-	-	-	-	-	-	-	-
6/2/2021	Mid-Ebb	Sunny	Moderate	FCZ1A			Surface	2	1.0	27.3	8.1	111.6	7.99	-	36.88	-	1.8	-	2.4	-	-	-	-	-	-	-	-	-	-	-	-	-
6/2/2021	Mid-Ebb	Sunny	Moderate	FCZ1A			Bottom	1	2.3	27.2	8.1	108.8	7.80	7.79	37.09	-	1.8	-	3.0	-	-	-	-	-	-	-	-	-	-	-	-	-
6/2/2021	Mid-Ebb	Sunny	Moderate	FCZ1A			Bottom	2	2.3	27.3	8.1	108.3	7.77	-	36.97	-	1.6	-	2.1	-	-	-	-	-	-	-	-	-	-	-	-	-
6/2/2021	Mid-Ebb	Sunny	Moderate	FCZ1B	18:10	4.5	Surface	1	1.0	27.3	8.0	103.4	7.41	7.48	36.60	36.94	1.8	1.6	3.3	3.2	<0.02	<0.02	0.45	0.45	<0.05	<0.05	0.01	0.02	1.7	1.6	1*	2
6/2/2021	Mid-Ebb	Sunny	Moderate	FCZ1B			Surface	2	1.0	27.1	8.0	104.9	7.54	-	36.92	-	1.5	-	2.4	-	<0.02	-	0.47	-	<0.05	-	0.02	-	1.7	-	2*	-
6/2/2021	Mid-Ebb	Sunny	Moderate	FCZ1B			Bottom	1	3.5	27.0	8.0	103.3	7.43	7.42	37.07	-	1.7	-	3.0	-	<0.02	-	0.43	-	<0.05	-	0.01	-	1.5	-	3*	-
6/2/2021	Mid-Ebb	Sunny	Moderate	FCZ1B			Bottom	2	3.5	26.9	8.1	103.0	7.40	-	37.18	-	1.5	-	4.1	-	<0.02	-	0.44	-	<0.05	-	0.02	-	1.6	-	2*	-
6/2/2021	Mid-Ebb	Sunny	Moderate	H4A	17:56	1.8	Middle	1	0.9	27.6	8.1	106.9	7.64	7.56	36.16	36.26	1.7	1.6	5.1	5.4	<0.02	<0.02	0.43	0.44	<0.05	<0.05	0.02	0.02	1.4	1.9	5*	4
6/2/2021	Mid-Ebb	Sunny	Moderate	H4A			Middle	2	0.9	27.6	8.1	104.4	7.48	-	36.35	-	1.5	-	5.6	-	<0.02	-	0.45	-	<0.05	-	0.01	-	2.3	-	3*	-
6/2/2021	Mid-Ebb	Sunny	Moderate	H1A	17:28	1.6	Middle	1	0.8	27.7	8.1	115.1	8.22	8.24	36.05	36.08	1.7	1.7	3.3	3.5	<0.02	<0.02	0.40	0.41	<0.05	<0.05	0.01	0.02	1.6	1.5	2*	3
6/2/2021	Mid-Ebb	Sunny	Moderate	H1A			Middle	2	0.8	27.6	8.1	115.5	8.26	-	36.10	-	1.6	-	3.6	-	<0.02	-	0.42	-	<0.05	-	0.02	-	1.4	-	3*	-
6/2/2021	Mid-Ebb	Sunny	Moderate	M1A	17:15	1.2	Middle	1	0.6	27.6	8.1	111.5	7.97	8.02	36.06	36.06	1.5	1.5	3.0	3.0	<0.02	<0.02	0.45	0.43	<0.05	<0.05	0.02	0.02	1.3	1.4	3*	3
6/2/2021	Mid-Ebb	Sunny	Moderate	M1A			Middle	2	0.6	27.6	8.1	113.0	8.06	-	36.06	-	1.5	-	3.0	-	<0.02	-	0.40	-	<0.05	-	0.01	-	1.5	-	2*	-
6/2/2021	Mid-Ebb	Sunny	Moderate	SGA	17:03	1.0	Middle	1	0.5	27.7	8.1	110.1	7.88	7.87	36.01	36.05	1.6	1.6	2.6	2.9	<0.02	<0.02	0.43	0.43	<0.05	<0.05	0.02	0.02	1.4	1.5	4*	4
6/2/2021	Mid-Ebb	Sunny	Moderate	SGA			Middle	2	0.5	27.6	8.1	108.9	7.86	-	36.09	-	1.5	-	3.2	-	<0.02	-	0.43	-	<0.05	-	0.01	-	1.5	-	4*	-

**DA - Depth-averaged
Marine Water Quality Monitoring Results on 2-Jun-21 at Mid-Flood tide**

Date	Tidal	Weather Condition	Sea Condition	Monitoring Station	Time	Water Depth, m	Water Level	Replicate	Sampling Depth	Temperature, °C	pH	DO Saturation, %	DO, mg/L		Salinity, ppt		Turbidity, NTU		Suspended Solid, mg/L		Ammonia Nitrogen, mg/L		Total Nitrogen, mg/L		Total Inorganic Nitrogen, mg/L		Total Phosphorus, mg/L		Biochemical Oxygen Demand, mg/L		E. Coli, Cfu/100ml	
													Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA
6/2/2021	Mid-Flood	Sunny	Moderate	C	4:20	9.3	Surface	1	1.0	27.4	7.9	104.2	7.47	7.21	36.37	37.12	2.0	2.2	1.9	2.3	-	-	-	-	-	-	-	-	-	-	-	-
6/2/2021	Mid-Flood	Sunny	Moderate	C			Surface	2	1.0	27.7	8.0	105.6	7.55	-	35.86	-	2.0	-	2.0	-	-	-	-	-	-	-	-	-	-	-	-	-
6/2/2021	Mid-Flood	Sunny	Moderate	C			Middle	1	4.7	26.1	7.8	96.1	6.95	-	37.53	-	2.2	-	2.5	-	-	-	-	-	-	-	-	-	-	-	-	-
6/2/2021	Mid-Flood	Sunny	Moderate	C			Middle	2	4.7	26.2	7.8	95.2	6.87	-	37.49	-	2.1	-	2.0	-	-	-	-	-	-	-	-	-	-	-	-	-
6/2/2021	Mid-Flood	Sunny	Moderate	C			Bottom	1	8.3	25.2	7.8	91.6	6.65	6.68	37.74	-	2.5	-	2.3	-	-	-	-	-	-	-	-	-	-	-	-	-
6/2/2021	Mid-Flood	Sunny	Moderate	C			Bottom	2	8.3	25.1	7.8	92.6	6.70	-	37.71	-	2.4	-	2.8	-	-	-	-	-	-	-	-	-	-	-	-	-
6/2/2021	Mid-Flood	Sunny	Moderate	N2	4:47	5.4	Surface	1	1.0	27.7	8.0	108.0	7.71	7.76	36.05	36.75	1.6	1.6	2.3	2.4	-	-	-	-	-	-	-	-	-	-	-	-
6/2/2021	Mid-Flood	Sunny	Moderate	N2			Surface	2	1.0	27.4	8.0	109.0	7.81	-	36.48	-	1.6	-	2.1	-	-	-	-	-	-	-	-	-	-	-	-	-
6/2/2021	Mid-Flood	Sunny	Moderate	N2			Bottom	1	4.4	26.6	8.0	105.7	7.57	7.60	37.38	-	1.6	-	2.8	-	-	-	-	-	-	-	-	-	-	-	-	-
6/2/2021	Mid-Flood	Sunny	Moderate	N2			Bottom	2	4.4	26.9	8.0	106.0	7.62	-	37.09	-	1.6	-	2.3	-	-	-	-	-	-	-	-	-	-	-	-	-
6/2/2021	Mid-Flood	Sunny	Moderate	FCZ1A	5:13	3.4	Surface	1	1.0	27.5	8.1	115.3	8.21	8.22	36.41	36.49	1.6	1.6	2.1	2.5	-	-	-	-	-	-	-	-	-	-	-	
6/2/2021	Mid-Flood	Sunny	Moderate	FCZ1A			Surface	2	1.0	27.7	8.1	115.3	8.22	-	35.97	-	1.5	-	3.0	-	-	-	-	-	-	-	-	-	-	-	-	-
6/2/2021	Mid-Flood	Sunny</																														

Marine Water Quality Monitoring Results on 4-Jun-21 at Mid-Ebb tide

Date	Tidal	Weather Condition	Sea Condition	Monitoring Station	Time	Water Depth, m	Water Level	Replicate	Sampling Depth	Temperature, °C	pH	DO Saturation, %	DO, mg/L		Salinity, ppt		Turbidity, NTU		Suspended Solid, mg/L		Ammonia Nitrogen, mg/L		Total Nitrogen, mg/L		Total Inorganic Nitrogen, mg/L		Total Phosphorus, mg/L		Biochemical Oxygen Demand, mg/L		E. Coli, Cfu/100ml											
													Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA
6/4/2021	Mid-Ebb	Fine	Moderate	C	14:21	9.6	Surface	1	1.0	28.1	8.1	97.9	7.07	6.98	36.07	36.95	1.9	1.9	2.4	2.1	<0.02	<0.02	0.41	0.36	<0.05	<0.05	0.01	0.01	1.4	1.7	NOT DETECTED	ND										
6/4/2021	Mid-Ebb	Fine	Moderate	C			Surface	2	1.0	28.0	8.1	98.1	7.07	-	36.11	-	1.8	-	2.5	-	<0.02	-	0.38	-	<0.05	-	<0.01	-	1.5	-	NOT DETECTED	-										
6/4/2021	Mid-Ebb	Fine	Moderate	C			Middle	1	4.8	24.7	8.1	95.5	6.89	-	37.35	-	1.9	-	1.8	-	<0.02	-	0.29	-	<0.05	-	0.01	-	2.3	-	NOT DETECTED	-										
6/4/2021	Mid-Ebb	Fine	Moderate	C			Middle	2	4.8	24.5	8.1	95.4	6.88	-	37.39	-	2.0	-	2.2	-	<0.02	-	0.27	-	<0.05	-	<0.01	-	1.5	-	NOT DETECTED	-										
6/4/2021	Mid-Ebb	Fine	Moderate	C			Bottom	1	8.6	24.4	8.1	92.3	6.66	6.76	37.40	-	2.0	-	1.7	-	<0.02	-	0.41	-	<0.05	-	0.01	-	1.4	-	NOT DETECTED	-										
6/4/2021	Mid-Ebb	Fine	Moderate	C			Bottom	2	8.6	24.5	8.1	94.8	6.85	-	37.38	-	2.0	-	1.9	-	<0.02	-	0.39	-	<0.05	-	<0.01	-	2.3	-	NOT DETECTED	-										
6/4/2021	Mid-Ebb	Fine	Moderate	N1	14:08	6.5	Surface	1	1.0	27.9	8.1	106.0	7.53	7.43	36.17	36.88	1.5	1.5	2.1	2.0	<0.02	<0.02	0.43	0.42	<0.05	<0.05	0.01	0.01	1.6	1.7	NOT DETECTED	ND										
6/4/2021	Mid-Ebb	Fine	Moderate	N1			Surface	2	1.0	28.2	8.1	106.6	7.57	-	36.04	-	1.5	-	2.4	-	<0.02	-	0.42	-	<0.05	-	0.01	-	1.3	-	NOT DETECTED	-										
6/4/2021	Mid-Ebb	Fine	Moderate	N1			Middle	1	3.3	25.4	8.1	103.1	7.30	-	36.95	-	1.5	-	2.3	-	<0.02	-	0.43	-	<0.05	-	0.01	-	2.3	-	NOT DETECTED	-										
6/4/2021	Mid-Ebb	Fine	Moderate	N1			Middle	2	3.3	25.2	8.1	102.5	7.30	-	37.15	-	1.5	-	1.9	-	<0.02	-	0.40	-	<0.05	-	0.01	-	2.2	-	NOT DETECTED	-										
6/4/2021	Mid-Ebb	Fine	Moderate	N1			Bottom	1	5.5	24.4	8.1	101.3	7.31	7.34	37.43	-	1.5	-	1.7	-	<0.02	-	0.42	-	<0.05	-	0.01	-	1.4	-	NOT DETECTED	-										
6/4/2021	Mid-Ebb	Fine	Moderate	N1			Bottom	2	5.5	24.4	8.1	102.1	7.37	-	37.54	-	1.6	-	1.8	-	<0.02	-	0.43	-	<0.05	-	0.01	-	1.4	-	NOT DETECTED	-										
6/4/2021	Mid-Ebb	Fine	Moderate	FCZ1A	13:11	3.3	Surface	1	1.0	27.9	8.2	118.1	8.38	8.33	36.15	36.28	1.5	1.5	4.1	3.8	-	-	-	-	-	-	-	-	-	-	-											
6/4/2021	Mid-Ebb	Fine	Moderate	FCZ1A			Surface	2	1.0	27.6	8.2	116.2	8.28	-	36.29	-	1.5	-	3.6	-	-	-	-	-	-	-	-	-	-	-	-											
6/4/2021	Mid-Ebb	Fine	Moderate	FCZ1A			Bottom	1	2.3	27.2	8.2	117.4	8.42	8.38	36.29	-	1.6	-	3.3	-	-	-	-	-	-	-	-	-	-	-	-											
6/4/2021	Mid-Ebb	Fine	Moderate	FCZ1A			Bottom	2	2.3	27.0	8.2	116.1	8.34	-	36.39	-	1.5	-	4.2	-	-	-	-	-	-	-	-	-	-	-	-											
6/4/2021	Mid-Ebb	Fine	Moderate	FCZ1B	13:39	4.6	Surface	1	1.0	28.1	8.2	109.6	7.78	7.80	36.01	36.48	1.4	1.5	2.6	2.2	<0.02	<0.02	0.43	0.42	<0.05	<0.05	0.01	0.01	1.4	1.5	NOT DETECTED	ND										
6/4/2021	Mid-Ebb	Fine	Moderate	FCZ1B			Surface	2	1.0	28.1	8.2	110.1	7.82	-	36.04	-	1.4	-	1.9	-	<0.02	-	0.40	-	<0.05	-	0.01	-	1.7	-	NOT DETECTED	-										
6/4/2021	Mid-Ebb	Fine	Moderate	FCZ1B			Bottom	1	3.6	25.6	8.2	109.4	7.89	7.91	36.98	-	1.6	-	1.8	-	<0.02	-	0.41	-	<0.05	-	0.01	-	1.5	-	NOT DETECTED	-										
6/4/2021	Mid-Ebb	Fine	Moderate	FCZ1B			Bottom	2	3.6	25.9	8.2	110.2	7.93	-	36.87	-	1.4	-	2.6	-	<0.02	-	0.42	-	<0.05	-	0.01	-	1.5	-	NOT DETECTED	-										
6/4/2021	Mid-Ebb	Fine	Moderate	H4A	13:25	1.6	Middle	1	0.8	28.2	8.2	117.9	8.35	8.37	36.12	36.11	1.5	1.5	2.4	2.2	<0.02	<0.02	0.41	0.41	<0.05	<0.05	<0.01	<0.01	2.5	2.5	NOT DETECTED	ND										
6/4/2021	Mid-Ebb	Fine	Moderate	H4A			Middle	2	0.8	28.2	8.2	118.6	8.38	-	36.10	-	1.4	-	1.9	-	<0.02	-	0.40	-	<0.05	-	0.01	-	2.5	-	NOT DETECTED	-										
6/4/2021	Mid-Ebb	Fine	Moderate	H1A	12:57	1.6	Middle	1	0.8	28.1	8.2	122.2	8.64	8.64	36.10	36.09	1.6	1.6	2.2	1.8	<0.02	<0.02	0.41	0.41	<0.05	<0.05	<0.01	0.01	2.5	2.4	NOT DETECTED	ND										
6/4/2021	Mid-Ebb	Fine	Moderate	H1A			Middle	2	0.8	28.2	8.2	122.2	8.64	-	36.08	-	1.6	-	1.3	-	<0.02	-	0.40	-	<0.05	-	<0.01	-	2.3	-	NOT DETECTED	-										
6/4/2021	Mid-Ebb	Fine	Moderate	M1A	12:44	1.0	Middle	1	0.5	28.2	8.2	122.2	8.63	8.61	36.06	36.06	1.6	1.6	2.4	2.2	<0.02	<0.02	0.42	0.42	<0.05	<0.05	<0.01	<0.01	1.5	1.4	NOT DETECTED	ND										
6/4/2021	Mid-Ebb	Fine	Moderate	M1A			Middle	2	0.5	28.2	8.2	121.6	8.59	-	36.06	-	1.6	-	1.9	-	<0.02	-	0.41	-	<0.05	-	<0.01	-	1.2	-	NOT DETECTED	ND										
6/4/2021	Mid-Ebb	Fine	Moderate	SGA	12:30	1.0	Middle	1	0.5	28.1	8.2	117.7	8.36	8.43	36.12	36.09	1.5	1.6	2.6	2.2	<0.02	<0.02	0.38	0.39	<0.05	<0.05	0.01	0.1	1.4	1.3	1*	<1										
6/4/2021	Mid-Ebb	Fine	Moderate	SGA			Middle	2	0.5	28.2	8.2	119.9	8.49	-	36.05	-	1.7	-	1.8	-	<0.02	-	0.40	-	<0.05	-	0.01	-	1.2	-	NOT DETECTED	-										

DA - Depth-averaged

Marine Water Quality Monitoring Results on 4-Jun-21 at Mid-Flood tide

Date	Tidal	Weather Condition	Sea Condition	Monitoring Station	Time	Water Depth, m	Water Level	Replicate	Sampling Depth	Temperature, °C	pH	DO Saturation, %	DO, mg/L		Salinity, ppt		Turbidity, NTU		Suspended Solid, mg/L		Ammonia Nitrogen, mg/L		Total Nitrogen, mg/L		Total Inorganic Nitrogen, mg/L		Total Phosphorus, mg/L		Biochemical Oxygen Demand, mg/L		E. Coli, Cfu/100ml									
													Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA
6/4/2021	Mid-Flood	Fine	Moderate	C	6:55	9.6	Surface	1	1.0	27.7	8.1	100.3	7.14	6.81	36.25	37.04	2.2	2.4	2.7	3.0	-	-	-	-	-	-	-	-	-	-	-	-								
6/4/2021	Mid-Flood	Fine	Moderate	C			Surface	2	1.0	27.6	8.1	101.0	7.17	-	36.25	-	2.3	-	2.3	-	-	-	-	-	-	-	-	-	-	-	-	-								
6/4/2021	Mid-Flood	Fine	Moderate	C			Middle	1	4.8	24.8	8.0	89.0	6.42	-	37.32	-	2.3	-	2.6	-	-	-	-	-	-	-	-	-	-	-	-	-								
6/4/2021	Mid-Flood	Fine	Moderate	C			Middle	2	4.8	24.7	8.0	89.9	6.50	-	37.44	-	2.4	-	3.0	-	-	-	-	-	-	-	-	-	-	-	-	-								
6/4/2021	Mid-Flood	Fine	Moderate	C			Bottom	1	8.6	24.4	8.0	88.7	6.42	6.48	37.50	-	2.6	-	3.6	-	-	-	-	-	-	-	-	-	-	-	-	-								
6/4/2021	Mid-Flood	Fine	Moderate	C			Bottom	2	8.6	24.4	8.0	90.2	6.53	-	37.48	-	2.6	-	3.7	-	-	-	-	-	-	-	-	-	-	-	-	-								
6/4/2021	Mid-Flood	Fine	Moderate	N2	7:22	5.7	Surface	1	1.0	27.6	8.1	105.6	7.52	7.53	36.31	36.75	1.4	1.5	3.6	3.5	-	-	-	-	-	-	-	-	-	-	-	-								
6/4/2021	Mid-Flood	Fine	Moderate	N2			Surface	2	1.0	27.5	8.1	105.8	7.54	-	36.33	-	1.4	-	3.2	-	-	-	-	-	-	-	-	-	-	-	-	-								
6/4/2021	Mid-Flood	Fine	Moderate	N2			Bottom	1	4.7	25.1	8.1	103.3	7.43	7.50	37.16	-	1.6	-	3.6	-	-	-	-	-	-	-	-	-	-	-	-	-								
6/4/2021	Mid-Flood	Fine	Moderate	N2			Bottom	2	4.7	25.0	8.1	105.3	7.56	-	37.20	-	1.5	-	3.4	-	-	-	-	-	-	-	-	-	-	-	-	-								
6/4/2021	Mid-Flood	Fine	Moderate	FCZ1A	7:48	3.3	Surface	1	1.0	27.7	8.2	113.5	8.05	8.03	36.23	36																								

Marine Water Quality Monitoring Results on 7-Jun-21 at Mid-Ebb tide

Date	Tidal	Weather Condition	Sea Condition	Monitoring Station	Time	Water Depth, m	Water Level	Replicate	Sampling Depth	Temperature, °C	pH	DO Saturation, %	DO, mg/L		Salinity, ppt		Turbidity, NTU		Suspended Solid, mg/L		Ammonia Nitrogen, mg/L		Total Nitrogen, mg/L		Total Inorganic Nitrogen, mg/L		Total Phosphorus, mg/L		Biochemical Oxygen Demand, mg/L		E. Coli, Cfu/100ml				
													Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value
6/7/2021	Mid-Ebb	Sunny	Moderate	C	9:31	9.3	Surface	1	1.0	28.8	8.1	110.6	6.96	6.54	36.76	37.10	1.8	2.0	2.3	2.5	-	-	-	-	-	-	-	-	-	-	-	-	-		
6/7/2021	Mid-Ebb	Sunny	Moderate	C			Surface	2	1.0	28.9	8.1	110.7	6.97	-	36.75	-	1.9	-	2.0	-	-	-	-	-	-	-	-	-	-	-	-	-	-		
6/7/2021	Mid-Ebb	Sunny	Moderate	C			Middle	1	4.7	28.0	8.0	96.6	6.17	-	36.91	-	2.1	-	2.4	-	-	-	-	-	-	-	-	-	-	-	-	-	-		
6/7/2021	Mid-Ebb	Sunny	Moderate	C			Middle	2	4.7	28.0	7.9	95.3	6.05	-	36.91	-	2.1	-	2.4	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Ebb	Sunny	Moderate	C			Bottom	1	8.3	24.8	8.0	93.2	5.96	5.96	37.78	-	2.1	-	3.0	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Ebb	Sunny	Moderate	C			Bottom	2	8.3	25.8	8.0	92.9	5.95	-	37.51	-	2.1	-	2.4	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
6/7/2021	Mid-Ebb	Sunny	Moderate	N1	9:42	6.2	Surface	1	1.0	28.7	8.1	113.4	7.33	7.32	36.81	36.98	1.5	1.6	3.0	2.5	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Ebb	Sunny	Moderate	N1			Surface	2	1.0	28.8	8.1	120.7	7.60	-	36.79	-	1.6	-	2.3	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Ebb	Sunny	Moderate	N1			Middle	1	3.1	27.7	8.1	114.6	7.30	-	37.11	-	1.6	-	2.2	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Ebb	Sunny	Moderate	N1			Middle	2	3.1	28.1	8.1	111.7	7.04	-	36.93	-	1.6	-	2.8	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Ebb	Sunny	Moderate	N1			Bottom	1	5.2	28.0	8.0	96.3	6.17	6.25	36.92	-	1.6	-	2.1	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Ebb	Sunny	Moderate	N1			Bottom	2	5.2	27.0	8.1	99.3	6.32	-	37.32	-	1.6	-	2.5	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Ebb	Sunny	Moderate	FCZ1A	10:15	3.3	Surface	1	1.0	28.8	8.2	138.9	8.75	8.74	36.78	36.77	1.4	1.3	3.2	2.7	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Ebb	Sunny	Moderate	FCZ1A			Surface	2	1.0	28.8	8.2	138.6	8.73	-	36.78	-	1.3	-	2.7	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Ebb	Sunny	Moderate	FCZ1A			Bottom	1	2.3	28.7	8.2	139.1	8.77	8.81	36.74	-	1.4	-	2.2	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Ebb	Sunny	Moderate	FCZ1A			Bottom	2	2.3	28.5	8.2	140.0	8.85	-	36.78	-	1.2	-	2.6	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Ebb	Sunny	Moderate	H4A	10:04	1.6	Middle	1	0.8	28.9	8.2	141.3	8.88	8.92	36.75	36.75	1.4	1.5	2.2	2.0	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Ebb	Sunny	Moderate	H4A			Middle	2	0.8	28.9	8.2	142.4	8.95	-	36.74	-	1.5	-	1.8	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Ebb	Sunny	Moderate	H1A	10:27	1.4	Middle	1	0.7	28.9	8.2	143.2	9.01	9.00	36.74	36.75	1.6	1.5	2.7	2.6	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Ebb	Sunny	Moderate	H1A			Middle	2	0.7	28.9	8.2	142.9	8.99	-	36.75	-	1.4	-	2.4	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Ebb	Sunny	Moderate	M1A	10:38	1.2	Middle	1	0.6	28.9	8.2	144.6	9.09	9.09	36.74	36.74	1.5	1.6	1.9	2.1	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Ebb	Sunny	Moderate	M1A			Middle	2	0.6	28.9	8.2	144.4	9.08	-	36.74	-	1.6	-	2.2	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Ebb	Sunny	Moderate	SGA	10:51	1.2	Middle	1	0.6	28.9	8.2	140.9	8.87	8.85	36.75	36.76	1.5	1.5	1.5	1.6	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Ebb	Sunny	Moderate	SGA			Middle	2	0.6	28.8	8.2	140.1	8.82	-	36.76	-	1.4	-	1.6	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	

Marine Water Quality Monitoring Results on 7-Jun-21 at Mid-Flood tide

Date	Tidal	Weather Condition	Sea Condition	Monitoring Station	Time	Water Depth, m	Water Level	Replicate	Sampling Depth	Temperature, °C	pH	DO Saturation, %	DO, mg/L		Salinity, ppt		Turbidity, NTU		Suspended Solid, mg/L		Ammonia Nitrogen, mg/L		Total Nitrogen, mg/L		Total Inorganic Nitrogen, mg/L		Total Phosphorus, mg/L		Biochemical Oxygen Demand, mg/L		E. Coli, Cfu/100ml			
													Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA
6/7/2021	Mid-Flood	Sunny	Moderate	C	17:04	9.5	Surface	1	1.0	28.8	8.2	114.4	7.63	7.40	36.77	37.00	1.9	2.0	1.2	2.0	<0.02	<0.02	0.45	0.39	<0.05	<0.05	0.01	0.01	2.3	2.2	NOT DETECTED	ND		
6/7/2021	Mid-Flood	Sunny	Moderate	C			Surface	2	1.0	28.8	8.1	115.7	7.56	-	36.79	-	1.9	-	1.5	-	<0.02	-	0.42	-	<0.05	-	0.01	-	2.4	-	NOT DETECTED	-		
6/7/2021	Mid-Flood	Sunny	Moderate	C			Middle	1	4.8	27.9	8.0	112.0	7.06	-	36.90	-	1.9	-	2.5	-	<0.02	-	0.30	-	<0.05	-	0.01	-	2.2	-	NOT DETECTED	-		
6/7/2021	Mid-Flood	Sunny	Moderate	C			Middle	2	4.8	27.9	8.0	116.6	7.34	-	36.95	-	1.9	-	2.3	-	<0.02	-	0.29	-	<0.05	-	0.01	-	2.4	-	NOT DETECTED	-		
6/7/2021	Mid-Flood	Sunny	Moderate	C			Bottom	1	8.5	25.0	8.1	93.1	5.96	5.98	37.72	-	2.0	-	2.1	-	<0.02	-	0.44	-	<0.05	-	0.01	-	1.9	-	NOT DETECTED	-		
6/7/2021	Mid-Flood	Sunny	Moderate	C			Bottom	2	8.5	26.5	8.1	93.8	5.99	-	36.87	-	2.1	-	2.6	-	<0.02	-	0.42	-	<0.05	-	0.01	-	1.8	-	NOT DETECTED	-		
6/7/2021	Mid-Flood	Sunny	Moderate	N2	16:39	5.3	Surface	1	1.0	28.5	8.2	129.0	8.21	8.34	36.87	36.80	1.3	1.4	2.3	2.6	<0.02	<0.02	0.47	0.45	<0.05	<0.05	0.01	0.01	2.5	2.2	NOT DETECTED	ND		
6/7/2021	Mid-Flood	Sunny	Moderate	N2			Surface	2	1.0	28.9	8.2	134.5	8.47	-	36.76	-	1.3	-	1.6	-	<0.02	-	0.44	-	<0.05	-	0.01	-	1.5	-	NOT DETECTED	-		
6/7/2021	Mid-Flood	Sunny	Moderate	N2			Bottom	1	4.3	28.1	8.2	126.6	8.00	8.09	36.82	-	1.4	-	3.1	-	<0.02	-	0.42	-	<0.05	-	0.01	-	2.4	-	NOT DETECTED	-		
6/7/2021	Mid-Flood	Sunny	Moderate	N2			Bottom	2	4.3	28.4	8.2	129.1	8.18	-	36.73	-	1.4	-	3.2	-	<0.02	-	0.46	-	<0.05	-	0.01	-	2.2	-	NOT DETECTED	-		
6/7/2021	Mid-Flood	Sunny	Moderate	FCZ1A	16:04	3.4	Surface	1	1.0	28.7	8.2	136.8	8.62	8.65	36.78	36.77	1.2	1.2	2.8	2.6	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Flood	Sunny	Moderate	FCZ1A			Surface	2	1.0	28.7	8.2	137.5	8.67	-	36.81	-	1.2	-	3.4	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Flood	Sunny	Moderate	FCZ1A			Bottom	1	2.4	28.6	8.2	138.8	8.77	8.71	36.74	-	1.3	-	2.6	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
6/7/2021	Mid-Flood	Sunny	Moderate	FCZ1A			Bottom	2	2.4	28.6	8.2	137.0	8.65	-	36.76	-	1.2	-	1.5	-	-	-	-	-	-	-	-	-	-	-	-	-	-	
6/7/2021	Mid-Flood	Sunny	Moderate	FCZ1B	16:27	4.6	Surface	1	1.0	28.7	8.2	134.3	8.50	8.56	36.82	36.78	1.9	1.8	2.0	2.1	<0.02	<0.02	0.42	0.44	<0.05	<0.05	0.01	0.01	1.5	1.4	NOT DETECTED	ND		
6/7/2021	Mid-Flood	Sunny	Moderate	FCZ1B			Surface	2	1.0	28.8	8.2	135.6	8.61	-	36.79	-	1.8	-	2.1	-	<0.02	-	0.46	-	<0.05	-	0.02	-	1.5	-	NOT DETECTED	-		
6/7/2021	Mid-Flood	Sunny	Moderate	FCZ1B			Bottom	1	3.6	28.3	8.2	133.4	8.40																					

Marine Water Quality Monitoring Results on 9-Jun-21 at Mid-Ebb tide

Date	Tidal	Weather Condition	Sea Condition	Monitoring Station	Time	Water Depth, m	Water Level	Replicate	Sampling Depth	Temperature, °C	pH	DO Saturation, %	DO, mg/L		Salinity, ppt		Turbidity, NTU		Suspended Solid, mg/L		Ammonia Nitrogen, mg/L		Total Nitrogen, mg/L		Total Inorganic Nitrogen, mg/L		Total Phosphorus, mg/L		Biochemical Oxygen Demand, mg/L		E. Coli, Cfu/100ml											
													Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA
6/9/2021	Mid-Ebb	Cloudy	Moderate	C	13:06	9.3	Surface	1	1.0	29.0	8.2	119.0	7.48	7.37	36.68	36.82	2.6	2.7	3.2	2.8	<0.02	<0.02	0.50	0.44	<0.05	<0.05	<0.01	0.02	2.0	2.4	NOT DETECTED	ND										
6/9/2021	Mid-Ebb	Cloudy	Moderate	C			Surface	2	1.0	29.0	8.2	118.9	7.46	-	36.70	-	2.6	-	3.2	-	<0.02	-	0.48	-	<0.05	-	0.02	-	2.4	-	NOT DETECTED	-										
6/9/2021	Mid-Ebb	Cloudy	Moderate	C			Middle	1	4.7	28.9	8.2	115.9	7.28	-	36.83	-	2.7	-	2.5	-	<0.02	-	0.52	-	<0.05	-	0.02	-	2.6	-	NOT DETECTED	-										
6/9/2021	Mid-Ebb	Cloudy	Moderate	C			Middle	2	4.7	28.9	8.2	115.7	7.27	-	36.84	-	2.6	-	2.4	-	<0.02	-	0.51	-	<0.05	-	0.02	-	2.8	-	NOT DETECTED	-										
6/9/2021	Mid-Ebb	Cloudy	Moderate	C			Bottom	1	8.3	28.4	8.1	101.1	6.40	6.40	36.92	-	3.0	-	2.6	-	<0.02	-	0.32	-	<0.05	-	0.02	-	2.3	-	NOT DETECTED	-										
6/9/2021	Mid-Ebb	Cloudy	Moderate	C			Bottom	2	8.3	28.4	8.1	100.9	6.39	-	36.92	-	2.9	-	2.8	-	<0.02	-	0.30	-	<0.05	-	0.02	-	2.1	-	NOT DETECTED	-										
6/9/2021	Mid-Ebb	Cloudy	Moderate	N1	12:42	6.3	Surface	1	1.0	29.0	8.2	121.0	7.61	7.40	36.48	36.75	2.8	2.8	2.6	2.3	<0.02	<0.02	0.52	0.49	<0.05	<0.05	0.02	0.02	2.3	2.6	NOT DETECTED	<1										
6/9/2021	Mid-Ebb	Cloudy	Moderate	N1			Surface	2	1.0	29.0	8.2	120.0	7.54	-	36.52	-	2.7	-	3.0	-	<0.02	-	0.48	-	<0.05	-	0.02	-	3.2	-	NOT DETECTED	-										
6/9/2021	Mid-Ebb	Cloudy	Moderate	N1			Middle	1	3.2	28.9	8.2	114.9	7.22	-	36.83	-	2.8	-	2.1	-	<0.02	-	0.50	-	<0.05	-	0.02	-	2.8	-	NOT DETECTED	-										
6/9/2021	Mid-Ebb	Cloudy	Moderate	N1			Middle	2	3.2	28.9	8.2	114.9	7.22	-	36.84	-	2.9	-	2.2	-	<0.02	-	0.48	-	<0.05	-	0.02	-	2.6	-	NOT DETECTED	-										
6/9/2021	Mid-Ebb	Cloudy	Moderate	N1			Bottom	1	5.3	28.6	8.1	110.1	6.95	6.93	36.92	-	2.9	-	1.6	-	<0.02	-	0.49	-	<0.05	-	0.02	-	2.6	-	1*	-										
6/9/2021	Mid-Ebb	Cloudy	Moderate	N1			Bottom	2	5.3	28.4	8.1	108.8	6.90	-	36.91	-	2.9	-	2.0	-	<0.02	-	0.48	-	<0.05	-	0.02	-	2.2	-	NOT DETECTED	-										
6/9/2021	Mid-Ebb	Cloudy	Moderate	FCZ1A	10:31	3.2	Surface	1	1.0	28.9	8.2	119.3	7.50	7.50	36.60	36.73	2.8	2.8	1.8	1.7	-	-	-	-	-	-	-	-	-	-	-											
6/9/2021	Mid-Ebb	Cloudy	Moderate	FCZ1A			Surface	2	1.0	28.9	8.2	119.3	7.50	-	36.63	-	2.8	-	1.6	-	-	-	-	-	-	-	-	-	-	-	-											
6/9/2021	Mid-Ebb	Cloudy	Moderate	FCZ1A			Bottom	1	2.2	28.9	8.2	117.8	7.40	7.40	36.84	-	2.8	-	1.3	-	-	-	-	-	-	-	-	-	-	-	-											
6/9/2021	Mid-Ebb	Cloudy	Moderate	FCZ1A			Bottom	2	2.2	28.9	8.2	117.7	7.40	-	36.84	-	2.8	-	2.1	-	-	-	-	-	-	-	-	-	-	-	-											
6/9/2021	Mid-Ebb	Cloudy	Moderate	FCZ1B	12:04	4.5	Surface	1	1.0	28.9	8.2	116.1	7.30	7.30	36.84	36.87	2.8	2.8	1.8	2.3	<0.02	<0.02	0.49	0.49	<0.05	<0.05	<0.01	0.02	1.3	2.0	NOT DETECTED	ND										
6/9/2021	Mid-Ebb	Cloudy	Moderate	FCZ1B			Surface	2	1.0	28.9	8.2	116.1	7.30	-	36.83	-	2.7	-	2.5	-	<0.02	-	0.51	-	<0.05	-	0.02	-	2.1	-	NOT DETECTED	-										
6/9/2021	Mid-Ebb	Cloudy	Moderate	FCZ1B			Bottom	1	3.5	28.6	8.2	114.0	7.20	7.19	36.91	-	2.9	-	2.2	-	<0.02	-	0.50	-	<0.05	-	0.02	-	2.1	-	NOT DETECTED	-										
6/9/2021	Mid-Ebb	Cloudy	Moderate	FCZ1B			Bottom	2	3.5	28.6	8.2	113.7	7.18	-	36.91	-	2.8	-	2.8	-	<0.02	-	0.46	-	<0.05	-	0.02	-	2.4	-	NOT DETECTED	-										
6/9/2021	Mid-Ebb	Cloudy	Moderate	H4A	10:42	1.6	Middle	1	0.8	28.9	8.2	122.3	7.70	7.69	36.55	36.55	3.0	3.0	2.8	2.6	<0.02	<0.02	0.47	0.48	<0.05	<0.05	<0.01	0.01	1.7	1.8	NOT DETECTED	ND										
6/9/2021	Mid-Ebb	Cloudy	Moderate	H4A			Middle	2	0.8	28.9	8.2	122.0	7.68	-	36.55	-	3.0	-	2.3	-	<0.02	-	0.48	-	<0.05	-	0.01	-	1.8	-	NOT DETECTED	-										
6/9/2021	Mid-Ebb	Cloudy	Moderate	H1A	10:12	1.4	Middle	1	0.7	28.9	8.2	121.4	7.64	7.65	36.63	36.62	2.7	2.7	2.1	2.6	<0.02	<0.02	0.48	0.48	<0.05	<0.05	<0.01	0.02	2.2	2.2	NOT DETECTED	ND										
6/9/2021	Mid-Ebb	Cloudy	Moderate	H1A			Middle	2	0.7	28.9	8.2	121.7	7.66	-	36.61	-	2.6	-	3.0	-	<0.02	-	0.47	-	<0.05	-	0.02	-	2.2	-	NOT DETECTED	-										
6/9/2021	Mid-Ebb	Cloudy	Moderate	M1A	10:01	1.2	Middle	1	0.6	28.9	8.2	118.8	7.47	7.48	36.65	36.65	2.6	2.7	3.8	3.6	<0.02	<0.02	0.31	0.31	<0.05	<0.05	0.02	0.2	2.4	2.4	NOT DETECTED	ND										
6/9/2021	Mid-Ebb	Cloudy	Moderate	M1A			Middle	2	0.6	28.9	8.2	119.0	7.48	-	36.65	-	2.7	-	3.3	-	<0.02	-	0.30	-	<0.05	-	0.02	-	2.4	-	NOT DETECTED	-										
6/9/2021	Mid-Ebb	Cloudy	Moderate	SGA	9:42	1.2	Middle	1	0.6	28.9	8.2	115.4	7.25	7.24	36.74	36.74	2.9	2.9	2.4	2.6	<0.02	<0.02	0.30	0.31	<0.05	<0.05	0.02	0.2	2.3	2.1	NOT DETECTED	ND										
6/9/2021	Mid-Ebb	Cloudy	Moderate	SGA			Middle	2	0.6	28.9	8.2	115.0	7.23	-	36.74	-	2.8	-	2.7	-	<0.02	-	0.31	-	<0.05	-	0.02	-	1.9	-	NOT DETECTED	-										

DA - Depth-averaged

Marine Water Quality Monitoring Results on 9-Jun-21 at Mid-Flood tide

Date	Tidal	Weather Condition	Sea Condition	Monitoring Station	Time	Water Depth, m	Water Level	Replicate	Sampling Depth	Temperature, °C	pH	DO Saturation, %	DO, mg/L		Salinity, ppt		Turbidity, NTU		Suspended Solid, mg/L		Ammonia Nitrogen, mg/L		Total Nitrogen, mg/L		Total Inorganic Nitrogen, mg/L		Total Phosphorus, mg/L		Biochemical Oxygen Demand, mg/L		E. Coli, Cfu/100ml									
													Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA
6/9/2021	Mid-Flood	Cloudy	Moderate	C	4:17	9.3	Surface	1	1.0	28.9	8.1	114.3	7.18	6.96	36.86	36.92	2.8	2.8	1.5	1.9	-	-	-	-	-	-	-	-	-	-	-									
6/9/2021	Mid-Flood	Cloudy	Moderate	C			Surface	2	1.0	29.0	8.1	113.3	7.11	-	36.84	-	2.7	-	1.4	-	-	-	-	-	-	-	-	-	-	-	-									
6/9/2021	Mid-Flood	Cloudy	Moderate	C			Middle	1	4.7	28.8	8.0	108.1	6.80	-	36.92	-	2.7	-	2.0	-	-	-	-	-	-	-	-	-	-	-	-									
6/9/2021	Mid-Flood	Cloudy	Moderate	C			Middle	2	4.7	28.8	8.1	107.4	6.76	-	36.92	-	2.8	-	1.8	-	-	-	-	-	-	-	-	-	-	-	-									
6/9/2021	Mid-Flood	Cloudy	Moderate	C			Bottom	1	8.3	28.5	8.0	103.2	6.52	6.51	36.99	-	2.9	-	2.0	-	-	-	-	-	-	-	-	-	-	-	-									
6/9/2021	Mid-Flood	Cloudy	Moderate	C			Bottom	2	8.3	28.5	8.0	102.9	6.50	-	37.01	-	2.9	-	2.6	-	-	-	-	-	-	-	-	-	-	-	-									
6/9/2021	Mid-Flood	Cloudy	Moderate	N2	5:01	5.5	Surface	1	1.0	29.0	8.2	118.1	7.43	7.42	36.39	36.70	2.7	2.7	1.9	1.6	-	-	-	-	-	-	-	-	-	-	-									
6/9/2021	Mid-Flood	Cloudy	Moderate	N2			Surface	2	1.0	29.0	8.2	117.7	7.40	-	36.47	-	2.7	-	1.3	-	-	-	-	-	-	-	-	-	-	-	-									
6/9/2021	Mid-Flood	Cloudy	Moderate	N2			Bottom	1	4.5	28.6	8.1	107.8	6.81	6.83	36.96	-	2.7	-	1.8	-	-	-	-	-	-	-	-	-	-	-	-									
6/9/2021	Mid-Flood	Cloudy	Moderate	N2			Bottom	2	4.5	28.6	8.1	108.3	6.84	-	36.98	-	2.8	-	1.2	-	-	-	-	-	-	-	-	-	-	-	-									
6/9/2021	Mid-Flood	Cloudy	Moderate	FCZ1A	5:40	3.3	Surface	1	1.0	29.0	8.2	118.5	7.48	7.51	35.85	36.32	2.8	2.8																						

Marine Water Quality Monitoring Results on 11-Jun-21 at Mid-Ebb tide

Date	Tidal	Weather Condition	Sea Condition	Monitoring Station	Time	Water Depth, m	Water Level	Replicate	Sampling Depth	Temperature, °C	pH	DO Saturation, %	DO, mg/L		Salinity, ppt		Turbidity, NTU		Suspended Solid, mg/L		Ammonia Nitrogen, mg/L		Total Nitrogen, mg/L		Total Inorganic Nitrogen, mg/L		Total Phosphorus, mg/L		Biochemical Oxygen Demand, mg/L		E. Coli, Cfu/100ml											
													Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA
6/11/2021	Mid-Ebb	Cloudy	Moderate	C	13:22	9.3	Surface	1	1.0	29.3	8.1	113.6	7.11	7.00	36.53	36.72	1.8	1.9	2.1	2.1	<0.02	<0.02	0.29	0.29	<0.05	<0.05	0.01	0.01	2.1	1.6	NOT DETECTED	ND										
6/11/2021	Mid-Ebb	Cloudy	Moderate	C			Surface	2	1.0	29.3	8.1	114.1	7.14	-	36.54	-	1.9	-	2.4	-	<0.02	-	0.28	-	<0.05	-	0.01	-	1.6	-	NOT DETECTED	-										
6/11/2021	Mid-Ebb	Cloudy	Moderate	C			Middle	1	4.7	28.9	8.1	108.4	6.85	-	36.78	-	1.9	-	1.7	-	<0.02	-	0.28	-	<0.05	-	0.01	-	1.5	-	NOT DETECTED	-										
6/11/2021	Mid-Ebb	Cloudy	Moderate	C			Middle	2	4.7	28.9	8.1	109.4	6.91	-	36.76	-	1.9	-	2.6	-	<0.02	-	0.31	-	<0.05	-	0.01	-	1.5	-	NOT DETECTED	-										
6/11/2021	Mid-Ebb	Cloudy	Moderate	C			Bottom	1	8.3	28.6	8.1	104.5	6.58	6.61	36.85	-	1.9	-	1.8	-	<0.02	-	0.29	-	<0.05	-	0.01	-	1.4	-	NOT DETECTED	-										
6/11/2021	Mid-Ebb	Cloudy	Moderate	C			Bottom	2	8.3	28.5	8.1	105.3	6.63	-	36.87	-	1.9	-	1.7	-	<0.02	-	0.28	-	<0.05	-	0.01	-	1.5	-	NOT DETECTED	-										
6/11/2021	Mid-Ebb	Cloudy	Moderate	N1	13:12	6.3	Surface	1	1.0	29.3	8.2	116.8	7.35	7.33	36.54	36.63	1.5	1.5	<1.0	1.8	<0.02	<0.02	0.27	0.29	<0.05	<0.05	0.01	0.01	1.2	1.4	NOT DETECTED	ND										
6/11/2021	Mid-Ebb	Cloudy	Moderate	N1			Surface	2	1.0	29.3	8.2	117.5	7.36	-	36.54	-	1.4	-	<1.0	-	<0.02	-	0.30	-	<0.05	-	<0.01	-	1.2	-	NOT DETECTED	-										
6/11/2021	Mid-Ebb	Cloudy	Moderate	N1			Middle	1	3.2	29.2	8.1	115.5	7.27	-	36.57	-	1.5	-	1.7	-	<0.02	-	0.29	-	<0.05	-	0.01	-	1.3	-	NOT DETECTED	-										
6/11/2021	Mid-Ebb	Cloudy	Moderate	N1			Middle	2	3.2	29.0	8.1	117.2	7.33	-	36.69	-	1.5	-	2.6	-	<0.02	-	0.27	-	<0.05	-	<0.01	-	1.4	-	NOT DETECTED	-										
6/11/2021	Mid-Ebb	Cloudy	Moderate	N1			Bottom	1	5.3	28.9	8.1	115.3	7.22	7.19	36.73	-	1.4	-	2.8	-	<0.02	-	0.29	-	<0.05	-	0.01	-	2.0	-	NOT DETECTED	-										
6/11/2021	Mid-Ebb	Cloudy	Moderate	N1			Bottom	2	5.3	28.9	8.1	113.8	7.15	-	36.73	-	1.5	-	1.9	-	<0.02	-	0.29	-	<0.05	-	0.01	-	1.5	-	NOT DETECTED	-										
6/11/2021	Mid-Ebb	Cloudy	Moderate	FCZ1A	12:29	3.3	Surface	1	1.0	29.2	8.1	119.1	7.46	7.47	36.55	36.56	1.8	1.8	2.4	2.6	-	-	-	-	-	-	-	-	-	-	-											
6/11/2021	Mid-Ebb	Cloudy	Moderate	FCZ1A			Surface	2	1.0	29.2	8.2	119.5	7.48	-	36.55	-	1.9	-	3.0	-	-	-	-	-	-	-	-	-	-	-	-											
6/11/2021	Mid-Ebb	Cloudy	Moderate	FCZ1A			Bottom	1	2.3	29.2	8.1	119.0	7.46	7.45	36.56	-	1.8	-	2.8	-	-	-	-	-	-	-	-	-	-	-	-											
6/11/2021	Mid-Ebb	Cloudy	Moderate	FCZ1A			Bottom	2	2.3	29.2	8.1	118.7	7.44	-	36.57	-	1.8	-	2.0	-	-	-	-	-	-	-	-	-	-	-	-											
6/11/2021	Mid-Ebb	Cloudy	Moderate	FCZ1B	12:50	4.5	Surface	1	1.0	29.2	8.2	119.6	7.49	7.50	36.54	36.55	1.6	1.6	2.3	2.3	<0.02	<0.02	0.34	0.31	<0.05	<0.05	0.01	0.01	1.5	1.6	NOT DETECTED	ND										
6/11/2021	Mid-Ebb	Cloudy	Moderate	FCZ1B			Surface	2	1.0	29.2	8.2	119.8	7.50	-	36.54	-	1.6	-	2.0	-	<0.02	-	0.30	-	<0.05	-	0.01	-	1.9	-	NOT DETECTED	-										
6/11/2021	Mid-Ebb	Cloudy	Moderate	FCZ1B			Bottom	1	3.5	29.2	8.2	119.7	7.49	7.49	36.55	-	1.5	-	2.5	-	<0.02	-	0.29	-	<0.05	-	0.01	-	1.4	-	NOT DETECTED	-										
6/11/2021	Mid-Ebb	Cloudy	Moderate	FCZ1B			Bottom	2	3.5	29.2	8.2	119.5	7.48	-	36.56	-	1.6	-	2.3	-	<0.02	-	0.29	-	<0.05	-	0.01	-	1.6	-	NOT DETECTED	-										
6/11/2021	Mid-Ebb	Cloudy	Moderate	H4A	12:41	1.6	Middle	1	0.8	29.2	8.2	119.7	7.50	7.50	36.54	36.54	1.7	1.7	2.6	2.5	<0.02	<0.02	0.27	0.28	<0.05	<0.05	0.01	0.01	1.6	1.4	NOT DETECTED	ND										
6/11/2021	Mid-Ebb	Cloudy	Moderate	H4A			Middle	2	0.8	29.2	8.2	119.7	7.49	-	36.54	-	1.7	-	2.4	-	<0.02	-	0.28	-	<0.05	-	0.01	-	1.2	-	NOT DETECTED	-										
6/11/2021	Mid-Ebb	Cloudy	Moderate	H1A	12:17	1.4	Middle	1	0.7	29.2	8.2	119.5	7.49	7.49	36.54	36.54	1.2	1.3	2.1	2.6	<0.02	<0.02	0.30	0.30	<0.05	<0.05	0.01	0.01	1.3	1.3	NOT DETECTED	ND										
6/11/2021	Mid-Ebb	Cloudy	Moderate	H1A			Middle	2	0.7	29.2	8.1	119.6	7.49	-	36.54	-	1.3	-	3.0	-	<0.02	-	0.29	-	<0.05	-	0.01	-	1.3	-	NOT DETECTED	-										
6/11/2021	Mid-Ebb	Cloudy	Moderate	M1A	12:07	1.0	Middle	1	0.5	29.2	8.1	119.2	7.47	7.47	36.54	36.54	1.4	1.4	1.9	2.1	<0.02	<0.02	0.30	0.29	<0.05	<0.05	0.01	0.01	1.3	1.4	NOT DETECTED	ND										
6/11/2021	Mid-Ebb	Cloudy	Moderate	M1A			Middle	2	0.5	29.2	8.1	119.0	7.46	-	36.54	-	1.4	-	2.2	-	<0.02	-	0.28	-	<0.05	-	<0.01	-	1.4	-	NOT DETECTED	-										
6/11/2021	Mid-Ebb	Cloudy	Moderate	SGA	11:55	1.2	Middle	1	0.6	29.2	8.1	115.3	7.22	7.30	36.55	36.55	1.5	1.5	1.6	2.1	<0.02	<0.02	0.28	0.29	<0.05	<0.05	0.01	0.01	1.5	1.7	NOT DETECTED	ND										
6/11/2021	Mid-Ebb	Cloudy	Moderate	SGA			Middle	2	0.6	29.2	8.1	117.7	7.37	-	36.54	-	1.5	-	2.5	-	<0.02	-	0.29	-	<0.05	-	0.01	-	1.9	-	NOT DETECTED	-										

DA - Depth-averaged

Marine Water Quality Monitoring Results on 11-Jun-21 at Mid-Flood tide

Date	Tidal	Weather Condition	Sea Condition	Monitoring Station	Time	Water Depth, m	Water Level	Replicate	Sampling Depth	Temperature, °C	pH	DO Saturation, %	DO, mg/L		Salinity, ppt		Turbidity, NTU		Suspended Solid, mg/L		Ammonia Nitrogen, mg/L		Total Nitrogen, mg/L		Total Inorganic Nitrogen, mg/L		Total Phosphorus, mg/L		Biochemical Oxygen Demand, mg/L		E. Coli, Cfu/100ml									
													Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA
6/11/2021	Mid-Flood	Fine	Moderate	C	5:01	9.3	Surface	1	1.0	29.1	8.0	107.0	6.71	6.57	36.56	36.77	1.6	1.8	2.0	2.1	-	-	-	-	-	-	-	-	-	-	-	-								
6/11/2021	Mid-Flood	Fine	Moderate	C			Surface	2	1.0	29.1	7.9	110.9	6.95	-	36.54	-	1.8	-	2.6	-	-	-	-	-	-	-	-	-	-	-	-	-								
6/11/2021	Mid-Flood	Fine	Moderate	C			Middle	1	4.7	28.7	7.9	98.6	6.24	-	36.83	-	1.8	-	2.0	-	-	-	-	-	-	-	-	-	-	-	-	-								
6/11/2021	Mid-Flood	Fine	Moderate	C			Middle	2	4.7	28.7	7.8	101.2	6.39	-	36.84	-	1.8	-	2.0	-	-	-	-	-	-	-	-	-	-	-	-	-								
6/11/2021	Mid-Flood	Fine	Moderate	C			Bottom	1	8.3	28.5	7.8	99.5	6.29	6.21	36.92	-	1.8	-	2.2	-	-	-	-	-	-	-	-	-	-	-	-	-								
6/11/2021	Mid-Flood	Fine	Moderate	C			Bottom	2	8.3	28.4	7.9	96.9	6.12	-	36.91	-	1.7	-	1.9	-	-	-	-	-	-	-	-	-	-	-	-	-								
6/11/2021	Mid-Flood	Fine	Moderate	N2	5:25	5.3	Surface	1	1.0	28.9	8.0	109.7	6.90	6.92	36.66	36.72	1.5	1.5	2.4	2.1	-	-	-	-	-	-	-	-	-	-	-	-								
6/11/2021	Mid-Flood	Fine	Moderate	N2			Surface	2	1.0	29.1	8.0	110.6	6.94	-	36.57	-	1.4	-	2.0	-	-	-	-	-	-	-	-	-	-	-	-	-								
6/11/2021	Mid-Flood	Fine	Moderate	N2			Bottom	1	4.3	28.7	8.0	111.7	7.05	6.97	36.82	-	1.5	-	2.1	-	-	-	-	-	-	-	-	-	-	-	-	-								
6/11/2021	Mid-Flood	Fine	Moderate	N2			Bottom	2	4.3	28.7	8.0	109.3	6.89	-	36.82	-	1.5	-	2.0	-	-	-	-	-	-	-	-	-	-	-	-	-								
6/11/2021	Mid-Flood	Fine	Moderate	FCZ1A	5:45	3.4	Surface	1	1.0																															

Marine Water Quality Monitoring Results on 14-Jun-21 at Mid-Ebb tide

Date	Tidal	Weather Condition	Sea Condition	Monitoring Station	Time	Water Depth, m	Water Level	Replicate	Sampling Depth	Temperature, °C	pH	DO Saturation, %	DO, mg/L		Salinity, ppt		Turbidity, NTU		Suspended Solid, mg/L		Ammonia Nitrogen, mg/L		Total Nitrogen, mg/L		Total Inorganic Nitrogen, mg/L		Total Phosphorus, mg/L		Biochemical Oxygen Demand, mg/L		E. Coli, Cfu/100ml											
													Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA
6/14/2021	Mid-Ebb	Cloudy	Moderate	C	13:38	9.2	Surface	1	1.0	29.6	8.2	105.7	6.88	6.49	33.92	35.67	2.6	2.6	3.0	2.4	<0.02	<0.02	0.52	0.45	<0.05	<0.05	0.02	0.02	1.8	1.4	NOT DETECTED	ND										
6/14/2021	Mid-Ebb	Cloudy	Moderate	C			Surface	2	1.0	29.6	8.2	108.2	6.83	-	33.86	-	2.6	-	2.3	-	<0.02	-	0.44	-	<0.05	-	0.02	-	1.3	-	NOT DETECTED	-										
6/14/2021	Mid-Ebb	Cloudy	Moderate	C			Middle	1	4.6	28.7	8.1	97.5	6.17	-	36.52	-	2.6	-	2.4	-	<0.02	-	0.42	-	<0.05	-	0.02	-	1.3	-	NOT DETECTED	-										
6/14/2021	Mid-Ebb	Cloudy	Moderate	C			Middle	2	4.6	28.7	8.1	99.1	6.26	-	36.54	-	2.6	-	2.3	-	<0.02	-	0.45	-	<0.05	-	0.01	-	1.4	-	NOT DETECTED	-										
6/14/2021	Mid-Ebb	Cloudy	Moderate	C			Bottom	1	8.2	28.6	8.1	94.2	5.95	5.94	36.59	-	2.6	-	2.0	-	<0.02	-	0.43	-	<0.05	-	0.01	-	1.4	-	NOT DETECTED	-										
6/14/2021	Mid-Ebb	Cloudy	Moderate	C			Bottom	2	8.2	28.6	8.1	93.8	5.92	-	36.59	-	2.7	-	2.6	-	<0.02	-	0.42	-	<0.05	-	0.01	-	1.4	-	NOT DETECTED	-										
6/14/2021	Mid-Ebb	Cloudy	Moderate	N1	13:28	6.2	Surface	1	1.0	29.5	8.2	110.7	6.98	6.94	33.99	35.64	1.3	1.4	1.9	2.5	<0.02	<0.02	0.40	0.37	<0.05	<0.05	0.02	0.02	2.0	1.5	NOT DETECTED	<1										
6/14/2021	Mid-Ebb	Cloudy	Moderate	N1			Surface	2	1.0	29.4	8.2	111.6	7.04	-	34.04	-	1.4	-	2.3	-	<0.02	-	0.40	-	<0.05	-	0.02	-	1.4	-	NOT DETECTED	-										
6/14/2021	Mid-Ebb	Cloudy	Moderate	N1			Middle	1	3.1	28.8	8.1	108.8	6.88	-	36.47	-	1.3	-	2.8	-	<0.02	-	0.39	-	<0.05	-	0.02	-	1.5	-	1*	-										
6/14/2021	Mid-Ebb	Cloudy	Moderate	N1			Middle	2	3.1	28.8	8.1	108.5	6.86	-	36.48	-	1.4	-	2.4	-	<0.02	-	0.40	-	<0.05	-	0.02	-	1.4	-	NOT DETECTED	-										
6/14/2021	Mid-Ebb	Cloudy	Moderate	N1			Bottom	1	5.2	28.9	8.1	104.8	6.62	6.61	36.39	-	1.6	-	3.1	-	<0.02	-	0.29	-	<0.05	-	0.01	-	1.4	-	1*	-										
6/14/2021	Mid-Ebb	Cloudy	Moderate	N1			Bottom	2	5.2	28.8	8.1	104.4	6.59	-	36.48	-	1.5	-	2.6	-	<0.02	-	0.33	-	<0.05	-	0.02	-	1.4	-	NOT DETECTED	-										
6/14/2021	Mid-Ebb	Cloudy	Moderate	FCZ1A	12:44	3.3	Surface	1	1.0	29.5	8.2	119.3	7.53	7.40	34.05	35.21	1.7	1.7	2.3	2.6	-	-	-	-	-	-	-	-	-	-	-											
6/14/2021	Mid-Ebb	Cloudy	Moderate	FCZ1A			Surface	2	1.0	29.3	8.2	114.8	7.26	-	34.20	-	1.7	-	2.8	-	-	-	-	-	-	-	-	-	-	-	-											
6/14/2021	Mid-Ebb	Cloudy	Moderate	FCZ1A			Bottom	1	2.3	28.9	8.2	114.6	7.23	7.24	36.29	-	1.8	-	2.1	-	-	-	-	-	-	-	-	-	-	-	-											
6/14/2021	Mid-Ebb	Cloudy	Moderate	FCZ1A			Bottom	2	2.3	29.0	8.2	114.6	7.24	-	36.29	-	1.7	-	3.0	-	-	-	-	-	-	-	-	-	-	-	-											
6/14/2021	Mid-Ebb	Cloudy	Moderate	FCZ1B	13:06	4.4	Surface	1	1.0	29.1	8.2	116.4	7.39	7.33	34.43	35.30	1.7	1.6	2.6	2.2	<0.02	<0.02	0.40	0.39	<0.05	<0.05	0.02	0.02	1.3	1.6	NOT DETECTED	ND										
6/14/2021	Mid-Ebb	Cloudy	Moderate	FCZ1B			Surface	2	1.0	29.4	8.2	115.2	7.26	-	34.18	-	1.6	-	2.2	-	<0.02	-	0.37	-	<0.05	-	0.01	-	1.4	-	NOT DETECTED	-										
6/14/2021	Mid-Ebb	Cloudy	Moderate	FCZ1B			Bottom	1	3.4	29.0	8.2	113.0	7.15	7.17	36.32	-	1.5	-	2.1	-	<0.02	-	0.38	-	<0.05	-	0.02	-	1.4	-	NOT DETECTED	-										
6/14/2021	Mid-Ebb	Cloudy	Moderate	FCZ1B			Bottom	2	3.4	29.0	8.2	114.3	7.18	-	36.28	-	1.6	-	2.0	-	<0.02	-	0.42	-	<0.05	-	0.02	-	2.3	-	NOT DETECTED	-										
6/14/2021	Mid-Ebb	Cloudy	Moderate	H4A	12:55	1.6	Middle	1	0.8	29.8	8.3	127.7	8.05	8.15	33.91	33.89	1.9	2.0	2.2	2.5	<0.02	<0.02	0.37	0.38	<0.05	<0.05	0.02	0.02	1.3	1.4	NOT DETECTED	<1										
6/14/2021	Mid-Ebb	Cloudy	Moderate	H4A			Middle	2	0.8	29.8	8.3	130.9	8.24	-	33.86	-	2.0	-	2.7	-	<0.02	-	0.38	-	<0.05	-	0.01	-	1.4	-	1*	-										
6/14/2021	Mid-Ebb	Cloudy	Moderate	H1A	12:32	1.4	Middle	1	0.7	29.8	8.3	133.6	8.41	8.40	33.88	33.89	2.3	2.4	2.1	2.3	<0.02	<0.02	0.39	0.39	<0.05	<0.05	0.02	0.02	1.2	1.2	NOT DETECTED	<1										
6/14/2021	Mid-Ebb	Cloudy	Moderate	H1A			Middle	2	0.7	29.8	8.3	133.1	8.39	-	33.90	-	2.4	-	2.4	-	<0.02	-	0.39	-	<0.05	-	0.02	-	1.2	-	NOT DETECTED	-										
6/14/2021	Mid-Ebb	Cloudy	Moderate	M1A	12:22	1.2	Middle	1	0.6	29.8	8.3	131.4	8.27	8.24	33.91	33.91	2.5	2.5	1.8	2.3	<0.02	<0.02	0.39	0.40	<0.05	<0.05	0.01	0.02	1.1	1.2	NOT DETECTED	ND										
6/14/2021	Mid-Ebb	Cloudy	Moderate	M1A			Middle	2	0.6	29.8	8.3	130.1	8.20	-	33.91	-	2.4	-	2.7	-	<0.02	-	0.40	-	<0.05	-	0.02	-	1.3	-	NOT DETECTED	-										
6/14/2021	Mid-Ebb	Cloudy	Moderate	SGA	12:10	1.2	Middle	1	0.6	29.6	8.2	122.7	7.74	7.49	33.93	34.10	2.6	2.6	2.6	2.5	<0.02	<0.02	0.38	0.40	<0.05	<0.05	0.02	0.02	1.6	1.5	NOT DETECTED	ND										
6/14/2021	Mid-Ebb	Cloudy	Moderate	SGA			Middle	2	0.6	29.1	8.2	113.8	7.23	-	34.27	-	2.6	-	2.3	-	<0.02	-	0.41	-	<0.05	-	0.02	-	1.3	-	NOT DETECTED	-										

DA - Depth-averaged

Marine Water Quality Monitoring Results on 14-Jun-21 at Mid-Flood tide

Date	Tidal	Weather Condition	Sea Condition	Monitoring Station	Time	Water Depth, m	Water Level	Replicate	Sampling Depth	Temperature, °C	pH	DO Saturation, %	DO, mg/L		Salinity, ppt		Turbidity, NTU		Suspended Solid, mg/L		Ammonia Nitrogen, mg/L		Total Nitrogen, mg/L		Total Inorganic Nitrogen, mg/L		Total Phosphorus, mg/L		Biochemical Oxygen Demand, mg/L		E. Coli, Cfu/100ml									
													Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA
6/14/2021	Mid-Flood	Cloudy	Moderate	C	5:02	9.4	Surface	1	1.0	29.3	8.0	100.0	6.34	6.28	34.21	35.77	2.9	2.7	2.4	2.8	-	-	-	-	-	-	-	-	-	-	-									
6/14/2021	Mid-Flood	Cloudy	Moderate	C			Surface	2	1.0	29.3	8.1	101.4	6.42	-	34.15	-	2.8	-	2.3	-	-	-	-	-	-	-	-	-	-	-	-									
6/14/2021	Mid-Flood	Cloudy	Moderate	C			Middle	1	4.7	28.7	7.9	99.3	6.27	-	36.56	-	1.9	-	2.1	-	-	-	-	-	-	-	-	-	-	-	-									
6/14/2021	Mid-Flood	Cloudy	Moderate	C			Middle	2	4.7	28.7	7.9	96.3	6.09	-	36.51	-	2.9	-	3.2	-	-	-	-	-	-	-	-	-	-	-	-									
6/14/2021	Mid-Flood	Cloudy	Moderate	C			Bottom	1	8.4	28.7	8.0	91.6	5.78	5.78	36.59	-	2.8	-	3.4	-	-	-	-	-	-	-	-	-	-	-	-									
6/14/2021	Mid-Flood	Cloudy	Moderate	C			Bottom	2	8.4	28.6	7.9	91.4	5.77	-	36.61	-	2.9	-	3.5	-	-	-	-	-	-	-	-	-	-	-	-									
6/14/2021	Mid-Flood	Cloudy	Moderate	N2	5:25	5.2	Surface	1	1.0	29.1	8.1	107.5	6.82	6.89	34.30	35.32	1.5	1.5	2.8	2.9	-	-	-	-	-	-	-	-	-	-	-									
6/14/2021	Mid-Flood	Cloudy	Moderate	N2			Surface	2	1.0	29.2	8.1	109.8	6.96	-	34.23	-	1.6	-	2.8	-	-	-	-	-	-	-	-	-	-	-	-									
6/14/2021	Mid-Flood	Cloudy	Moderate	N2			Bottom	1	4.2	28.8	8.1	111.1	7.01	7.02	36.45	-	1.5	-	2.6	-	-	-	-	-	-	-	-	-	-	-	-									
6/14/2021	Mid-Flood	Cloudy	Moderate	N2			Bottom	2	4.2	29.0	8.1	111.7	7.03	-	36.28	-	1.5	-	3.4	-	-	-	-	-	-	-	-	-	-	-	-									
6/14/2021	Mid-Flood	Cloudy	Moderate	FCZ1A	5:46	3.2	Surface	1	1.0	29.4	8.2	124.8	7.85	7.73	34.10	35																								

Marine Water Quality Monitoring Results on 16-Jun-21 at Mid-Ebb tide

Date	Tidal	Weather Condition	Sea Condition	Monitoring Station	Time	Water Depth, m	Water Level	Replicate	Sampling Depth	Temperature, °C	pH	DO Saturation, %	DO, mg/L		Salinity, ppt		Turbidity, NTU		Suspended Solid, mg/L		Ammonia Nitrogen, mg/L		Total Nitrogen, mg/L		Total Inorganic Nitrogen, mg/L		Total Phosphorus, mg/L		Biochemical Oxygen Demand, mg/L		E. Coli, Cfu/100ml									
													Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA
6/16/2021	Mid-Ebb	Cloudy	Moderate	C	15:52	9.6	Surface	1	1.0	29.4	8.1	101.2	6.33	6.10	36.17	36.35	1.9	2.0	2.3	2.5	<0.02	<0.02	0.23	0.40	<0.05	<0.05	<0.01	<0.01	1.6	1.5	NOT DETECTED	ND								
6/16/2021	Mid-Ebb	Cloudy	Moderate	C			Surface	2	1.0	29.5	8.1	102.8	6.42	-	36.17	-	2.0	-	2.1	-	<0.02	-	0.21	-	<0.05	-	<0.01	-	1.4	-	NOT DETECTED	-								
6/16/2021	Mid-Ebb	Cloudy	Moderate	C			Middle	1	4.8	29.0	8.1	92.0	5.79	-	36.37	-	2.1	-	2.6	-	<0.02	-	0.50	-	<0.05	-	<0.01	-	1.8	-	NOT DETECTED	-								
6/16/2021	Mid-Ebb	Cloudy	Moderate	C			Middle	2	4.8	29.1	8.1	93.2	5.86	-	36.36	-	2.0	-	2.8	-	<0.02	-	0.46	-	<0.05	-	<0.01	-	1.5	-	NOT DETECTED	-								
6/16/2021	Mid-Ebb	Cloudy	Moderate	C			Bottom	1	8.6	28.7	8.1	93.7	5.92	5.95	36.52	-	2.0	-	2.4	-	<0.02	-	0.51	-	<0.05	-	<0.01	-	1.2	-	NOT DETECTED	-								
6/16/2021	Mid-Ebb	Cloudy	Moderate	C			Bottom	2	8.6	28.7	8.1	94.6	5.98	-	36.51	-	2.2	-	3.0	-	<0.02	-	0.49	-	<0.05	-	<0.01	-	1.3	-	NOT DETECTED	-								
6/16/2021	Mid-Ebb	Cloudy	Moderate	N1	15:38	6.3	Surface	1	1.0	29.5	8.1	105.0	6.56	6.52	36.17	36.26	1.3	1.3	1.7	2.0	<0.02	<0.02	0.47	0.39	<0.05	<0.05	<0.01	<0.01	1.4	1.5	NOT DETECTED	ND								
6/16/2021	Mid-Ebb	Cloudy	Moderate	N1			Surface	2	1.0	29.5	8.1	104.8	6.55	-	36.17	-	1.4	-	2.5	-	<0.02	-	0.46	-	<0.05	-	<0.01	-	1.4	-	NOT DETECTED	-								
6/16/2021	Mid-Ebb	Cloudy	Moderate	N1			Middle	1	3.2	29.3	8.1	104.2	6.54	-	36.27	-	1.4	-	1.7	-	<0.02	-	0.48	-	<0.05	-	<0.01	-	1.8	-	NOT DETECTED	-								
6/16/2021	Mid-Ebb	Cloudy	Moderate	N1			Middle	2	3.2	29.1	8.1	102.3	6.41	-	36.33	-	1.3	-	2.2	-	<0.02	-	0.50	-	<0.05	-	<0.01	-	1.8	-	NOT DETECTED	-								
6/16/2021	Mid-Ebb	Cloudy	Moderate	N1			Bottom	1	5.3	28.9	8.1	99.2	6.23	6.30	36.40	-	1.3	-	1.9	-	<0.02	-	0.20	-	<0.05	-	<0.01	-	1.4	-	NOT DETECTED	-								
6/16/2021	Mid-Ebb	Cloudy	Moderate	N1			Bottom	2	5.3	29.2	8.1	101.0	6.37	-	36.21	-	1.3	-	2.2	-	<0.02	-	0.21	-	<0.05	-	<0.01	-	1.3	-	NOT DETECTED	-								
6/16/2021	Mid-Ebb	Cloudy	Moderate	FCZ1A	14:44	3.3	Surface	1	1.0	29.5	8.1	104.4	6.51	6.52	36.22	36.22	1.6	1.7	2.1	1.8	-	-	-	-	-	-	-	-	-	-	-									
6/16/2021	Mid-Ebb	Cloudy	Moderate	FCZ1A			Surface	2	1.0	29.6	8.1	104.5	6.52	-	36.21	-	1.7	-	1.5	-	-	-	-	-	-	-	-	-	-	-	-									
6/16/2021	Mid-Ebb	Cloudy	Moderate	FCZ1A			Bottom	1	2.3	29.5	8.1	104.4	6.52	6.51	36.21	-	1.8	-	2.0	-	-	-	-	-	-	-	-	-	-	-	-									
6/16/2021	Mid-Ebb	Cloudy	Moderate	FCZ1A			Bottom	2	2.3	29.5	8.1	104.2	6.50	-	36.22	-	1.8	-	1.4	-	-	-	-	-	-	-	-	-	-	-	-									
6/16/2021	Mid-Ebb	Cloudy	Moderate	FCZ1B	15:12	4.4	Surface	1	1.0	29.5	8.1	105.4	6.58	6.58	36.17	36.20	1.4	1.4	2.9	2.5	<0.02	<0.02	0.49	0.47	<0.05	<0.05	<0.01	<0.01	1.2	1.3	NOT DETECTED	ND								
6/16/2021	Mid-Ebb	Cloudy	Moderate	FCZ1B			Surface	2	1.0	29.5	8.1	105.2	6.57	-	36.18	-	1.3	-	2.8	-	<0.02	-	0.45	-	<0.05	-	<0.01	-	1.4	-	NOT DETECTED	-								
6/16/2021	Mid-Ebb	Cloudy	Moderate	FCZ1B			Bottom	1	3.4	29.3	8.1	104.8	6.56	6.56	36.23	-	1.5	-	2.6	-	<0.02	-	0.45	-	<0.05	-	<0.01	-	1.3	-	NOT DETECTED	-								
6/16/2021	Mid-Ebb	Cloudy	Moderate	FCZ1B			Bottom	2	3.4	29.4	8.1	104.8	6.55	-	36.22	-	1.4	-	1.7	-	<0.02	-	0.48	-	<0.05	-	<0.01	-	1.4	-	NOT DETECTED	-								
6/16/2021	Mid-Ebb	Cloudy	Moderate	H4A	14:58	1.8	Middle	1	0.9	29.6	8.1	104.9	6.55	6.55	36.19	36.19	1.5	1.5	2.4	2.4	<0.02	<0.02	0.51	0.52	<0.05	<0.05	<0.01	<0.01	1.5	1.5	NOT DETECTED	ND								
6/16/2021	Mid-Ebb	Cloudy	Moderate	H4A			Middle	2	0.9	29.6	8.1	105.0	6.55	-	36.18	-	1.4	-	2.3	-	<0.02	-	0.52	-	<0.05	-	<0.01	-	1.4	-	NOT DETECTED	-								
6/16/2021	Mid-Ebb	Cloudy	Moderate	H1A	14:30	1.8	Middle	1	0.9	29.5	8.1	104.0	6.49	6.49	36.22	36.22	1.7	1.7	2.0	2.5	<0.02	<0.02	0.47	0.48	<0.05	<0.05	<0.01	<0.01	1.3	1.6	NOT DETECTED	ND								
6/16/2021	Mid-Ebb	Cloudy	Moderate	H1A			Middle	2	0.9	29.5	8.1	103.9	6.49	-	36.22	-	1.7	-	3.0	-	<0.02	-	0.48	-	<0.05	-	<0.01	-	1.8	-	NOT DETECTED	-								
6/16/2021	Mid-Ebb	Cloudy	Moderate	M1A	14:17	1.0	Middle	1	0.5	29.5	8.1	103.5	6.47	6.47	36.23	36.23	1.5	1.5	1.6	2.0	<0.02	<0.02	0.50	0.49	<0.05	<0.05	<0.01	<0.01	1.3	1.3	NOT DETECTED	ND								
6/16/2021	Mid-Ebb	Cloudy	Moderate	M1A			Middle	2	0.5	29.5	8.1	103.6	6.47	-	36.23	-	1.4	-	2.3	-	<0.02	-	0.47	-	<0.05	-	<0.01	-	1.2	-	NOT DETECTED	-								
6/16/2021	Mid-Ebb	Cloudy	Moderate	SGA	14:03	1.0	Middle	1	0.5	29.5	8.1	103.1	6.44	6.45	36.24	36.24	1.3	1.3	2.9	2.4	<0.02	<0.02	0.50	0.51	<0.05	<0.05	<0.01	<0.01	1.2	1.3	1*	<1								
6/16/2021	Mid-Ebb	Cloudy	Moderate	SGA			Middle	2	0.5	29.5	8.1	103.5	6.46	-	36.23	-	1.3	-	1.9	-	<0.02	-	0.51	-	<0.05	-	<0.01	-	1.4	-	NOT DETECTED	-								

DA - Depth-averaged

Marine Water Quality Monitoring Results on 16-Jun-21 at Mid-Flood tide

Date	Tidal	Weather Condition	Sea Condition	Monitoring Station	Time	Water Depth, m	Water Level	Replicate	Sampling Depth	Temperature, °C	pH	DO Saturation, %	DO, mg/L		Salinity, ppt		Turbidity, NTU		Suspended Solid, mg/L		Ammonia Nitrogen, mg/L		Total Nitrogen, mg/L		Total Inorganic Nitrogen, mg/L		Total Phosphorus, mg/L		Biochemical Oxygen Demand, mg/L		E. Coli, Cfu/100ml									
													Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA
6/16/2021	Mid-Flood	Cloudy	Moderate	C	5:56	9.4	Surface	1	1.0	29.6	8.0	100.5	6.27	6.21	36.15	36.31	2.1	2.2	1.9	2.0	-	-	-	-	-	-	-	-	-	-	-									
6/16/2021	Mid-Flood	Cloudy	Moderate	C			Surface	2	1.0	29.6	8.0	102.4	6.31	-	36.16	-	2.0	-	2.6	-	-	-	-	-	-	-	-	-	-	-	-									
6/16/2021	Mid-Flood	Cloudy	Moderate	C			Middle	1	4.7	29.5	7.9	97.4	6.08	-	36.19	-	2.1	-	2.1	-	-	-	-	-	-	-	-	-	-	-	-									
6/16/2021	Mid-Flood	Cloudy	Moderate	C			Middle	2	4.7	29.3	7.9	97.7	6.16	-	36.27	-	2.2	-	1.6	-	-	-	-	-	-	-	-	-	-	-	-									
6/16/2021	Mid-Flood	Cloudy	Moderate	C			Bottom	1	8.4	28.6	7.9	87.9	5.56	5.49	36.57	-	2.4	-	2.0	-	-	-	-	-	-	-	-	-	-	-	-									
6/16/2021	Mid-Flood	Cloudy	Moderate	C			Bottom	2	8.4	28.8	7.9	86.5	5.42	-	36.49	-	2.3	-	1.5	-	-	-	-	-	-	-	-	-	-	-	-									
6/16/2021	Mid-Flood	Cloudy	Moderate	N2	6:23	5.2	Surface	1	1.0	29.6	8.1	106.8	6.66	6.66	36.14	36.15	1.7	1.8	2.1	2.1	-	-	-	-	-	-	-	-	-	-	-									
6/16/2021	Mid-Flood	Cloudy	Moderate	N2			Surface	2	1.0	29.6	8.1	106.6	6.65	-	36.15	-	1.8	-	2.9	-	-	-	-	-	-	-	-	-	-	-	-									
6/16/2021	Mid-Flood	Cloudy	Moderate	N2			Bottom	1	4.2	29.6	8.1	106.6	6.65	6.66	36.14	-	1.9	-	2.0	-	-	-	-	-	-	-	-	-	-	-	-									
6/16/2021	Mid-Flood	Cloudy	Moderate	N2			Bottom	2	4.2	29.5	8.1	106.6	6.66	-	36.15	-	1.9	-	1.4	-	-	-	-	-	-	-	-	-	-	-	-									
6/16/2021	Mid-Flood	Cloudy	Moderate	FCZ1A	6:50	3.2	Surface	1	1.0	29.6	8.1</																													

Marine Water Quality Monitoring Results on 21-Jun-21 at Mid-Ebb tide

Date	Tidal	Weather Condition	Sea Condition	Monitoring Station	Time	Water Depth, m	Water Level	Replicate	Sampling Depth	Temperature, °C	pH	DO Saturation, %	DO, mg/L		Salinity, ppt		Turbidity, NTU		Suspended Solid, mg/L		Ammonia Nitrogen, mg/L		Total Nitrogen, mg/L		Total Inorganic Nitrogen, mg/L		Total Phosphorus, mg/L		Biochemical Oxygen Demand, mg/L		E. Coli, Cfu/100ml	
													Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA
6/21/2021	Mid-Ebb	Sunny	Moderate	C	8:00	9.4	Surface	1	1.0	29.5	8.0	96.8	6.64	6.50	36.45	37.33	2.3	2.7	2.8	3.3	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	C			Surface	2	1.0	29.5	8.0	96.6	6.72	-	36.45	-	2.5	-	3.2	-	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	C			Middle	1	4.7	25.0	8.0	92.0	6.29	-	37.68	-	2.8	-	3.4	-	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	C			Middle	2	4.7	25.0	8.0	92.9	6.36	-	37.77	-	2.5	-	3.6	-	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	C			Bottom	1	8.4	24.5	7.9	80.9	5.44	5.57	37.81	-	3.0	-	3.2	-	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	C			Bottom	2	8.4	24.5	8.0	83.1	5.69	-	37.82	-	2.9	-	3.5	-	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	N1	8:15	6.5	Surface	1	1.0	29.4	8.2	105.2	7.17	6.84	36.46	36.94	2.4	2.5	2.8	2.9	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	N1			Surface	2	1.0	29.4	8.2	106.8	7.21	-	36.47	-	2.3	-	3.4	-	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	N1			Middle	1	3.3	29.3	8.1	94.1	6.55	-	36.49	-	2.5	-	2.5	-	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	N1			Middle	2	3.3	28.6	8.2	92.5	6.43	-	36.84	-	2.4	-	3.2	-	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	N1			Bottom	1	5.5	24.9	8.2	89.1	6.12	6.10	37.69	-	2.6	-	2.3	-	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	N1			Bottom	2	5.5	24.9	8.2	88.7	6.08	-	37.66	-	2.5	-	3.1	-	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	FCZ1A	8:56	3.5	Surface	1	1.0	29.4	8.2	112.4	7.02	7.02	36.47	36.47	2.0	2.0	1.9	2.5	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	FCZ1A			Surface	2	1.0	29.4	8.2	112.1	7.01	-	36.48	-	1.8	-	1.7	-	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	FCZ1A			Bottom	1	2.5	29.4	8.2	112.3	7.02	7.01	36.47	-	2.1	-	3.1	-	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	FCZ1A			Bottom	2	2.5	29.4	8.2	111.9	7.00	-	36.46	-	2.2	-	3.1	-	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	H4A	8:43	1.6	Middle	1	0.8	29.4	8.2	111.9	6.99	7.00	36.45	36.45	2.2	2.1	3.6	3.6	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	H4A			Middle	2	0.8	29.4	8.2	112.2	7.01	-	36.45	-	2.0	-	3.6	-	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	H1A	9:07	1.4	Middle	1	0.7	29.4	8.2	112.7	7.04	7.04	36.47	36.47	1.3	1.4	3.3	3.5	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	H1A			Middle	2	0.7	29.4	8.2	112.7	7.04	-	36.47	-	1.4	-	3.7	-	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	M1A	9:20	1.2	Middle	1	0.6	29.4	8.2	112.8	7.05	7.05	36.46	36.47	1.4	1.3	2.4	2.8	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	M1A			Middle	2	0.6	29.4	8.2	112.8	7.05	-	36.47	-	1.2	-	3.1	-	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	SGA	9:34	1.0	Middle	1	0.5	29.4	8.2	112.8	7.05	7.06	36.46	36.46	1.4	1.5	2.8	2.9	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Ebb	Sunny	Moderate	SGA			Middle	2	0.5	29.4	8.2	112.9	7.06	-	36.46	-	1.5	-	3.0	-	-	-	-	-	-	-	-	-	-	-	-	-

Marine Water Quality Monitoring Results on 21-Jun-21 at Mid-Flood tide

Date	Tidal	Weather Condition	Sea Condition	Monitoring Station	Time	Water Depth, m	Water Level	Replicate	Sampling Depth	Temperature, °C	pH	DO Saturation, %	DO, mg/L		Salinity, ppt		Turbidity, NTU		Suspended Solid, mg/L		Ammonia Nitrogen, mg/L		Total Nitrogen, mg/L		Total Inorganic Nitrogen, mg/L		Total Phosphorus, mg/L		Biochemical Oxygen Demand, mg/L		E. Coli, Cfu/100ml	
													Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA
6/21/2021	Mid-Flood	Sunny	Moderate	C	16:08	9.5	Surface	1	1.0	29.9	8.1	90.5	6.19	6.13	36.30	37.28	2.6	2.6	1.9	2.8	<0.02	<0.02	0.27	0.26	<0.05	<0.05	0.02	0.02	1.5	1.6	NOT DETECTED	ND
6/21/2021	Mid-Flood	Sunny	Moderate	C			Surface	2	1.0	29.9	8.0	91.4	6.24	-	36.31	-	2.5	-	2.5	-	<0.02	-	0.26	-	<0.05	-	0.02	-	1.8	-	NOT DETECTED	-
6/21/2021	Mid-Flood	Sunny	Moderate	C			Middle	1	4.8	24.8	8.0	86.5	5.93	-	37.76	-	2.7	-	2.5	-	<0.02	-	0.26	-	<0.05	-	0.02	-	1.5	-	NOT DETECTED	-
6/21/2021	Mid-Flood	Sunny	Moderate	C			Middle	2	4.8	24.9	8.0	89.9	6.16	-	37.75	-	2.5	-	2.8	-	<0.02	-	0.27	-	<0.05	-	0.02	-	1.6	-	NOT DETECTED	-
6/21/2021	Mid-Flood	Sunny	Moderate	C			Bottom	1	8.5	24.8	8.0	82.1	5.61	5.80	37.77	-	2.8	-	3.5	-	<0.02	-	0.26	-	<0.05	-	0.02	-	1.5	-	NOT DETECTED	-
6/21/2021	Mid-Flood	Sunny	Moderate	C			Bottom	2	8.5	24.8	8.0	87.7	5.99	-	37.77	-	2.7	-	3.8	-	<0.02	-	0.26	-	<0.05	-	0.02	-	1.4	-	NOT DETECTED	-
6/21/2021	Mid-Flood	Sunny	Moderate	N2	15:38	5.7	Surface	1	1.0	29.9	8.1	97.1	6.64	6.63	36.31	37.03	1.8	2.0	2.2	2.6	<0.02	<0.02	0.28	0.28	<0.05	<0.05	0.02	0.02	1.9	1.7	NOT DETECTED	ND
6/21/2021	Mid-Flood	Sunny	Moderate	N2			Surface	2	1.0	29.8	8.1	96.9	6.61	-	36.33	-	1.9	-	3.0	-	<0.02	-	0.29	-	<0.05	-	0.02	-	1.6	-	NOT DETECTED	-
6/21/2021	Mid-Flood	Sunny	Moderate	N2			Bottom	1	4.7	25.0	8.1	93.8	6.41	6.47	37.75	-	2.1	-	2.6	-	<0.02	-	0.27	-	<0.05	-	0.02	-	1.6	-	NOT DETECTED	-
6/21/2021	Mid-Flood	Sunny	Moderate	N2			Bottom	2	4.7	24.9	8.1	95.5	6.52	-	37.73	-	2.0	-	2.5	-	<0.02	-	0.28	-	<0.05	-	0.02	-	1.5	-	NOT DETECTED	-
6/21/2021	Mid-Flood	Sunny	Moderate	FCZ1A	14:57	3.6	Surface	1	1.0	29.7	8.2	117.1	7.28	7.29	36.38	36.38	2.0	2.0	3.2	2.9	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Flood	Sunny	Moderate	FCZ1A			Surface	2	1.0	29.8	8.2	117.5	7.30	-	36.37	-	2.0	-	2.5	-	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Flood	Sunny	Moderate	FCZ1A			Bottom	1	2.6	29.7	8.2	117.2	7.29	7.30	36.39	-	1.9	-	3.4	-	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Flood	Sunny	Moderate	FCZ1A			Bottom	2	2.6	29.7	8.2	117.4	7.30	-	36.38	-	2.0	-	2.4	-	-	-	-	-	-	-	-	-	-	-	-	-
6/21/2021	Mid-Flood	Sunny	Moderate	FCZ1B	15:24	4.4	Surface	1	1.0	29.8	8.1	106.3	6.60	6.43	36.34	36.73	1.5	1.5	2.8	2.6	<0.02	<0.02	0.27	0.28	<0.05	<0.05	0.02	0.02	2.2	1.7	NOT DETECTED	ND
6/21/2021	Mid-Flood	Sunny	Moderate	FCZ1B			Surface	2	1.0	29.8	8.1	100.6	6.25	-	36.35	-	1.4	-	3.3	-	<0.02	-	0.28	-	<0.05	-	0.02	-	1.6	-	NOT DETECTED	-
6/21/2021	Mid-Flood	Sunny	Moderate	FCZ1B			Bottom	1	3.4	27.3	8.1	107.0	6.89	6.84	37.04	-	1.5	-	2.1	-	<0.02	-	0.28	-	<0.05	-	0.02	-	1.5	-	NOT DETECTED	-
6/21/2021	Mid-Flood	Sunny	Moderate	FCZ1B			Bottom	2	3.4	26.7	8.1	104.4	6.78	-	37.20	-	1.7	-	2.2	-	<0.02	-	0.28	-	<0.05	-	0.02	-	1.5	-	NOT DETECTED	-
6/21/2021	Mid-Flood	Sunny	Moderate	H4A	15:10	1.6	Middle	1	0.8	29.8	8.2	119.4	7.41	7.41	36.34	36.34	1.6	1.7	3.0	2.7	<0.02	<0.02	0.30	0.31	<0.05	<0.05	0.02	0.02	1.6	1.7	NOT DETECTED	ND
6/21/2021	Mid-Flood	Sunny	Moderate	H4A			Middle	2	0.8	29.8	8.2	119.2	7.40	-	36.34	-	1.8	-	2.4	-	<0.02	-	0.32	-	<0.05	-	0.02	-	1.7	-	NOT DETECTED	-
6/21/2021	Mid-Flood	Sunny	Moderate	H1A	14:42	1.4	Middle	1	0.7	29.7	8.2	110.6	6.88	7.02	36.40	36.39	1.7	1.8	3.6	3.2	<0.02	<0.02	0.28	0.29	<0.05	<0.05	0.02	0.02	1.6	1.6	NOT DETECTED	ND
6/21/2021	Mid-Flood	Sunny	Moderate	H1A			Middle	2	0.7	29.7	8.2	115.0	7.15	-	36.37	-	1.8	-	2.7	-	<0.02	-	0.29	-	<0.05	-	0.02	-	1.6	-	NOT DETECTED	-
6/21/2021	Mid-Flood	Sunny	Moderate	M1A	14:28	1.4	Middle	1	0.7	29.4	8.2	113.0	7.06	7.05	36.50	36.50	2.1	2.0	2.1	2.7	<0.02	<0.02	0.30	0.30	<0.05	<						

Marine Water Quality Monitoring Results on 23-Jun-21 at Mid-Ebb tide

Date	Tidal	Weather Condition	Sea Condition	Monitoring Station	Time	Water Depth, m	Water Level	Replicate	Sampling Depth	Temperature, °C	pH	DO Saturation, %	DO, mg/L		Salinity, ppt		Turbidity, NTU		Suspended Solid, mg/L		Ammonia Nitrogen, mg/L		Total Nitrogen, mg/L		Total Inorganic Nitrogen, mg/L		Total Phosphorus, mg/L		Biochemical Oxygen Demand, mg/L		E. Coli, Cfu/100ml	
													Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA
6/23/2021	Mid-Ebb	Fine	Moderate	C	9:50	9.5	Surface	1	1.0	28.4	8.0	66.8	4.26	4.04	35.50	36.95	2.3	2.4	2.4	2.3	-	-	-	-	-	-	-	-	-	-	-	-
6/23/2021	Mid-Ebb	Fine	Moderate	C			Surface	2	1.0	28.5	8.0	74.4	4.74	-	35.38	-	2.2	-	2.8	-	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	C			Middle	1	4.8	25.5	7.8	54.9	3.63	-	37.69	-	2.3	-	2.6	-	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	C			Middle	2	4.8	25.6	7.9	53.2	3.51	-	37.61	-	2.4	-	2.5	-	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	C			Bottom	1	8.5	25.0	7.9	71.1	4.74	4.68	37.79	-	2.5	-	1.4	-	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	C			Bottom	2	8.5	25.2	7.9	69.6	4.62	-	37.75	-	2.8	-	2.2	-	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	N1	10:04	6.7	Surface	1	1.0	28.4	8.0	83.0	5.30	5.35	35.41	36.96	1.4	1.6	1.1	1.8	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	N1			Surface	2	1.0	28.4	8.0	84.9	5.41	-	35.54	-	1.3	-	1.3	-	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	N1			Middle	1	3.4	25.6	7.9	81.2	5.37	-	37.66	-	1.7	-	1.3	-	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	N1			Middle	2	3.4	25.7	7.9	80.9	5.33	-	37.62	-	1.8	-	1.8	-	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	N1			Bottom	1	5.7	25.2	8.0	76.4	5.07	5.09	37.78	-	1.8	-	2.6	-	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	N1			Bottom	2	5.7	25.2	7.9	76.8	5.11	-	37.73	-	1.6	-	2.4	-	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	FCZ1A	10:35	3.5	Surface	1	1.0	28.5	8.1	94.2	6.00	6.07	35.58	36.53	1.5	1.6	1.3	1.7	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	FCZ1A			Surface	2	1.0	28.4	8.1	96.4	6.14	-	35.64	-	1.4	-	1.2	-	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	FCZ1A			Bottom	1	2.5	26.0	8.0	85.6	5.61	6.03	37.50	-	1.7	-	1.8	-	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	FCZ1A			Bottom	2	2.5	26.2	8.1	98.6	6.45	-	37.41	-	1.6	-	2.6	-	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	H4A	10:23	1.6	Middle	1	0.8	28.4	8.1	106.1	6.77	6.91	35.51	35.51	1.3	1.4	1.6	1.5	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	H4A			Middle	2	0.8	28.5	8.1	110.6	7.05	-	35.50	-	1.5	-	1.3	-	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	H1A	10:48	1.4	Middle	1	0.7	28.5	8.1	111.0	7.08	6.87	35.52	35.54	1.5	1.5	1.5	1.9	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	H1A			Middle	2	0.7	28.5	8.1	104.3	6.65	-	35.55	-	1.4	-	2.2	-	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	M1A	11:01	1.0	Middle	1	0.5	28.5	8.1	113.8	7.26	7.26	35.50	35.50	1.2	1.2	2.0	2.4	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	M1A			Middle	2	0.5	28.5	8.1	113.7	7.25	-	35.50	-	1.1	-	2.8	-	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	SGA	11:15	1.2	Middle	1	0.6	28.5	8.1	114.0	7.27	7.28	35.46	35.47	1.6	1.5	2.5	2.7	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Ebb	Fine	Moderate	SGA			Middle	2	0.6	28.4	8.1	114.1	7.28	-	35.47	-	1.4	-	2.8	-	-	-	-	-	-	-	-	-	-	-	-	

Marine Water Quality Monitoring Results on 23-Jun-21 at Mid-Flood tide

Date	Tidal	Weather Condition	Sea Condition	Monitoring Station	Time	Water Depth, m	Water Level	Replicate	Sampling Depth	Temperature, °C	pH	DO Saturation, %	DO, mg/L		Salinity, ppt		Turbidity, NTU		Suspended Solid, mg/L		Ammonia Nitrogen, mg/L		Total Nitrogen, mg/L		Total Inorganic Nitrogen, mg/L		Total Phosphorus, mg/L		Biochemical Oxygen Demand, mg/L		E. Coli, Cfu/100ml	
													Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA	Value	DA
6/23/2021	Mid-Flood	Fine	Moderate	C	18:20	9.3	Surface	1	1.0	28.3	8.1	56.7	3.77	4.58	35.50	37.01	1.8	1.8	2.1	2.2	<0.02	<0.02	0.23	0.24	<0.05	<0.05	0.02	0.02	1.1	1.2	25	21
6/23/2021	Mid-Flood	Fine	Moderate	C			Surface	2	1.0	28.3	8.1	59.6	3.95	-	35.58	-	1.7	-	1.7	-	<0.02	-	0.25	-	<0.05	-	0.02	-	1.2	-	21	-
6/23/2021	Mid-Flood	Fine	Moderate	C			Middle	1	4.7	25.3	7.9	81.5	5.44	-	37.65	-	1.8	-	1.7	-	<0.02	-	0.23	-	<0.05	-	0.02	-	1.1	-	26	-
6/23/2021	Mid-Flood	Fine	Moderate	C			Middle	2	4.7	25.2	7.9	77.5	5.17	-	37.65	-	1.9	-	2.3	-	<0.02	-	0.24	-	<0.05	-	0.02	-	1.1	-	24	-
6/23/2021	Mid-Flood	Fine	Moderate	C			Bottom	1	8.3	25.0	8.0	86.1	5.50	5.37	37.80	-	1.8	-	2.4	-	<0.02	-	0.24	-	<0.05	-	0.02	-	1.2	-	13	-
6/23/2021	Mid-Flood	Fine	Moderate	C			Bottom	2	8.3	24.9	8.0	81.9	5.23	-	37.86	-	2.0	-	3.0	-	<0.02	-	0.24	-	<0.05	-	0.02	-	1.3	-	14	-
6/23/2021	Mid-Flood	Fine	Moderate	N2	17:53	5.3	Surface	1	1.0	28.3	8.1	90.8	6.04	6.02	35.57	36.67	1.2	1.1	1.5	1.5	<0.02	<0.02	0.24	0.25	<0.05	<0.05	0.02	0.02	1.1	1.1	25	20
6/23/2021	Mid-Flood	Fine	Moderate	N2			Surface	2	1.0	28.3	8.0	91.0	6.00	-	35.71	-	1.2	-	1.4	-	<0.02	-	0.25	-	<0.05	-	0.02	-	1.1	-	19	-
6/23/2021	Mid-Flood	Fine	Moderate	N2			Bottom	1	4.3	25.2	8.1	92.3	6.14	6.01	37.82	-	1.0	-	1.4	-	<0.02	-	0.24	-	<0.05	-	0.02	-	1.1	-	16	-
6/23/2021	Mid-Flood	Fine	Moderate	N2			Bottom	2	4.3	25.7	8.1	89.2	5.88	-	37.57	-	1.1	-	1.7	-	<0.02	-	0.25	-	<0.05	-	0.02	-	1.2	-	21	-
6/23/2021	Mid-Flood	Fine	Moderate	FCZ1A	17:12	3.1	Surface	1	1.0	28.3	8.1	82.8	5.29	5.72	35.52	36.36	1.6	1.6	1.8	2.0	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Flood	Fine	Moderate	FCZ1A			Surface	2	1.0	28.4	8.1	96.3	6.15	-	35.53	-	1.5	-	2.4	-	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Flood	Fine	Moderate	FCZ1A			Bottom	1	2.1	26.8	8.0	90.2	5.86	5.41	37.09	-	1.7	-	1.6	-	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Flood	Fine	Moderate	FCZ1A			Bottom	2	2.1	26.4	8.0	75.9	4.96	-	37.30	-	1.5	-	2.2	-	-	-	-	-	-	-	-	-	-	-	-	
6/23/2021	Mid-Flood	Fine	Moderate	FCZ1B	17:40	4.3	Surface	1	1.0	28.4	8.1	92.6	5.91	5.64	35.53	36.57	1.1	1.2	2.3	2.3	<0.02	<0.02	0.24	0.24	<0.05	<0.05	0.02	0.02	<1.0	1.1	26	23
6/23/2021	Mid-Flood	Fine	Moderate	FCZ1B			Surface	2	1.0	28.3	8.0	84.1	5.37	-	35.68	-	1.0	-	2.0	-	<0.02	-	0.23	-	<0.05	-	0.02	-	1.1	-	26	-
6/23/2021	Mid-Flood	Fine	Moderate	FCZ1B			Bottom	1	3.3	25.7	8.0	93.3	6.15	5.88	37.53	-	1.2	-	2.5	-	<0.02	-	0.25	-	<0.05	-	0.02	-	1.1	-	23	-
6/23/2021	Mid-Flood	Fine	Moderate	FCZ1B			Bottom	2	3.3	25.8	8.0	85.0	5.60	-	37.55	-	1.4	-	2.3	-	<0.02	-	0.24	-	<0.05	-	0.02	-	1.2	-	18	-
6/23/2021	Mid-Flood	Fine</																														

Composite Effluent Quality Monitoring Results (1-year Operation of TSTP)

Date	Monitoring Station	Replicate	Temperature*	pH	DO	DO	Salinity	Turbidity	Suspended Solids	Ammonia Nitrogen	Total Nitrogen	Total Inorganic Nitrogen	Total Phosphorus	E. Coli	Biochemical Oxygen Demand ^A
			°C		Saturation %									mg/L	
6/1/2021	Effluent	1	6.6	7.8	74.0	8.57	0.2	2.2	2	0.41	17.8	14.6	1.87	250	<2
		2	6.6	7.8	73.4	8.51	0.2	2.3	-	-	-	-	-	-	-
6/2/2021	Effluent	1	6.6	7.8	76.7	8.91	0.2	2.2	3	0.58	15.6	13.7	2.18	71	<2
		2	6.6	7.8	75.9	8.78	0.2	2.2	-	-	-	-	-	-	-
6/3/2021	Effluent	1	6.6	7.9	71.8	8.33	0.2	2.2	<2	0.58	16.2	13.6	2.19	88	2
		2	6.6	7.9	71.4	8.28	0.2	2.2	-	-	-	-	-	-	-
6/4/2021	Effluent	1	6.6	7.8	68.8	8.14	0.2	2.2	2	0.1	18	15.7	1.94	86	3
		2	6.6	7.8	68.1	8.07	0.2	2.1	-	-	-	-	-	-	-
6/5/2021	Effluent	1	6.6	7.9	70.4	8.69	0.2	2.3	3	0.22	18	15.4	1.93	120	<2
		2	6.6	7.9	69.3	8.59	0.2	2.2	-	-	-	-	-	-	-
6/6/2021	Effluent	1	6.2	8.2	78.2	9.77	0.22	2.3	6	2	15.5	13.5	2.44	580	3
		2	6.2	8.2	76.7	9.54	0.2	2.4	-	-	-	-	-	-	-
6/7/2021	Effluent	1	6.6	7.7	75.7	8.26	0.2	2.2	3	1.95	16	13.4	2.48	560	2
		2	6.6	7.7	75.0	8.18	0.2	2.3	-	-	-	-	-	-	-
6/8/2021	Effluent	1	6.0	8.2	73.8	9.13	0.14	1.9	3	1.66	19.3	17.2	2.47	170	<2
		2	6.1	8.2	74.6	9.26	0.16	2.0	-	-	-	-	-	-	-
6/9/2021	Effluent	1	6.0	8.2	73.7	9.30	0.15	2.1	2	1.6	18.9	17.1	2.43	340	<2
		2	6.1	8.2	75.2	9.46	0.14	1.8	-	-	-	-	-	-	-
6/10/2021	Effluent	1	6.3	8.2	74.6	9.20	0.19	2.2	<2	0.07	17.8	16.8	2.62	380	<2
		2	6.2	8.2	73.3	9.27	0.18	2.0	-	-	-	-	-	-	-
6/11/2021	Effluent	1	6.5	8.2	71.9	9.01	0.24	2.3	<2	0.12	17.5	17	2.57	290	<2
		2	6.5	8.2	72.7	9.12	0.22	2.5	-	-	-	-	-	-	-
6/12/2021	Effluent	1	6.3	8.2	75.4	9.37	0.14	1.8	8	1.85	18.1	17	2.46	360	2
		2	6.2	8.2	76.3	9.45	0.13	2.0	-	-	-	-	-	-	-
6/13/2021	Effluent	1	6.3	8.2	77.6	9.48	0.16	1.7	3	1.58	19.5	18.3	2.34	380	<2
		2	6.2	8.2	78.7	9.50	0.16	2.0	-	-	-	-	-	-	-
6/14/2021	Effluent	1	6.6	7.8	76.6	8.24	0.2	2.2	2	1.4	19.7	18.8	2.4	470	<2
		2	6.6	7.8	76.6	8.17	0.2	2.2	-	-	-	-	-	-	-
6/15/2021	Effluent	1	6.6	7.8	72.4	7.82	0.2	2.1	4	1.56	19.8	18.5	2.33	290	<2
		2	6.6	7.8	71.7	7.74	0.2	2.1	-	-	-	-	-	-	-
6/16/2021	Effluent	1	6.6	7.8	70.6	7.55	0.2	2.1	3	1.68	19.5	18.4	2.3	450	<2
		2	6.6	7.8	70.2	7.50	0.2	2.2	-	-	-	-	-	-	-
6/17/2021	Effluent	1	6.6	7.8	75.7	8.25	0.2	2.1	3	2.35	18	16.8	2.74	50	3
		2	6.6	7.8	75.0	8.18	0.2	2.1	-	-	-	-	-	-	-
6/18/2021	Effluent	1	6.6	7.8	76.2	7.95	0.2	2.1	4	2.37	19.5	17.1	2.97	420	3
		2	6.6	7.8	75.7	7.90	0.2	2.1	-	-	-	-	-	-	-
6/19/2021	Effluent	1	6.6	7.8	80.4	7.96	0.2	2.2	6	2.78	19.7	17.5	2.73	68	4
		2	6.6	7.8	80.0	7.92	0.2	2.2	-	-	-	-	-	-	-
6/20/2021	Effluent	1	6.6	7.8	77.4	8.16	0.2	2.1	6	2.71	20.1	18.9	2.83	230	4
		2	6.6	7.8	77.0	8.12	0.2	2.1	-	-	-	-	-	-	-
6/21/2021	Effluent	1	6.3	8.1	76.3	9.34	0.2	2.0	6	0.06	18.9	17.3	2.05	110	4
		2	6.4	8.1	78.2	9.46	0.18	2.1	-	-	-	-	-	-	-
6/22/2021	Effluent	1	6.6	7.9	72.4	7.91	0.2	2.1	6	0.08	17.8	17.4	1.95	410	3
		2	6.6	7.9	71.8	7.83	0.2	2.1	-	-	-	-	-	-	-
6/23/2021	Effluent	1	6.6	7.8	70.6	7.20	0.2	2.1	7	0.08	12.3	11.5	1.31	110	3
		2	6.6	7.8	70.1	7.15	0.2	2.1	-	-	-	-	-	-	-
6/24/2021	Effluent	1	6.6	7.8	78.6	8.22	0.2	2.1	6	0.09	13	12.2	1.27	110	3
		2	6.6	7.8	78.0	8.14	0.2	2.1	-	-	-	-	-	-	-
6/25/2021	Effluent	1	6.4	8.3	72.4	8.44	0.23	2.1	4	0.19	18.3	18	1.68	560	3
		2	6.4	8.3	73.5	8.57	0.24	2.0	-	-	-	-	-	-	-
6/26/2021	Effluent	1	6.1	8.2	75.7	8.62	0.17	2.2	4	0.18	18.8	18.6	1.68	140	<2
		2	6.0	8.2	73.8	8.57	0.19	2.1	-	-	-	-	-	-	-
6/27/2021	Effluent	1	6.1	8.1	74.3	8.66	0.21	2.2	3	0.02	12.5	11.5	1.18	1400	<2
		2	6.2	8.1	73.5	8.52	0.19	2.0	-	-	-	-	-	-	-
6/28/2021	Effluent	1	6.3	8.2	75.9	8.62	0.22	1.9	4	0.03	12	11	1.15	350	<2
		2	6.3	8.2	76.7	8.74	0.19	2.0	-	-	-	-	-	-	-
6/29/2021	Effluent	1	6.6	7.8	73.2	7.86	0.2	2.1	<2	0.08	18.2	17.2	1.7	410	<2
		2	6.6	7.8	72.4	7.79	0.2	2.1	-	-	-	-	-	-	-
6/30/2021	Effluent	1	6.2	8.1	76.3	8.66	0.21	2.1	<2	0.08	18.7	18.5	1.68	2200	<2
		2	6.2	8.1	75.2	8.57	0.18	2.4	-	-	-	-	-	-	-

Action Level	20	-	28.6	-	3.3	664	13.3
Limit Level	40	-	57.1	-	6.6	996	26.6

A 24-hour flow-weighted composite effluent sample was collected and mixed.

* Effluent sample was collected by refrigerated autosampler. The collected samples were kept in low temperature during 24-hr sampling period.

^ABOD5 tested with nitrification inhibitor

Action Level - Value presented in bold,

Limit Level - Value presented in bold and underlined

QAQC Reports

2 June 2021

Laboratory Duplicate (DUP) Report

Matrix: WATER				Laboratory Duplicate (DUP) Report				
Laboratory sample ID	Sample ID	Method: Compound	CAS Number	LOR	Unit	Original Result	Duplicate Result	RPD (%)
EA/ED: Physical and Aggregate Properties (QC Lot: 3716890)								
HK2120925-001	FCZ1B_S Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	3.3	3.1	6.2
HK2120925-039	H4A_M Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	5.1	5.4	5.3
EA/ED: Physical and Aggregate Properties (QC Lot: 3716891)								
HK2120925-057	C_M Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	3.4	3.6	5.7
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3718600)								
HK2120925-034	H1A_M_Dup Ebb	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3718601)								
HK2120925-060	C_B_Dup Ebb	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3721245)								
HK2120925-034	H1A_M_Dup Ebb	EK067P: Total Phosphorus as P	----	0.01	mg/L	0.02	0.01	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3721246)								
HK2121716-022	Anonymous	EK067P: Total Phosphorus as P	----	0.01	mg/L	0.01	0.01	0.0

Method Blank (MB), Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report

Matrix: WATER				Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report							
Method: Compound	CAS Number	Method Blank (MB) Report			Spike Concentration	Spike Recovery (%)				RPD (%)	
		LOR	Unit	Result		LCS	DCS	Low	High		Value
EA/ED: Physical and Aggregate Properties (QC Lot: 3716890)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	108	----	85.9	117	----	----
EA/ED: Physical and Aggregate Properties (QC Lot: 3716891)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	99.0	----	85.9	117	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3718600)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	99.2	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3718601)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	102	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3721245)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	97.5	----	93.6	102	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3721246)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	97.1	----	93.6	102	----	----

4 June 2021

Laboratory Duplicate (DUP) Report

Matrix: WATER				Laboratory Duplicate (DUP) Report				
Laboratory sample ID	Sample ID	Method: Compound	CAS Number	LOR	Unit	Original Result	Duplicate Result	RPD (%)
EA/ED: Physical and Aggregate Properties (QC Lot: 3719358)								
HK2121716-001	FCZ1B_S Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.6	2.2	15.9
HK2121716-039	H4A_M Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.4	2.6	10.1
EA/ED: Physical and Aggregate Properties (QC Lot: 3719359)								
HK2121716-057	C_M Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	1.8	2.0	7.9
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3721002)								
HK2121716-056	C_S_Dup Ebb	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3721003)								
HK2121716-060	C_B_Dup Ebb	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3721246)								
HK2121716-022	SGA_M_Dup Ebb	EK067P: Total Phosphorus as P	----	0.01	mg/L	0.01	0.01	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3721247)								
HK2121716-060	C_B_Dup Ebb	EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.01	0.0

Method Blank (MB), Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report

Matrix: WATER				Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report							
Method: Compound	CAS Number	Method Blank (MB) Report			Spike Concentration	Spike Recovery (%)				RPD (%)	
		LOR	Unit	Result		LCS	DCS	Low	High		Value
EA/ED: Physical and Aggregate Properties (QC Lot: 3719358)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	98.5	----	85.9	117	----	----
EA/ED: Physical and Aggregate Properties (QC Lot: 3719359)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	100	----	85.9	117	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3721002)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	99.7	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3721003)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	99.7	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3721246)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	97.1	----	93.6	102	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3721247)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	97.9	----	93.6	102	----	----

7 June 2021

Laboratory Duplicate (DUP) Report

Matrix: WATER				Laboratory Duplicate (DUP) Report				
Laboratory sample ID	Sample ID	Method: Compound	CAS Number	LOR	Unit	Original Result	Duplicate Result	RPD (%)
EA/ED: Physical and Aggregate Properties (QC Lot: 3724392)								
HK2121717-001	FCZ1B_S Flood	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.0	2.4	16.8
HK2121717-039	H4A_M Flood	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.4	2.8	13.6
EA/ED: Physical and Aggregate Properties (QC Lot: 3724393)								
HK2121717-059	C_B Flood	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.1	2.4	15.6
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3726126)								
HK2121717-058	C_M_Dup Flood	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3726127)								
HK2121717-060	C_B_Dup Flood	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3726394)								
HK2121717-034	H1A_M_Dup Flood	EK067P: Total Phosphorus as P	----	0.01	mg/L	0.01	0.01	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3726395)								
HK2121717-060	C_B_Dup Flood	EK067P: Total Phosphorus as P	----	0.01	mg/L	0.01	0.01	0.0

Method Blank (MB), Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report

Matrix: WATER		Method Blank (MB) Report			Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report						
Method: Compound	CAS Number	LOR	Unit	Result	Spike Concentration	Spike Recovery (%)		Recovery Limits(%)		RPD (%)	Control Limit
						LCS	DCS	Low	High	Value	
EA/ED: Physical and Aggregate Properties (QC Lot: 3724392)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	106	----	85.9	117	----	----
EA/ED: Physical and Aggregate Properties (QC Lot: 3724393)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	100	----	85.9	117	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3726126)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	100	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3726127)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	97.4	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3726394)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	96.7	----	93.6	102	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3726395)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	97.7	----	93.6	102	----	----

9 June 2021

Laboratory Duplicate (DUP) Report

Matrix: WATER				Laboratory Duplicate (DUP) Report				
Laboratory sample ID	Sample ID	Method: Compound	CAS Number	LOR	Unit	Original Result	Duplicate Result	RPD (%)
EA/ED: Physical and Aggregate Properties (QC Lot: 3727127)								
HK2121718-001	FCZ1B_S Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	1.8	2.1	15.6
HK2121718-039	H4A_M Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.8	3.2	14.3
EA/ED: Physical and Aggregate Properties (QC Lot: 3727128)								
HK2121718-057	C_M Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.5	2.8	13.1
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3727018)								
HK2121718-056	C_S_Dup Ebb	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3727019)								
HK2121718-060	C_B_Dup Ebb	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3727036)								
HK2121718-034	H1A_M_Dup Ebb	EK067P: Total Phosphorus as P	----	0.01	mg/L	0.02	0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3727037)								
HK2121718-060	C_B_Dup Ebb	EK067P: Total Phosphorus as P	----	0.01	mg/L	0.02	0.02	0.0

Method Blank (MB), Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report

Matrix: WATER		Method Blank (MB) Report			Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report						
Method: Compound	CAS Number	LOR	Unit	Result	Spike Concentration	Spike Recovery (%)		Recovery Limits(%)		RPD (%)	Control Limit
						LCS	DCS	Low	High	Value	
EA/ED: Physical and Aggregate Properties (QC Lot: 3727127)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	102	----	85.9	117	----	----
EA/ED: Physical and Aggregate Properties (QC Lot: 3727128)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	104	----	85.9	117	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3727018)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	97.4	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3727019)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	95.8	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3727036)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	97.9	----	93.6	102	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3727037)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	97.3	----	93.6	102	----	----

11 June 2021

Laboratory Duplicate (DUP) Report

Matrix: WATER				Laboratory Duplicate (DUP) Report				
Laboratory sample ID	Sample ID	Method: Compound	CAS Number	LOR	Unit	Original Result	Duplicate Result	RPD (%)
EA/ED: Physical and Aggregate Properties (QC Lot: 3732630)								
HK2121823-001	FCZ1B_S Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.3	2.7	14.0
HK2121823-039	H4A_M Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.6	2.3	13.1
EA/ED: Physical and Aggregate Properties (QC Lot: 3732631)								
HK2121823-057	C_M Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	1.7	2.0	13.5
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3732535)								
HK2121823-056	C_S_Dup Ebb	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3732536)								
HK2121823-060	C_B_Dup Ebb	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3736492)								
HK2121823-034	H1A_M_Dup Ebb	EK067P: Total Phosphorus as P	----	0.01	mg/L	0.01	0.01	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3736493)								
HK2122795-022	Anonymous	EK067P: Total Phosphorus as P	----	0.01	mg/L	0.02	0.02	0.0

Method Blank (MB), Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report

Matrix: WATER		Method Blank (MB) Report			Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report						
Method: Compound	CAS Number	LOR	Unit	Result	Spike Concentration	Spike Recovery (%)		Recovery Limits(%)		RPD (%)	Control Limit
						LCS	DCS	Low	High	Value	
EA/ED: Physical and Aggregate Properties (QC Lot: 3732630)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	108	----	85.9	117	----	----
EA/ED: Physical and Aggregate Properties (QC Lot: 3732631)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	104	----	85.9	117	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3732535)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	99.5	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3732536)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	98.8	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3736492)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	97.2	----	93.6	102	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3736493)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	97.1	----	93.6	102	----	----

14 June 2021

Laboratory Duplicate (DUP) Report

Matrix: WATER				Laboratory Duplicate (DUP) Report				
Laboratory sample ID	Sample ID	Method: Compound	CAS Number	LOR	Unit	Original Result	Duplicate Result	RPD (%)
EA/ED: Physical and Aggregate Properties (QC Lot: 3737236)								
HK2122795-001	FCZ1B_S Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.6	2.8	7.3
HK2122795-039	H4A_M Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.2	2.4	7.7
EA/ED: Physical and Aggregate Properties (QC Lot: 3737237)								
HK2122795-057	C_M Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.4	2.5	6.1
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3736240)								
HK2122795-056	C_S_Dup Ebb	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3736241)								
HK2122795-060	C_B_Dup Ebb	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3736493)								
HK2122795-022	SGA_M_Dup Ebb	EK067P: Total Phosphorus as P	----	0.01	mg/L	0.02	0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3736494)								
HK2122795-060	C_B_Dup Ebb	EK067P: Total Phosphorus as P	----	0.01	mg/L	0.01	0.02	0.0

Method Blank (MB), Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report

Matrix: WATER		Method Blank (MB) Report			Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report						
Method: Compound	CAS Number	LOR	Unit	Result	Spike Concentration	Spike Recovery (%)		Recovery Limits(%)		RPD (%)	Control Limit
						LCS	DCS	Low	High	Value	
EA/ED: Physical and Aggregate Properties (QC Lot: 3737236)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	95.5	----	85.9	117	----	----
EA/ED: Physical and Aggregate Properties (QC Lot: 3737237)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	101	----	85.9	117	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3736240)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	104	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3736241)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	102	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3736493)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	97.1	----	93.6	102	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3736494)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	96.8	----	93.6	102	----	----

16 June 2021

Laboratory Duplicate (DUP) Report

Matrix: WATER				Laboratory Duplicate (DUP) Report				
Laboratory sample ID	Sample ID	Method: Compound	CAS Number	LOR	Unit	Original Result	Duplicate Result	RPD (%)
EA/ED: Physical and Aggregate Properties (QC Lot: 3742487)								
HK2122797-001	FCZ1B_S Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.9	3.2	8.2
HK2122797-039	H4A_M Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.4	2.7	9.8
EA/ED: Physical and Aggregate Properties (QC Lot: 3742488)								
HK2122797-057	C_M Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.6	2.4	11.1
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3741358)								
HK2122797-056	C_S_Dup Ebb	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3741359)								
HK2122797-060	C_B_Dup Ebb	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3744424)								
HK2122797-034	H1A_M_Dup Ebb	EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	<0.01	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3744425)								
HK2122797-060	C_B_Dup Ebb	EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	<0.01	0.0

Method Blank (MB), Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report

Matrix: WATER		Method Blank (MB) Report			Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report						
Method: Compound	CAS Number	LOR	Unit	Result	Spike Concentration	Spike Recovery (%)		Recovery Limits(%)		RPD (%)	
						LCS	DCS	Low	High	Value	Control Limit
EA/ED: Physical and Aggregate Properties (QC Lot: 3742487)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	102	----	85.9	117	----	----
EA/ED: Physical and Aggregate Properties (QC Lot: 3742488)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	94.5	----	85.9	117	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3741358)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	107	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3741359)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	104	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3744424)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	96.8	----	93.6	102	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3744425)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	96.3	----	93.6	102	----	----

18 June 2021

Laboratory Duplicate (DUP) Report

Matrix: WATER				Laboratory Duplicate (DUP) Report				
Laboratory sample ID	Sample ID	Method: Compound	CAS Number	LOR	Unit	Original Result	Duplicate Result	RPD (%)
EA/ED: Physical and Aggregate Properties (QC Lot: 3748204)								
HK2122799-001	FCZ1B_S Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	1.7	1.4	14.4
HK2122799-039	H4A_M Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.0	2.3	15.4
EA/ED: Physical and Aggregate Properties (QC Lot: 3748205)								
HK2122799-057	C_M Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.0	1.6	18.2
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3747648)								
HK2122799-056	C_S_Dup Ebb	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3747649)								
HK2122799-060	C_B_Dup Ebb	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3755256)								
HK2122799-034	H1A_M_Dup Ebb	EK067P: Total Phosphorus as P	----	0.01	mg/L	0.02	0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3755257)								
HK2124164-022	Anonymous	EK067P: Total Phosphorus as P	----	0.01	mg/L	0.02	0.02	0.0

Method Blank (MB), Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report

Matrix: WATER		Method Blank (MB) Report			Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report						
Method: Compound	CAS Number	LOR	Unit	Result	Spike Concentration	Spike Recovery (%)		Recovery Limits(%)		RPD (%)	
						LCS	DCS	Low	High	Value	Control Limit
EA/ED: Physical and Aggregate Properties (QC Lot: 3748204)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	108	----	85.9	117	----	----
EA/ED: Physical and Aggregate Properties (QC Lot: 3748205)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	93.5	----	85.9	117	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3747648)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	102	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3747649)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	106	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3755256)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	97.7	----	93.6	102	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3755257)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	97.6	----	93.6	102	----	----

21 June 2021

Laboratory Duplicate (DUP) Report

Matrix: WATER				Laboratory Duplicate (DUP) Report				
Laboratory sample ID	Sample ID	Method: Compound	CAS Number	LOR	Unit	Original Result	Duplicate Result	RPD (%)
EA/ED: Physical and Aggregate Properties (QC Lot: 3750591)								
HK2124164-001	FCZ1B_S Flood	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.8	3.1	8.5
HK2124164-039	H4A_M Flood	EA025: Suspended Solids (SS)	----	0.5	mg/L	3.0	2.7	8.8
EA/ED: Physical and Aggregate Properties (QC Lot: 3750592)								
HK2124164-059	C_B Flood	EA025: Suspended Solids (SS)	----	0.5	mg/L	3.5	3.2	10.4
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3752099)								
HK2124164-058	C_M_Dup Flood	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3752527)								
HK2124164-022	SGA_M_Dup Flood	EK067P: Total Phosphorus as P	----	0.01	mg/L	0.02	0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3752528)								
HK2124167-006	Anonymous	EK067P: Total Phosphorus as P	----	0.01	mg/L	0.02	0.02	0.0

Method Blank (MB), Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report

Matrix: WATER				Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report							
Method: Compound	CAS Number	Method Blank (MB) Report			Spike Concentration	Spike Recovery (%)		Recovery Limits(%)		RPD (%)	
		LOR	Unit	Result		LCS	DCS	Low	High	Value	Control Limit
EA/ED: Physical and Aggregate Properties (QC Lot: 3750591)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	93.5	----	85.9	117	----	----
EA/ED: Physical and Aggregate Properties (QC Lot: 3750592)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	95.0	----	85.9	117	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3752099)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	96.9	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3752100)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	100	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3752527)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	97.6	----	93.6	102	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3752528)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	99.0	----	93.6	102	----	----
EP: Aggregate Organics (QC Lot: 3751964)											

23 June 2021

Laboratory Duplicate (DUP) Report

Matrix: WATER				Laboratory Duplicate (DUP) Report				
Laboratory sample ID	Sample ID	Method: Compound	CAS Number	LOR	Unit	Original Result	Duplicate Result	RPD (%)
EA/ED: Physical and Aggregate Properties (QC Lot: 3756008)								
HK2124167-001	FCZ1B_S Flood	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.3	2.4	6.4
HK2124167-039	H4A_M Flood	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.0	2.3	15.0
EA/ED: Physical and Aggregate Properties (QC Lot: 3756009)								
HK2124167-059	C_B Flood	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.4	2.2	12.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3752528)								
HK2124167-006	FCZ1B_B_Dup Flood	EK067P: Total Phosphorus as P	----	0.01	mg/L	0.02	0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3752529)								
HK2124167-060	C_B_Dup Flood	EK067P: Total Phosphorus as P	----	0.01	mg/L	0.02	0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3757858)								
HK2124167-058	C_M_Dup Flood	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3757859)								
HK2124167-060	C_B_Dup Flood	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0

Method Blank (MB), Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report

Matrix: WATER				Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report							
Method: Compound	CAS Number	Method Blank (MB) Report			Spike Concentration	Spike Recovery (%)		Recovery Limits(%)		RPD (%)	
		LOR	Unit	Result		LCS	DCS	Low	High	Value	Control Limit
EA/ED: Physical and Aggregate Properties (QC Lot: 3756008)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	93.5	----	85.9	117	----	----
EA/ED: Physical and Aggregate Properties (QC Lot: 3756009)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	106	----	85.9	117	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3752528)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	99.0	----	93.6	102	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3752529)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	98.3	----	93.6	102	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3757858)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	99.3	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3757859)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	101	----	93.1	107	----	----

25 June 2021

Laboratory Duplicate (DUP) Report

Matrix: WATER				Laboratory Duplicate (DUP) Report				
Laboratory sample ID	Sample ID	Method: Compound	CAS Number	LOR	Unit	Original Result	Duplicate Result	RPD (%)
EA/ED: Physical and Aggregate Properties (QC Lot: 3761742)								
HK2124170-001	FCZ1B_S Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.2	2.4	7.7
HK2124170-039	H4A_M Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	3.2	2.9	10.6
EA/ED: Physical and Aggregate Properties (QC Lot: 3761743)								
HK2124170-057	C_M Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.6	2.4	6.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3760584)								
HK2124170-056	C_S_Dup Ebb	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3760585)								
HK2124170-060	C_B_Dup Ebb	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3761081)								
HK2124170-034	H1A_M_Dup Ebb	EK067P: Total Phosphorus as P	----	0.01	mg/L	0.02	0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3761082)								
HK2124170-060	C_B_Dup Ebb	EK067P: Total Phosphorus as P	----	0.01	mg/L	0.02	0.02	0.0

Method Blank (MB), Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report

Matrix: WATER		Method Blank (MB) Report			Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report						
Method: Compound	CAS Number	LOR	Unit	Result	Spike Concentration	Spike Recovery (%)		Recovery Limits(%)		RPD (%)	Control Limit
						LCS	DCS	Low	High	Value	
EA/ED: Physical and Aggregate Properties (QC Lot: 3761742)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	110	----	85.9	117	----	----
EA/ED: Physical and Aggregate Properties (QC Lot: 3761743)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	106	----	85.9	117	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3760584)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	96.0	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3760585)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	97.7	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3761081)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	98.8	----	93.6	102	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3761082)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	96.1	----	93.6	102	----	----

28 June 2021

Laboratory Duplicate (DUP) Report

Matrix: WATER				Laboratory Duplicate (DUP) Report				
Laboratory sample ID	Sample ID	Method: Compound	CAS Number	LOR	Unit	Original Result	Duplicate Result	RPD (%)
EA/ED: Physical and Aggregate Properties (QC Lot: 3764211)								
HK2124770-001	FCZ1B_S Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	15.5	15.7	1.4
HK2124770-039	H4A_M Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	15.6	14.9	4.6
EA/ED: Physical and Aggregate Properties (QC Lot: 3764212)								
HK2124770-057	C_M Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	12.6	13.0	3.3
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3765694)								
HK2124770-056	C_S_Dup Ebb	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	0.03	0.03	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3765695)								
HK2124770-060	C_B_Dup Ebb	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	0.03	0.03	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3771125)								
HK2124770-034	H1A_M_Dup Ebb	EK067P: Total Phosphorus as P	----	0.01	mg/L	0.05	0.05	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3771126)								
HK2124771-022	Anonymous	EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	<0.01	0.0

Method Blank (MB), Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report

Matrix: WATER		Method Blank (MB) Report			Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report						
Method: Compound	CAS Number	LOR	Unit	Result	Spike Concentration	Spike Recovery (%)		Recovery Limits(%)		RPD (%)	Control Limit
						LCS	DCS	Low	High	Value	
EA/ED: Physical and Aggregate Properties (QC Lot: 3764211)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	99.0	----	85.9	117	----	----
EA/ED: Physical and Aggregate Properties (QC Lot: 3764212)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	108	----	85.9	117	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3765694)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	96.8	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3765695)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	102	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3771125)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	95.9	----	93.6	102	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3771126)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	95.8	----	93.6	102	----	----

30 June 2021





Laboratory Duplicate (DUP) Report

Matrix: WATER				Laboratory Duplicate (DUP) Report				
Laboratory sample ID	Sample ID	Method/Compound	CAS Number	LOR	Unit	Original Result	Duplicate Result	RPD (%)
EA/ED: Physical and Aggregate Properties (QC Lot: 3771842)								
HK2124771-001	FCZ1B_S Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	1.1	1.3	12.5
HK2124771-039	H4A_M Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	2.0	2.0	0.0
EA/ED: Physical and Aggregate Properties (QC Lot: 3771843)								
HK2124771-057	C_M Ebb	EA025: Suspended Solids (SS)	----	0.5	mg/L	1.0	1.1	9.3
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3770565)								
HK2124771-056	C_S_Dup Ebb	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3770566)								
HK2124771-060	C_B_Dup Ebb	EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.02	<0.02	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3771126)								
HK2124771-022	SGA_M_Dup Ebb	EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	<0.01	0.0
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3771127)								
HK2124771-060	C_B_Dup Ebb	EK067P: Total Phosphorus as P	----	0.01	mg/L	0.01	0.01	0.0





Method Blank (MB), Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report

Matrix: WATER		Method Blank (MB) Report			Laboratory Control Spike (LCS) and Laboratory Control Spike Duplicate (DCS) Report						
Method/Compound	CAS Number	LOR	Unit	Result	Spike Concentration	Spike Recovery (%)		Recovery Limits (%)		RPD (%)	
						LCS	DCS	Low	High	Value	Control Limit
EA/ED: Physical and Aggregate Properties (QC Lot: 3771842)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	94.0	----	85.9	117	----	----
EA/ED: Physical and Aggregate Properties (QC Lot: 3771843)											
EA025: Suspended Solids (SS)	----	0.5	mg/L	<0.5	20 mg/L	106	----	85.9	117	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3770565)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	103	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3770566)											
EK055K: Ammonia as N	7664-41-7	0.01	mg/L	<0.01	0.5 mg/L	102	----	93.1	107	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3771126)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	95.8	----	93.6	102	----	----
ED/EK: Inorganic Nonmetallic Parameters (QC Lot: 3771127)											
EK067P: Total Phosphorus as P	----	0.01	mg/L	<0.01	0.5 mg/L	96.4	----	93.6	102	----	----

Marine Water Quality Monitoring for 1-year TSTP Operation

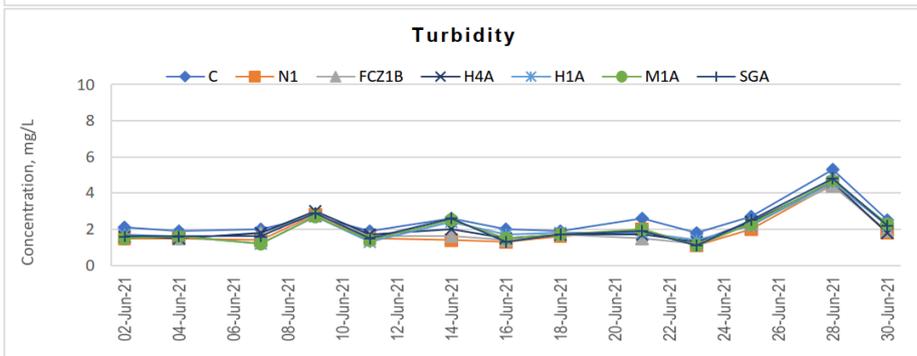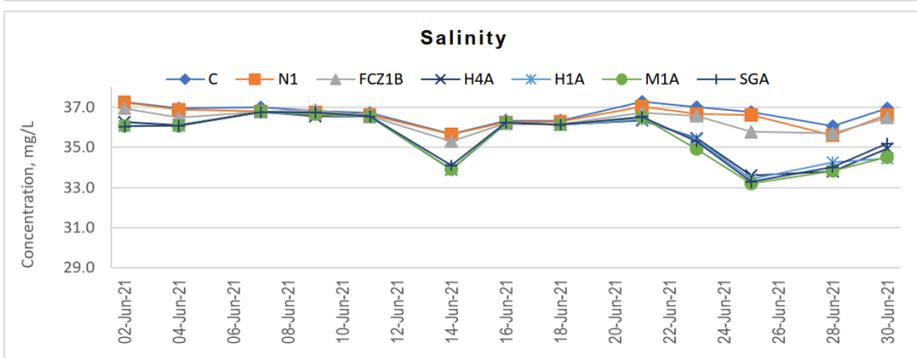
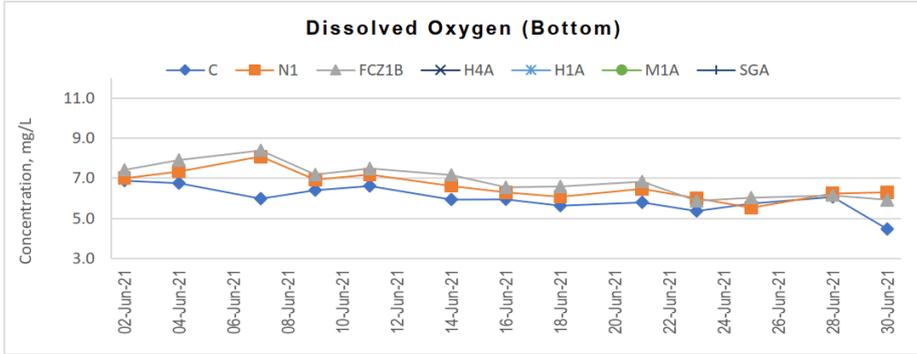
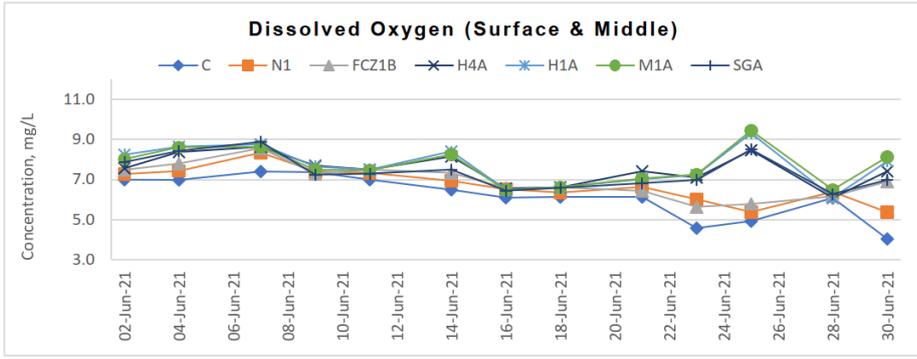


Marine Water Quality Monitoring for 1-year TSTP Operation

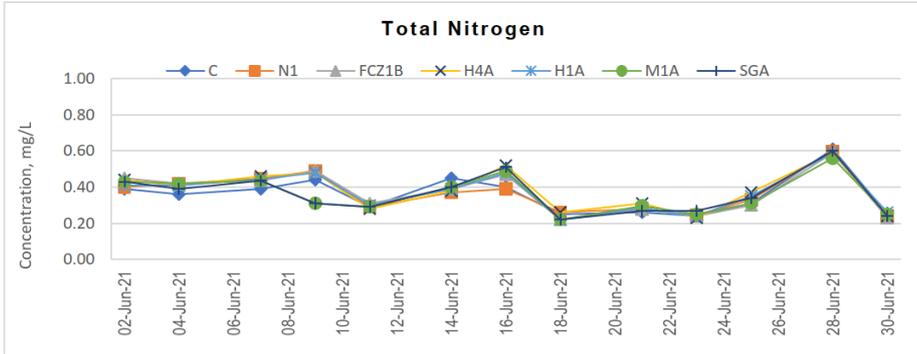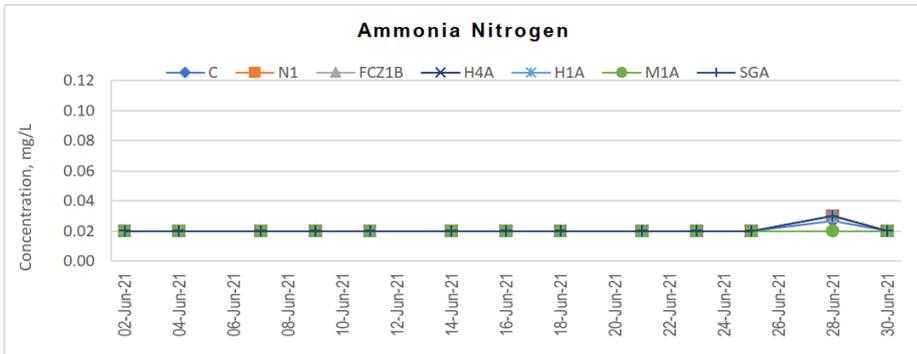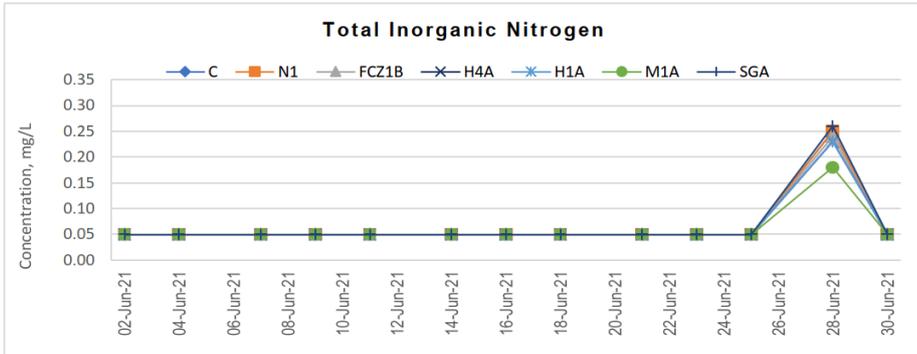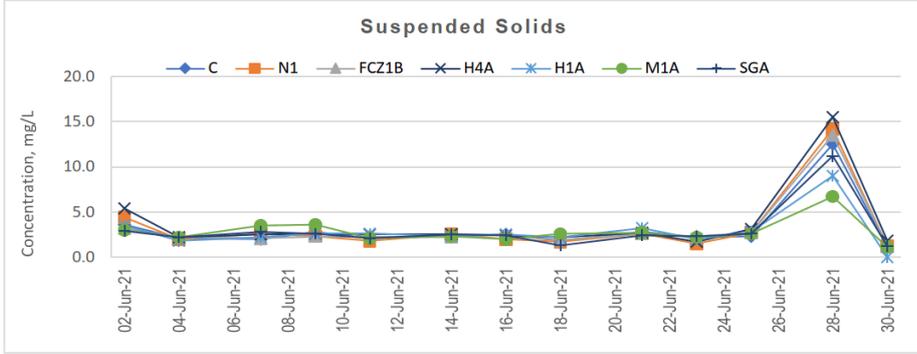


*For Total Inorganic Nitrogen, the <0.05 will be presented as value of 0.05 in the plot.
 *For Ammonia Nitrogen, the <0.02 will be presented as value of 0.02 in the plot.






Marine Water Quality Monitoring for 1-year TSTP Operation

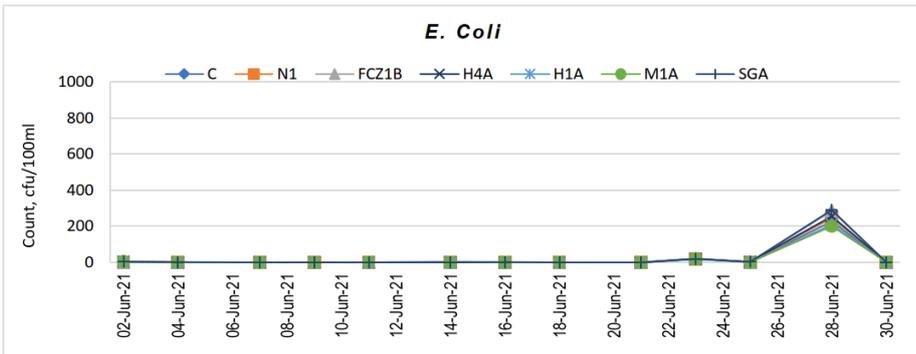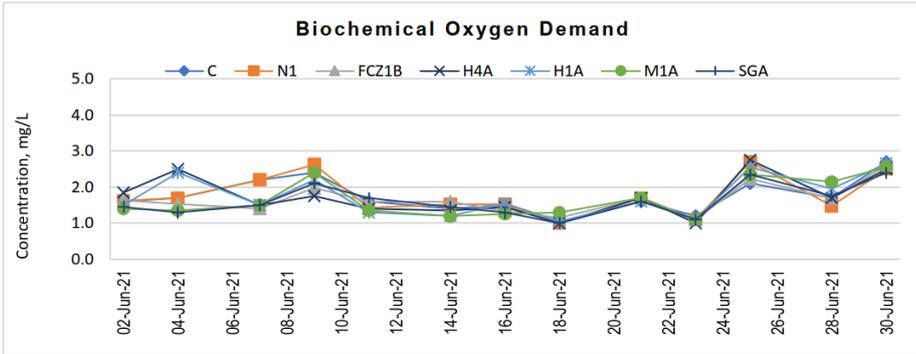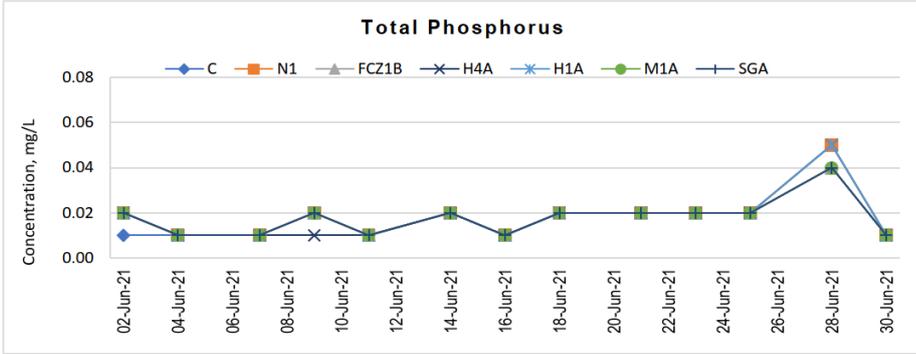






For E.Coli, the Not Detected will be presented as zero in the plot.

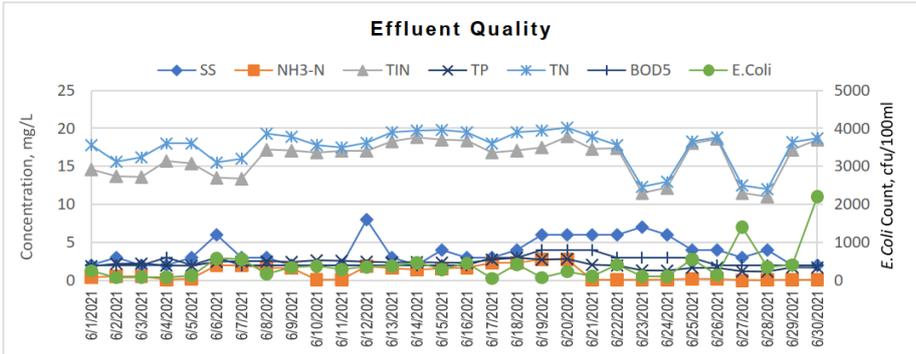

Marine Water Quality Monitoring for Marine Construction Works

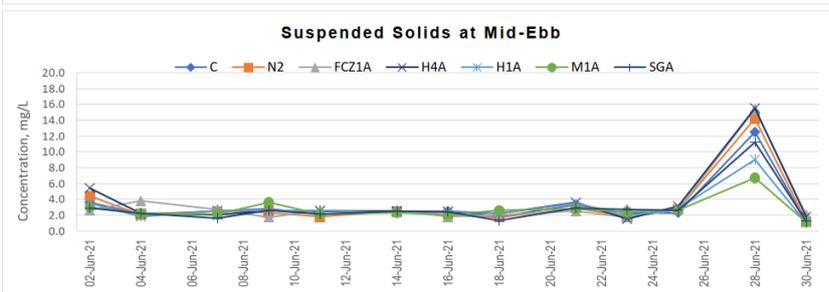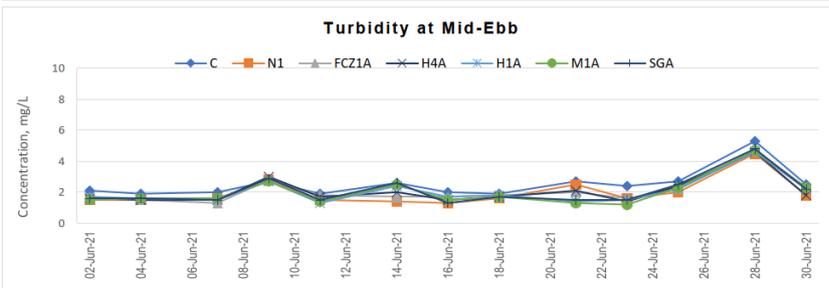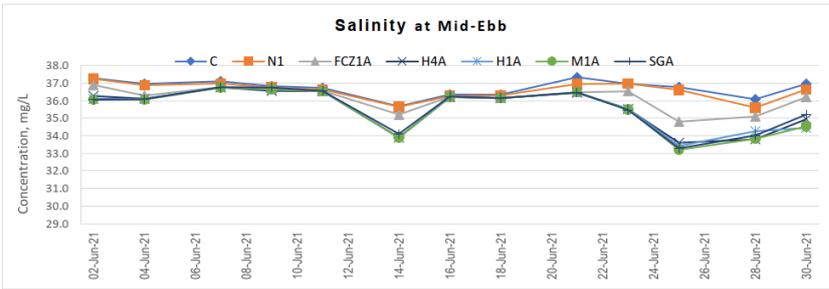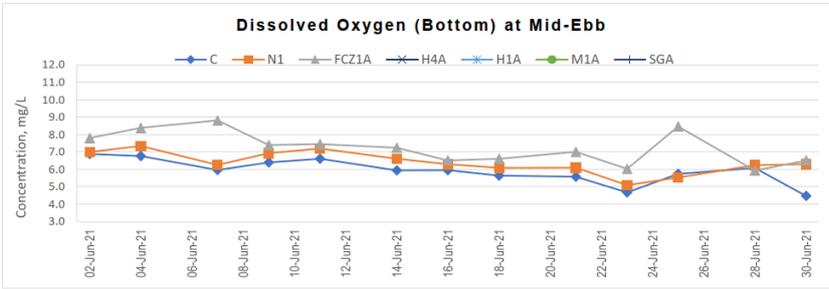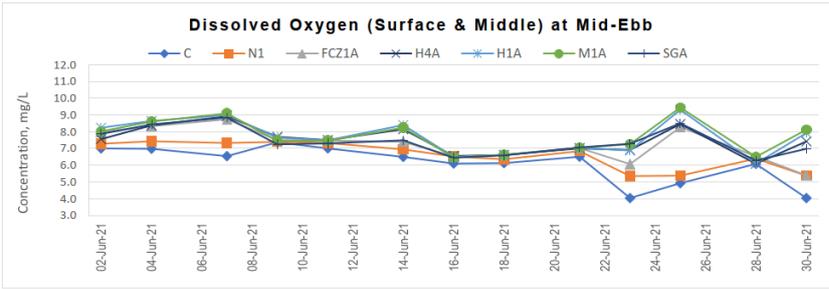

Marine Water Quality Monitoring for Marine Construction Works

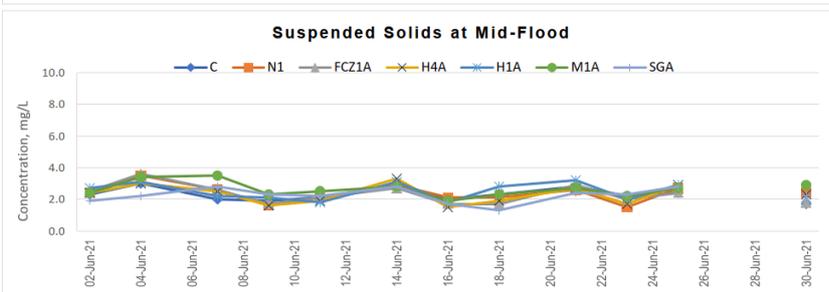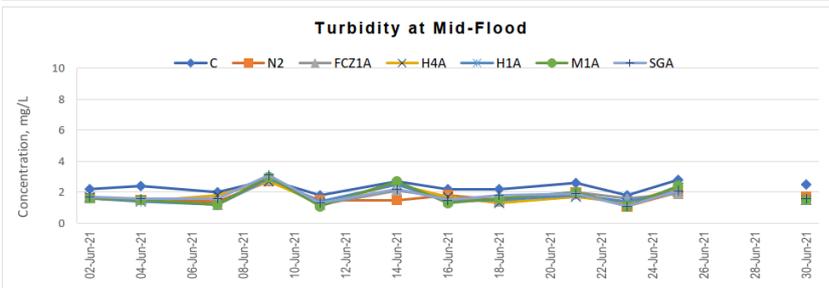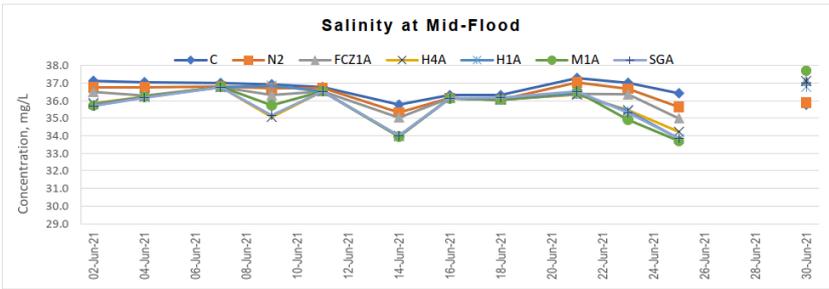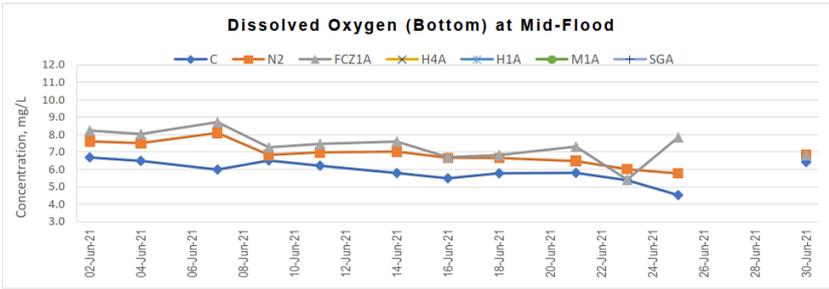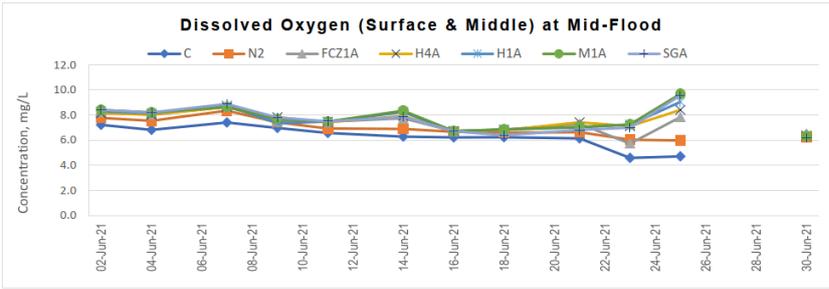

APPENDIX H

Event and Action Plan

Appendix H Event and Action Plan

EVENT	ACTION			
	ET	IEC	ER	Contractor
Construction Noise				
Action Level	<ol style="list-style-type: none"> 1. Carry out investigation to identify the source and cause of the complaint/exceedance(s) 2. Notify IEC, ER, and Contractor and report the results of investigation to the Contractor, ER and the IEC 3. Discuss with the Contractor and IEC for remedial measures required 4. If the complaint is related to the Project, conduct additional monitoring for checking mitigation effectiveness and report the findings and results to the IEC, ER and the Contractor 	<ol style="list-style-type: none"> 1. Review the analyzed results submitted by the ET. 2. Review the proposed remedial measures by the Contractor and advise the ER accordingly. 3. Supervise the implementation of remedial measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of Exceedance in writing. 2. Require Contractor to propose remedial measures for the analyzed noise problem. 3. Ensure remedial measures are properly implemented. 	<ol style="list-style-type: none"> 1. Submit noise mitigation proposals, if required, to the IEC and ER 2. Implement noise mitigation proposals
Limit Level	<ol style="list-style-type: none"> 1. Carry out investigation to identify the source and cause of the exceedance 2. Notify IEC, ER, Project Proponent, EPD and Contractor 3. Repeat measurements to confirm findings 4. Provide investigation report to IEC, ER, EPD and Contractor of the exceedances 5. If the exceedance is related to the Project, assess effectiveness by additional monitoring. 6. Report the remedial action implemented and the additional monitoring results to IEC, EPD, ER and Contractor 7. If exceedance stops, cease additional monitoring 	<ol style="list-style-type: none"> 1. Review the analyzed results submitted by the ET 2. Discuss the potential remedial measures with ER, ET Leader and Contractor 3. Review Contractors remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly 4. Supervise the implementation of remedial measures 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of Exceedance in writing. 2. Require the Contractor to propose remedial measures for the analyzed noise problem. 3. Ensure remedial measures are properly implemented. 4. If exceedance continues, consider what activity of the work is responsible and instruct the Contractor, in agreement with the Project Proponent, to stop that activity of work until the exceedance is abated. 	<ol style="list-style-type: none"> 1. Take immediate action to avoid further exceedance. 2. Submit proposals for remedial actions to IEC and RE within 3 working days of notification. 3. Implement the agreed proposals. 4. Resubmit proposals if problem still not under control. 5. Stop the relevant activity of works as determined by the Project Proponent until the exceedance is abated.
Landscape and Visual				
Non-conformity on one occasion	<ol style="list-style-type: none"> 1. Inform the Contractor, IEC and ER; 2. Discuss remedial actions with IEC, ER and Contractor 3. Monitor remedial actions until rectification has been completed 	<ol style="list-style-type: none"> 1. Check inspection report 2. Check Contractor's working method 3. Discuss with ET, ER and Contractor on possible remedial measures 4. Advise ER on effectiveness of proposed remedial measures 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of non-conformity in writing 2. Review and agree on the remedial measures proposed by the Contractor 3. Supervise implementation of remedial measures 	<ol style="list-style-type: none"> 1. Identify source and investigate the non-conformity 2. Implement remedial measures 3. Amend working methods agreed with ER as appropriate 4. Rectify damage and undertake any necessary replacement
Repeated Non-conformity	<ol style="list-style-type: none"> 1. Identify source(s) 2. Inform the Contractor, IEC and ER; 3. Discuss inspection frequency 4. Discuss remedial actions with IEC, ER and Contractor 5. Monitor remedial actions until rectification has been completed 6. If non-conformity stops, cease additional monitoring 	<ol style="list-style-type: none"> 1. Check inspection report 2. Check Contractor's working method 3. Discuss with ET, ER and Contractor on possible remedial measures 4. Advise ER on effectiveness of proposed remedial measures 	<ol style="list-style-type: none"> 1. Notify the Contractor 2. In consultation with the ET and IEC, agree with the Contractor on the remedial measures to be implemented 3. Supervise implementation of remedial measures 	<ol style="list-style-type: none"> 1. Identify source and investigate the non-conformity 2. Implement remedial measures 3. Amend working methods agreed with ER as appropriate 4. Rectify damage and undertake any necessary replacement. Stop relevant portion of works as determined by ER until the non-conformity is abated.

EVENT	ACTION			
	ET	IEC	ER	Contractor
Water Quality				
Action Level being exceeded by one sampling day	<ol style="list-style-type: none"> 1.Repeat in situ measurement on the next day of exceedance to confirm findings; 2. Check monitoring data, plant, equipment and Contractor(s)'s working methods; 3. Identify source(s) of impact and record in notification of exceedance; 4. Inform IEC, Contractor(s) and ER. 	<ol style="list-style-type: none"> 1.Check monitoring data submitted by ET and Contractor(s)'s working methods; 2. Inform EPD and AFCD. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of exceedance in writing; 2. Check plant and equipment and rectify unacceptable practice 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of exceedance in writing.
Action Level being exceeded by two or more consecutive sampling days	<ol style="list-style-type: none"> 1.Repeat in situ measurement on the next day of exceedance to confirm findings; 2. Check monitoring data, plant, equipment and Contractor(s)'s working methods; 3. Identify source(s) of impact and record in notification of exceedance; 4. Inform IEC, Contractor(s) and ER; 5. Discuss with IEC and Contractor(s) on additional mitigation measures and ensure that they are implemented 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET and Contractor(s)'s working methods; 2. Inform EPD and AFCD; 3. Discuss with ET and Contractor(s) on additional mitigation measures and advise ER accordingly; 4. Assess the effectiveness of the implemented mitigation measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of exceedance in writing; 2. Check plant and equipment and rectify unacceptable practice; 3. Consider changes of working methods; 4. Discuss with ET and IEC on additional mitigation measures and propose them to ER within 3 working days; 5. Implement the agreed mitigation measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of exceedance in writing; 2. Discuss with the IEC on the proposed additional mitigation measures and agree on the mitigation measures to be implemented. 3. Ensure additional mitigation measures are properly implemented.
Limit Level being exceeded by one sampling day	<ol style="list-style-type: none"> 1. Repeat in situ measurement on the next day of exceedance to confirm findings; 2. Check monitoring data, plant, equipment and Contractor(s)'s working methods; 3. Identify source(s) of impact and record in notification of exceedance; 4. Inform IEC, Contractor(s) and ER; 5. Discuss with IEC and Contractor(s) on additional mitigation measures and ensure that they are implemented 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET and Contractor(s)'s working methods; 2. Inform EPD and AFCD; 3. Discuss with ET and Contractor(s) on additional mitigation measures and advise ER accordingly; 4. Assess the effectiveness of the implemented mitigation measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of exceedance in writing; 2. Check plant and equipment and rectify unacceptable practice; 3. Critically review the need to change working methods; 4. Discuss with ET and IEC on additional mitigation measures and propose them to ER within 3 working days; 5. Implement the agreed mitigation measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of exceedance in writing; 2. Discuss with the IEC on the proposed additional mitigation measures and agree on the mitigation measures to be implemented. 3. Ensure additional mitigation measures are properly implemented. 4. Request Contractor(s) to critically review the working methods.
Limit Level being exceeded by two or more consecutive sampling days	<ol style="list-style-type: none"> 1. Repeat in situ measurement on the next day of exceedance to confirm findings; 2. Check monitoring data, plant, equipment and Contractor(s)'s working methods; 3. Identify source(s) of impact and record in notification of exceedance; 4. Inform IEC, Contractor(s) and ER; 5. Discuss with IEC and Contractor(s) on additional mitigation measures and ensure that they are implemented 	<ol style="list-style-type: none"> 1. Check monitoring data submitted by ET and Contractor(s)'s working methods; 2. Inform EPD and AFCD; 3. Discuss with ET and Contractor(s) on additional mitigation measures and advise ER accordingly; 4. Assess the effectiveness of the implemented mitigation measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of exceedance in writing; 2. Check plant and equipment and rectify unacceptable practice; 3. Critically review the need to change working methods; 4. Discuss with ET and IEC on additional mitigation measures and propose them to ER within 3 working days; 5. Implement the agreed mitigation measures. 	<ol style="list-style-type: none"> 1. Confirm receipt of notification of exceedance in writing; 2. Discuss with the IEC on the proposed additional mitigation measures and agree on the mitigation measures to be implemented. 3. Ensure additional mitigation measures are properly implemented. 4. Request Contractor(s) to critically review the working methods.

Notes:

ET – Environmental Team, IEC – Independent Environmental Checker; ER = Engineering Representatives

APPENDIX I

Waste Flow Table

Appendix I Waste Flow Table

Monthly Summary Waste Flow Table for 2021 (year)

Name of Person completing the record: Tim Tan (Assistant S & E Officer)

Project : Expansion of Sha Tau Kok Sewage Treatment Works Phase 1 and Village Sewerage in Tong To Contract No.: DC/2018/03

Month	Actual Quantities of Inert C&D Materials Generated Monthly						Actual Quantities of Non-Inert C&D Wastes Generated Monthly				
	Total Quantity Generated	Hard Rock and Large Broken Concrete	Reused in the Contract	Reused in other Projects	Disposed as Public Fill	Imported Fill	Metals	Paper/ cardboard packaging	Plastics (see Note 3)	Chemical Waste	Others, e.g. general refuse
	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000m ³)	(in '000 kg)	(in '000kg)	(in '000kg)	(in '000kg)	(in '000 m ³)
Jan	0.992	0.000	0.000	0.000	0.992	0.000	0.000	0.000	0.000	0.000	0.767
Feb	0.495	0.000	0.000	0.000	0.495	0.000	0.000	0.000	0.000	0.000	0.486
Mar	0.556	0.000	0.000	0.000	0.556	0.000	0.000	0.000	0.000	0.000	0.603
Apr	1.126	0.000	0.000	0.000	1.126	0.000	0.000	0.000	0.000	0.000	0.360
May	1.543	0.000	0.000	0.000	1.543	0.000	0.000	0.000	0.000	0.000	0.261
Jun	0.224	0.000	0.000	0.000	0.224	0.000	0.000	0.000	0.000	0.000	0.252
Sub-total	4.936	0.000	0.000	0.000	4.936	0.000	0.000	0.000	0.000	0.000	2.729
Jul	-	-	-	-	-	-	-	-	-	-	-
Aug	-	-	-	-	-	-	-	-	-	-	-
Sep	-	-	-	-	-	-	-	-	-	-	-
Oct	-	-	-	-	-	-	-	-	-	-	-
Nov	-	-	-	-	-	-	-	-	-	-	-
Dec	-	-	-	-	-	-	-	-	-	-	-
Total	4.936	0.000	0.000	0.000	4.936	0.000	0.000	0.000	0.000	0.000	2.729
2019	1.787	0.005	0.000	0.000	1.787	0.000	0.000	0.000	0.000	0.000	0.137
2020	3.316	0.000	0.000	0.000	3.321	0.000	0.000	0.000	0.000	0.000	0.703
Cumulative	10.039	0.005	0.000	0.000	10.044	0.000	0.000	0.000	0.000	0.000	3.569

- Notes:
- (1) The waste flow table shall also include C&D materials that are specified in the Contract to be imported for use at the Site.
 - (2) Plastics refer to plastic bottles/containers, plastic sheets/ foam from packaging materials.
 - (3) Broken concrete for recycling into aggregates.

APPENDIX J

**Implementation Schedule of Environmental Mitigation
Measures**

Appendix J Environmental Mitigation Implementation Schedule

EIA Ref	Objective & Address	Stage^ (D/C/O)	Recommended Environmental Protection Measures/ Mitigation Measures	Implementation Status in Construction Phase
Air Quality				
S3.7.1	Land site/ During Construction	C	- Dust control measures stipulated in the Air Pollution Control (Construction Dust) Regulation shall be implemented during the construction of the Project to control potential fugitive dust emissions.	^
			- Regular water spraying on exposed area.	^
			- Vehicle wheel-washing and body washing facilities shall be provided at the site entrance.	^
			- Shielding or covering with impervious sheet of stockpiled materials or exposed area when it is not used to reduce dust nuisance	^
			- Site practices such as regular maintenance and checking of the diesel-driven PMEs should be adopted to avoid any black smoke emissions and to reduce gaseous emissions	^
			- Open trench construction of the gravity sewers, each work front should be around 20m to 30m in length to control potential dust emission.	N.O.
S3.6.1			- The existing sewage pumping station and rising mains should be cleaned and flushed out properly to clear away any remaining potential sources of odour emission, such as sewage sludge from the facilities. The decommissioning including removal of the pumping station and rising mains should take place after the cleaning and flushing out.	N.O.
S3.9.1			- Regular site inspections on a weekly basis shall be carried out in order to confirm that the mitigation and control measures are properly implemented and are working effectively to ensure proper control of construction dust and gaseous emissions.	
S3.7.2	During operation (Odour: for operation of TSTP)	O	- To minimize odour problem, the sludge tankers for disposal of sludge shall be fully enclosed	^
		O	- Sludge produced will be thickened and dewatered to 30% dry solids prior to disposal at the landfill.	N.O.
		D/O	- Deodourizing facility using activated carbon filters and/or bio-trickling filters were equipped for both TSTP.	^
		D/O	- The deodorization system would undergo maintenance annually or when the average odour removal efficiency of deodorization facility is smaller than the required odour removal efficiency.	N.A.
		D/O	- Ventilation system was provided inside the TSTP to ensure adequate air change within the plant.	^
S3.9.2	During operation (Odour: for operation of TSTP)	O	- A commissioning test is recommended to be performed for the operation phase to ascertain the effectiveness of the deodorization systems at the TSTP. Exhaust air flow rate, temperature of exhaust, odour concentrations at the outlet of the deodorization systems should be monitored during the commissioning test.	^
		O	- Weekly monitoring of odour emission at the exhausts at TSTP by taking odour samples is recommended to be conducted in the first two months of the first year of the operation. (i.e. August to September 2020)	^
		O	- Provided that the monitoring results show no non-compliance on a weekly basis during the first two months, it is recommended to reduce the frequency to monthly in the subsequent four months (i.e. October 2020 to January 2021) and further reduce to quarterly in the remaining six months (i.e. February 2021 to July 2021) of the first year if no non-compliance is found. If there is any non-compliance, the operator should inspect the deodorization unit. Frequency of odour monitoring should not be reduced unless no non-compliance is found. Quarterly odour monitoring is also recommended to continue in the second year of the operation. If compliance can be achieved consistently throughout the first two years of operation, the Project Proponent may propose and seek approval with EPD to reduce monitoring frequency to every six month or yearly basis for subsequent years of operation.	^
S3.9.2	During operation (Odour: for operation of TSTP)	O	- Odour patrol is proposed during the period of maintenance or cleaning of the deodorization system for TSTP. It is generally defined as Level 0 to Level 4 in which Level 0 means no odour and Level 4 means unacceptable odour. If Level 3 – 4 is reported and the source of odour is confirmed to be originated from the exhaust of TSTP, the operator should be notified immediately and should investigate and rectify the problem of the cleaning or maintenance works within 24 hours in order to restore the level to below Level 2.	N.A.

EIA Ref	Objective & Address	Stage^ (D/C/O)	Recommended Environmental Protection Measures/ Mitigation Measures	Implementation Status in Construction Phase
Noise				
S4.8	Noise Control / During construction	C	- Use of quiet PME / quiet construction method.	^
			- Movable noise barriers of 3m in height with skid footing should be used and located within a few metres of stationary plant and mobile plant such that the line of sight to the NSR is blocked by the barriers. The length of the barrier should be at least five times greater than its height. The noise barrier material should have a superficial surface density of at least 7 kg m ² and have no openings or gaps.	N.O.
			- Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction phase.	^
			- Silencers or mufflers on construction equipment should be utilised and properly maintained during the construction phase.	^
			- Mobile plant, if any, should be sited as far away from NSRs as possible.	^
			- Machines and plant (such as trucks) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum.	^
			- Plant known to emit noise strongly in one direction should, wherever possible, be orientated so that the noise is directed away from the nearby NSRs.	^
			- Material stockpiles and other structures should be effectively utilised, wherever practicable, in screening noise from on-site construction activities.	N.O.
			- The construction activities should be planned and carried out in sequence rather than simultaneously at each location. Therefore, only one unit of each type of equipment should be operated at any one time.	^
	- Open trench construction of the gravity sewers, each work front should be around 20m to 30m in length.	N.O.		
	During operation	O	- Include noise levels specification when ordering new equipment items	^
	During operation	O	- Develop and implement a regularly scheduled equipment maintenance programme so that equipment items are properly operated and serviced. The programme should be implemented by properly trained personnel.	N.A.
S4.11	During construction	C	- Designated monitoring stations as defined in EM&A Manual/During construction phase.	^
Water Quality				
S5.9.3	Marine Dredging/ During construction	C	- A number of standard measures and good site practices should be implemented to avoid / minimize the potential impacts from marine construction. These measures include: • All vessels should be well maintained and inspected before use to limit any potential discharges to the marine environment; • All vessels must have a clean ballast system; • No soil waste is allowed to be disposed overboard.	^
S5.9.3	Marine Dredging/ During construction	C	- No discharge of sewage/grey wastewater should be allowed. Wastewater from potentially contaminated area on working vessels should be minimized and collected. These kinds of wastewater should be brought back to port and discharged at appropriate collection and treatment system.	^
EP Clause 2.11	Marine Dredging/ During construction	C	- The submarine outfall in Starling Inlet shall be constructed by trenchless method such as Horizontal Directional Drilling or equivalent such that the seabed (except at the diffuser location) will not be disturbed.	^
			- Cofferdam shall be installed at the receiving pit of the diffuser of submarine outfall. Excavation of sediment and construction of the diffuser shall be conducted in dry condition within the fully-drained cofferdam.	N.A.
S5.9.4	Land site & drainage/	C	- General Construction Activities Standard site practices outlined in ProPECC PN 1/94 "Construction Site Drainage" should be followed as far as practicable in order to reduce surface runoff, minimize erosion, and also to retain and reduce any SS prior to discharge.	^

EIA Ref	Objective & Address	Stage^ (D/C/O)	Recommended Environmental Protection Measures/ Mitigation Measures	Implementation Status in Construction Phase
	During construction		- Silt removal facilities such as silt traps or sedimentation facilities should be provided to remove silt particles from runoff to meet the requirements of the TM standard under the WPCO. The design of silt removal facilities should be based on the guidelines provided in ProPECC PN 1/94.	^
			- All drainage facilities and erosion and sediment control structures should be inspected on a regular basis and maintained to confirm proper and efficient operation at all times and particularly during rainstorms. Deposited silt and grit should be removed regularly.	^
			- Earthworks to form the final surfaces should be followed up with surface protection and drainage works to prevent erosion caused by rainstorms.	^
			- Appropriate surface drainage should be designed and provided where necessary.	^
			- The precautions to be taken at any time of year when rainstorms are likely together with the actions to be taken when a rainstorm is imminent or forecasted and actions to be taken during or after rainstorms are summarised in Appendix A2 of ProPECC PN 1/94.	^
			- Oil interceptors should be provided in the drainage system where necessary and regularly emptied to prevent the release of oil and grease into the storm water drainage system after accidental spillages.	^
S5.9.4	Land site & drainage/ During construction	C	- Temporary and permanent drainage pipes and culverts provided to facilitate runoff discharge, if any, should be adequately designed for the controlled release of storm flows. The temporary diverted drainage, if any, should be reinstated to the original condition when the construction work has finished or when the temporary diversion is no longer required.	^
S5.9.5	Land site & drainage/ During construction	C	- Appropriate infiltration control, such as cofferdam wall, should be adopted to limit groundwater inflow to the excavation works areas in the Project site. Groundwater pumped out from excavation area should be discharged into the storm system via silt removal facilities.	N.O.
S5.9.6	Land site & drainage/ During construction	C	- If needed, appropriate numbers of portable toilets shall be provided by a licensed contractor to serve the construction workers over the construction site to prevent direct disposal of sewage into the water environment.	^
S5.9.7			- Spillage of Chemicals Site drainage should be well maintained and good construction practices should be observed to ensure that oil, fuels, solvents and other chemicals are managed, stored and handled properly and do not enter the nearby streams or marine water.	^
S5.9.9	During operation	O	- The following design measures are also provided in the TSTP and the expanded STKSTW to avoid the risk of emergency discharge: <ul style="list-style-type: none"> •Provision of dual power supply and backup generator to eliminate the risk of power failure; •Provision of standby equipment (online and on-shelf) for all treatment units; •Operation of STKSTW is under 24-hour monitoring by Shift Team of Sha Tau Kok (for new STKSTW) and/or Shek Wu Hui STW in order to allow inspection and any necessary repair works by DSD at the earliest possible time; •A remote control and monitoring system (SCADA) will also be installed to allow off-site DSD staff (Shift Team) to monitor the operation of STKSTW; and •Provision of on-site storage of raw sewage up to 6 hours for the TSTP and STKSTW 	^
S5.9.10	During operation	O	- Additional measures provided to avoid plant failure associated fine screen include: <ul style="list-style-type: none"> •2 duties + 1 standby fine screens would be provided; •Uninstalled spare parts would be provided; •Monitoring equipment of fine screens would be installed; •Routine inspection and scheduled maintenance works would be strengthened and carried out regularly; and •Equipment and necessary measures such as lifting opening would be provided to shorten the time required for replacement of screen. 	N.A.

EIA Ref	Objective & Address	Stage^ (D/C/O)	Recommended Environmental Protection Measures/ Mitigation Measures	Implementation Status in Construction Phase
S5.9.12	During operation	O	- To avoid cross-connection of the reclaimed water supply to the potable water supply, the pipes for the reclaimed water will be specially arranged to differentiate them from that of the potable water pipe, e.g. clearly labelled with warning signs and notices, colour-coded, and/or using different pipe size.	N.A.
			- Caution would also be taken to avoid the use of high pressure jet in cleansing and landscape irrigation to minimize aerosol formation from the reclaimed effluent	N.A.
S5.12.1	Marine Dredging/ During construction	C	- Marine water quality monitoring at selected WSRs is recommended for installation, maintenance and removal of sheetpile and sediment removal works under this Project. Site audit would also be conducted throughout the marine and land-based construction under this Project. Details environmental monitoring procedures and audit requirements are provided in the standalone EM&A manual.	^
S5.12.2	During operation	O	- Marine water quality monitoring at selected WSRs is recommended for the first year of (1) interim operation of the TSTP, (2) operation of phase 1 and (3) phase 2 expansion of the STKSTW. Follow-up water quality monitoring should be commenced within 24 hours after an emergency discharge event and continue until the recovery of water quality. Monitoring of effluent quality would also be required for WPCO permit requirement. Detailed environmental monitoring procedures are provided in the standalone EM&A manual.	^
Waste Management & Land Contamination				
S6.6.1	During construction	C	- An Environmental Management Plan (EMP) in accordance with ETWB TCW No. 19/2005 – “Environmental Management on Construction Sites” should be prepared by the main Contractor of each construction contract upon appointment. The EMP should describe the arrangements for avoidance, reduction, reuse, recovery, recycling, storage, collection, treatment and disposal of different categories of waste to be generated from the construction activities.	^
S6.6.3	During construction	C	- An appropriate person, such as site agent or environmental officer should be nominated, to be responsible for good site practices, arrangement for collection and effective disposal of all wastes generated at the site to an approved facility. Training of construction staff should be undertaken by the Contractor about the concept of site cleanliness and appropriate waste management procedures. Requirements for staff training should be included in the EMP.	^
S6.6.4	During construction	C	- Good planning and site management practices should be employed to eliminate over ordering or mixing of construction materials to reduce wastage. Regular cleaning and maintenance of the waste storage area should be provided.	^
S6.6.5	During construction	C	- A recording system for the amount of wastes generated, recycled and disposed (including the disposal sites) should be implemented in accordance with DEVB TCW No. 6/2010. In order to monitor the disposal of C&D materials and solid wastes at public fill reception facilities and landfills and to control fly-tipping, a trip-ticket system should be included.	^
S6.6.6	During construction	C	- Imported soft fill and rocks, if required, should be sourced from CEDD's fill bank, other projects or other approved sources instead of using new materials. Approval from the Engineer and all other relevant parties should be obtained by the Contractor before importation of the fill materials.	N.O.
S6.6.7	During construction	C	- All waste materials should be segregated into categories covering: <ul style="list-style-type: none"> •inert C&D materials suitable for public filling facilities; •recyclable materials / waste; •remaining non-inert C&D materials for landfill; •spent bentonite for public filling facilities; •chemical waste; and •general refuse for landfill 	^
S6.6.9	During construction	C	- Proper segregation and disposal of construction waste should be implemented. Separate containers should be provided for inert and non-inert wastes.	^
S6.6.11	During construction	C	- The reuse of inert C&D materials such as soil, rock and broken concrete should be maximised. Waste should be separated into fine, soft and hard materials.	N.A.

EIA Ref	Objective & Address	Stage^ (D/C/O)	Recommended Environmental Protection Measures/ Mitigation Measures	Implementation Status in Construction Phase
S6.6.12	During construction	C	- Prior to export of material from the site, the potential for it to be reused should be assessed. Most C&D materials can easily be reused with minimum processing. Waste separation methods should be followed to ensure that C&D waste is separated at source. Suitable soft materials should be used for landscaping and grading of embankments. Fine material should be separated out and used as topsoil.	N.A.
S6.6.13	During construction	D & C	- Use of recycled aggregates whenever possible.	N.A.
S6.6.14, S6.6.30	During construction	C	- All C&D materials should be sorted on-site into inert and non-inert components by the Contractor. Non-inert C&D materials (C&D waste) such as wood, glass and plastic should be reused and recycled before disposal to a designated landfill as a last resort. Inert C&D materials (public fill) should be reused onsite or in other projects approved by relevant parties before disposed of at public fill reception facilities. Steel and other metals if any should be recovered from C&D materials and recycled.	^
S6.6.15	During construction	C	- Good quality reusable topsoil should be stockpiled for later landscaping works. Stockpiles should be less than 2m in height, formed to a safe angle of repose and hydroseeded or covered with tarpaulin to prevent erosion during the rainy season and to minimise dust generation.	^
S6.6.16	During construction	C	- Control measures for temporary stockpiles on-site should be taken in order to minimize the noise, generation of dust, pollution of water and visual impact.	^
S6.6.17	During construction	C	- The public fill to be disposed to public fill reception facilities must consist entirely of inert construction materials. Disposal of C&D waste to landfill must not have more than 50% by weight of inert material. The C&D waste delivered for landfill disposal should contain no free water and the liquid content should not exceed 70% by weight.	^
S6.6.18	During construction	C	- In order to avoid dust or odour impacts, any vehicles leaving a works area carrying C&D waste or public fill should have their load covered up before leaving the construction site.	^
S6.6.20	During construction	C	- With reference to the Sediment Quality Report in the EIA, only Category L sediment was identified. In accordance with ETWB TCW No. 34/2002, Type 1 – Open Sea Disposal should be adopted for the disposal of 3,040 m ³ excavated sediment during construction of the proposed outfall diffuser. The location of marine disposal site should be sought with MFC/CEDD. The Contractor shall obtain a Marine Dumping Permit in accordance with the Dumping at Sea Ordinance. The Contractor should provide separate submissions (e.g. Sediment Sampling and Testing Plan / Sediment Quality Report) to EPD / DASO authority when applying for the marine dumping permit under the Dumping at Sea Ordinance.	N.A.
S6.6.21	During construction	C	- Bentonite slurry used in the drilling works should be treated and recycled at the works area in STKSTW. Any bentonite that is not suitable for recycling should be suitably dewatered before disposed of at public fill reception facilities.	^
S6.6.22 & S6.6.37	During construction and operation	C & O	- Where the construction/ operation processes produce chemical waste, the Contractor must register with EPD as a chemical waste producer. Wastes classified as chemical wastes are listed in the Waste Disposal (Chemical Waste) (General) Regulation. These wastes are subject to stringent disposal routes. EPD requires information on the particulars of the waste generation processes including the types of waste produced, their location, quantities and generation rates. A nominated contact person must be registered with EPD.	^
S6.6.23 & S6.6.37	During construction	C & O	- Storage, handling, transport and disposal of chemical waste should be arranged in accordance with the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes published by EPD, and should be collected by a licensed chemical waste collector.	^
S6.6.24 & S6.6.37	During construction	C & O	- Suitable containers should be used for specific types of chemical wastes, containers should be properly labelled (English and Chinese in accordance with instructions prescribed in Schedule 2 of the Regulations), resistance to corrosion, safely stored and securely closed. Stored volume should not be kept more than 450 liters unless the specification has been approved by the EPD. Storage area should be enclosed by three sides by a wall, partition of fence that is at least 2 m height or height of tallest container with adequate ventilation and space.	^
S6.6.25 & S6.6.37	During construction	C & O	- Hard standing, impermeable surfaces draining via oil interceptors should be provided in works area compounds. Interceptors should be regularly emptied to prevent release of oils and grease into the surface water drainage system after accidental	^

EIA Ref	Objective & Address	Stage^ (D/C/O)	Recommended Environmental Protection Measures/ Mitigation Measures	Implementation Status in Construction Phase
			spillages. The interceptor should have a bypass to prevent flushing during periods of heavy rain. Oil and fuel bunkers should be bunded and/or enclosed on three sides to prevent discharge due to accidental spillages or breaches of tanks. Bunding should be of sufficient capacity to accommodate 110% of the volume of the largest container or 20% of the total volume of waste, whichever is largest. Waste collected from any grease traps should be collected and disposed of by a licensed contractor.	
S6.6.26 & S6.6.37	During construction	C & O	- Lubricants, waste oils and other chemical wastes are likely to be generated during the maintenance of vehicles and mechanical equipment. Used lubricants should be collected and stored in individual containers which are fully labelled in English and Chinese and stored in a designated secure place. If possible, such waste should be sent to oil recycling companies, and the empty oil drums collected by appropriate companies for reuse or refill.	^
S6.6.27	During construction	C	- The registered chemical waste producer (i.e. the Contractor) has to arrange for the chemical waste to be collected by licensed collectors. The licensed collector should regularly take chemical waste to a licensed chemical waste treatment facility (such as the Chemical Waste Treatment Centre in Tsing Yi). A trip ticket system operates to control the movement of chemical wastes.	^
S6.6.28	During construction	C	- No lubricants, oils, solvents or paint products should be allowed to discharge into water courses, either by direct discharge, or as contaminants carried in surface water runoff from the construction site.	^
S6.6.29	During construction	C	- All wooden materials used on-site should be kept separate from other wastes to avoid damage and to facilitate reuse. Timber which cannot be reused should be sorted out from other waste and stored separately from all inert waste before being disposed of to landfill.	^
S6.6.32	During construction	C	- General refuse generated on-site should be stored in enclosed bins or skips and collected separately from other construction and chemical wastes and disposed of at designated landfill. A temporary refuse collection point should be set up by the Contractor at the works area to facilitate the collection of refuse by licensed waste collector. The removal of waste from the site should be arranged on a daily or at least on every second day by the Contractor to minimise any potential odour impacts, minimise the presence of pests, vermin and other scavengers and prevent unsightly accumulation of waste.	^
S6.6.33	During construction	C	- The recyclable component of the municipal waste generated by the workforce, such as aluminum cans, paper and cleansed plastic containers should be separated from other waste. Provision and collection of recycling bins for different types of recyclable waste should be set up by the Contractor. The Contractor should also be responsible for arranging recycling companies to collect these materials.	^
S6.6.35	During operation	O	- Dewatered sludge should be delivered by sealed sludge tanker for treatment at the Sludge Treatment Facility in Tuen Mun.	N.A.
S6.6.36	During operation	O	- Screenings should be collected and stored in covered containers before disposed of at landfill. Likewise, worn membrane filters and general refuse should be properly stored and disposed of at landfill.	N.A.
Ecology				
S7.7.3	All area / During construction	C	- Erect fences along the boundary of the works area before the commencement of works to prevent vehicle movements and encroachment of personnel onto adjacent areas.	^
			- Regularly check the work site boundaries to ensure that they are not breached and that damage does not occur to surrounding areas.	^
			- Avoid any damage and disturbance, particularly those caused by filling and illegal dumping, to the surrounding habitats through proper management of waste disposal.	^
			- To avoid/ minimise the potential disturbance on the Night Roosting Site for Great Egret if confirmed to be continuing their usage before the construction activities, major noisy works such as concrete breaking should not be undertaken within an area of 100m from the Night Roosting Site after 16:00 under normal working hours. (i.e. 16:00 to 07:00 of the following day).	N.A.
			- Strong artificial lighting should not be used in the area at night to avoid disturbance to the roosting ardeids.	N.O.
Landscape & Visual				

EIA Ref	Objective & Address	Stage^ (D/C/O)	Recommended Environmental Protection Measures/ Mitigation Measures	Implementation Status in Construction Phase
Table 9.6 of EM&A Manual	To protect existing landscape resources during construction stage	C	<p>Preservation of Existing Vegetation:</p> <ul style="list-style-type: none"> - Existing trees designated to be retained in-situ should be properly protected. Tree protection measures to be undertaken shall be in accordance with DEVB TC(W) 7/2015 on "Tree Preservation" and Guidelines on Tree Preservation during Development" by DEVB. This may include the clear demarcation and fencing-off of tree protection zones, tight site supervision and monitoring to prevent tree damage by construction activities, and periodic arboricultural inspection and maintenance to uphold tree health. A total of around 108 nos. of trees should be retained in-situ within the tree survey area. - Under current proposal, no tree is recommended to be transplanted since the trees in conflict with the proposed works are not suitable to be transplanted. However, should transplantation be proposed in the detailed design stage after an update tree survey, the recommended final recipient sites should be adjacent to their current locations. Enough time should be reserved for tree transplantation works to increase the survival rate of the transplanting trees. To ensure the survival of transplanted trees, protection work should be considered. The tree transplantation proposal shall be submitted to relevant authorities for approval together with the formal tree removal application. Tree transplanting works shall be undertaken in accordance with Guidelines on Tree Transplanting by DEVB. 	^
	To reduce construction disturbance during construction stage	C	<p>Control of Site Construction Activities:</p> <ul style="list-style-type: none"> - Construction site controls shall be enforced, where possible, to ensure that the landscape and visual impacts arising from the construction phase activities are minimised. These construction site controls should include but not limited to the following: <ul style="list-style-type: none"> •Storage of materials should be carefully arranged to minimise potential landscape and visual impact. •The location and appearance of site accommodation should be carefully designed to minimize potential landscape and visual impact. •Site lighting should be carefully designed to prevent light spillage. •Extent of the works area and construction period should be minimised as far as practicable. •Screen hoarding with compatible design to blend into the surrounding natural environment should be considered (Screen hoarding may not be practicable for works of upgrading existing rising mains due to the spatial constraints of the works area along the Shun Hing Street). •Temporary works areas should be reinstated at the earliest possible opportunity. 	^
Table 9.7 of EM&A Manual	To reduce landscape and visual impact during construction	D & C	<p>Suitable design of the proposed TSTP:</p> <ul style="list-style-type: none"> - Colour of natural tones and non-reflective building materials shall be used for any outward facing building facades to avoid visual and glare disturbance. - Responsive lighting design <ul style="list-style-type: none"> •Directional and full cut off lighting is recommended within the boundaries of STKSTW to minimise light spillage to the surroundings; •Minimise geographical spread of lighting, only applying for safety at the key access points of the STKSTW; and - Limited lighting intensity to meet the minimum safety and operation requirement. 	^
Cultural Heritage				
S10.3.50	During construction	C	- Undertake trenchless excavation in the vicinity of the Tin Hau Temple and provide a buffer zone of 10m between the works area for the open cut section and the Tin Hau Temple.	N.O.
S10.3.51			- A condition survey and vibration impact assessment should be undertaken and if construction vibration monitoring and structural strengthening measures are required.	N.A.
S10.3.52			- Vibration and settlement monitoring should also be undertaken during the construction works to ensure that safe levels of vibration are not exceeded, if it is recommended in the condition survey report.	N.A.

EIA Ref	Objective & Address	Stage^ (D/C/O)	Recommended Environmental Protection Measures/ Mitigation Measures	Implementation Status in Construction Phase
S10.3.53			- If the maximum level is exceeded all works must stop and the structure must be examined to determine if it has been damaged. The contractor must also take measures, such as using smaller pneumatic drills to ensure that the levels are reduced to acceptable limits.	N.A.
S10.3.54			- If at any time during the construction period the foundation of the structure is affected by the works; the works shall be immediately suspended and the AMO notified. If the works cause any damage to the structures, the proponent should be responsible for the restoration and repair at their own cost. A method statement should be submitted to AMO for comment and the works should be under AMO's supervision.	N.O.
S10.3.55			- Protective covering should be provided as an additional mitigation measure to the Tin Hau Temple.	N.O.

Remarks: ^ Compliance of mitigation measure
x Non-compliance of mitigation measure
N.A Not Applicable at this stage as no such site activities were conducted in the reporting period
N.O Not Observed during site inspection in the reporting period.

APPENDIX K

Proactive Environmental Protection Proforma

Appendix K Proactive Environmental Protection Proforma

Reporting Period	01/06/2021 – 30/06/2021
Construction Works	<ul style="list-style-type: none"> • Excavation and formwork • Submarine Outfall pilot hole drilling (Land) • Submarine Outfall pilot hole drilling (Sea) • Sewer laying works in Shun Hing Street and Tong To Village
Anticipated Impacts	Dust, Noise and water quality impact.
Corresponding Mitigation Measures	<ul style="list-style-type: none"> • All construction plants / machineries will be checked / serviced on a regular basis during the courses of construction to minimize the emission of noise generation and eliminate dark smoke emission. • All C&D materials generated will be transported and stored at temporary storage area. Cover will be provided during transportation of dusty materials. Suitable materials will be sorted for reuse on-site. Only non-inert C&D material will be disposed off-site to NENT Landfill. • All dump trucks will be equipped with mechanical covers to prevent the dust emission during transportation when necessary. • Dust control measures, such as water spraying, will be provided during demolition works when necessary. • Maintaining of wet surface on access road and keep slow speed in the site. • Wastewater to be treated by wastewater treatment facilities before discharge. • Conditions in the Environmental Permit and Discharge License should be followed. • Fueling of equipment will be conducted carefully on-site by mobile tanker to avoid storage of fuel and oil spillage. • Provision of drip trays for equipment likely cause spillage of chemical / fuel, and provide routine maintenance. • Predict required quantity of concrete accurately and collect the unused fresh concrete at designated locations in the site for subsequent disposal. • Application of silent plant. • Provide sufficient mitigation measures as recommended in approved EM&A Manual requirement. • Floating single silt curtain shall be deployed to fully enclose the works area at sea side prior to the installation of pipe piles for temporary scaffold and remove the silt curtain after the completion of steel casing installation.
Coming Month	01/07/2021 – 31/07/2021
Construction Works	<ul style="list-style-type: none"> • Submarine Outfall pilot hole drilling (Land) • Submarine Outfall pilot hole drilling (Sea) • Sewer laying works in Shun Hing Street and Tong To Village • Formwork erection and rebar fixing
Anticipated Impacts	Dust, Noise and water quality impact.
Corresponding Mitigation Measures	<ul style="list-style-type: none"> • All construction plants / machineries will be checked / serviced on a regular basis during the courses of construction to minimize the emission of noise generation and eliminate dark smoke emission. • All C&D materials generated will be transported and stored at temporary storage area. Cover will be provided during transportation of dusty materials. Suitable materials will be sorted for reuse on-site. Only non-inert C&D material will be disposed off-site to NENT Landfill. • All dump trucks will be equipped with mechanical covers to prevent the dust emission during transportation when necessary. • Dust control measures, such as water spraying, will be provided during demolition works when necessary. • Maintaining of wet surface on access road and keep slow speed in the site. • Wastewater to be treated by wastewater treatment facilities before discharge. • Conditions in the Environmental Permit and Discharge License should be followed. • Fueling of equipment will be conducted carefully on-site by mobile tanker to avoid storage of fuel and oil spillage. • Provision of drip trays for equipment likely cause spillage of chemical / fuel, and provide routine maintenance. • Predict required quantity of concrete accurately and collect the unused fresh concrete at designated locations in the site for subsequent disposal. • Application of silent plant. • Provide sufficient mitigation measures as recommended in approved EM&A Manual requirement. • Floating single silt curtain shall be deployed to fully enclose the works area at sea side prior to the installation of pipe piles for temporary scaffold and remove the silt curtain after the completion of steel casing installation.

APPENDIX L

**Cumulative Statistics on Complaints, Notification of
Summons, Successful Prosecutions and Public Engagement
Activities**

Appendix L Cumulative Statistics on Complaints, Notifications of Summons, Successful Prosecutions and Public Engagement Activities

Environmental Complaints Log

Complaint Log No.	Date of Complaint	Received From	Received By	Nature of Complaint	Investigation/ Mitigation Action	Status
-	-	-	-	-	-	-

Remark:

** No Complaints related to 0700 to 1900 on normal weekdays, Notifications of Summons or Successful Prosecutions was received in the reporting period.*

Cumulative Statistics on Complaints, Notifications of Summons and Successful Prosecutions and Public Engagement Activities

Reporting Period	Complaints	Notifications of Summons and Prosecutions	Public Engagement Activities
This Month	0	0	0
Cumulative Project-to-Date	0	0	0

APPENDIX M

On-site Time Duties for the Team of ET and IEC

Appendix M On-site Time & duties for the Team of ET and IEC

On-site Time & Duties for the Team of ET during the reporting month		
Works to be carried on-site	Purposes	Actual Man-hour per week
Environmental site inspection	<ul style="list-style-type: none"> To audit and assess the effectiveness of the Contractor's site practice and work methodologies regarding on environmental and landscape & visual mitigation measures as stipulated in the EM&A Manual. To take pro-active actions to pre-empt environmental problems. To audit compliance with the intended aims of the measures implemented by the Contractor. The findings will notify to the Contractor at the time of inspection to enable the rapid resolution of identified non-conformities. To carry out the follow-up actions if non-conformities identified during the site inspection. 	3 hours per week
Keeping and logging records in the log-book	<ul style="list-style-type: none"> To keep a contemporaneous log-book of any such instance or circumstance or change of circumstances. 	1 hour per week
Impact noise monitoring	<ul style="list-style-type: none"> To carry out impact noise monitoring at each station at 0700-1900 hours on normal weekdays; per week when construction activities are underway. To check the performance of monitoring and to track the varying environmental impact. To carry out remedial actions described in the Event/Action Plans of the EM&A Manual in accordance with the time frame set out in the Event/ Action Plans in case where specified criteria in the EM&A Manual are exceeded. 	2 hours per week
Meeting with the ER, IEC, and contractor.	<ul style="list-style-type: none"> To discuss with ER, IEC and Contractor any observations that improvement works is required to enhance the overall environmental performance; liaise with Contractor on any environmental non-compliance identified and follow up actions taken. To liaise with the Project Proponent, IEC, RSS and other individuals or parties concerning other environmental issues deemed to be relevant to the construction/ operation process. 	2 hours per week
Additional Monitoring for Critical work activities	Purposes	Additional minimum on-site time
<u>Construction Phase</u>		
Monitoring of decommission of existing rising main and demolition of sewage pumping station inside the close area of Sha Tau Kok Chuen	<ul style="list-style-type: none"> To audit the Contractor's site practice and work methodologies regarding environmental mitigation measures contained in the EM&A Manual. To check any non-compliance with the construction methodology, mitigation measures and environmental monitoring and audit requirements recommended in the approved Method Statement submitted by the Contractor. To take pro-active actions to pre-empt environmental problems. 	Such work has not yet commenced.
Monitoring for Marine construction works including construction of cofferdam at the location of diffuser and construction of Submarine Outfall, etc.	<ul style="list-style-type: none"> To audit the Contractor's site practice and work methodologies regarding environmental mitigation measures contained in the EM&A Manual. To check any non-compliance with the construction methodology, mitigation measures and environmental monitoring and audit requirements recommended in the approved Method Statement submitted by the Contractor. To take pro-active actions to pre-empt environmental problems. 	2 hours per week
Marine Water quality monitoring during marine construction activities	<ul style="list-style-type: none"> To obtain water samples from the Water Quality Monitoring Stations as stipulated in the Table 5.3 of EM&A Manual. To check the monitoring parameter against the Action and Limit Levels stipulated in the Table 4.2 of Baseline Environmental Monitoring Report (Water). 	3 days per week x 8 hours = 24 hours per week
<u>Operation Phase</u>		
Marine Water quality monitoring during the first year of the TSTP	<ul style="list-style-type: none"> To obtain water samples from the Water Quality Monitoring Stations as stipulated in the Table 5.3 of EM&A Manual. To check the monitoring parameter against the Action and Limit Levels stipulated in the Table 4.3 of Baseline Environmental Monitoring Report (Water). 	3 days per week x 8 hours = 24 hours per week

Additional Monitoring for Critical work activities	Purposes	Additional minimum on-site time
Continuous monitoring of treated sewage effluent from the TSTP	<ul style="list-style-type: none"> To obtain 24-hour flow-weighted composite effluent sample for subsequent chemical analysis and testing To check the monitoring parameter against the Action and Limit Levels stipulated in the Table 5.4 of EM&A Manual. To notify the plant operator for the non-compliance and to identify the cause for the non-compliance if any non-compliance. 	For auto-sampling, 4 hours x 7 days = 28 hours per week
Testing & Commissioning for the TSTP	<ul style="list-style-type: none"> To ascertain the effectiveness of the deodorization systems as required in the EM&A at the TSTP and STKSTW during the operation phase. 	Completed
Monitoring of odour emission at the exhausts at TSTP	<ul style="list-style-type: none"> To check any non-compliance with the monitoring parameter as stipulated in the EM&A Manual. 	Will be performed in July 21
Odour patrol during the period of maintenance of the deodorization system for TSTP	<ul style="list-style-type: none"> To patrol and sniff along an odour patrol route at the existing STKSTW site boundary. To carry out the follow-up actions if any exceedance of the Action or Limit Level occurs actions in accordance with the Event/Action Plan presented in Table 3.5 of EM&A Manual should be carried out. 	No maintenance of deodorization system for TSTP in the reporting month.

On-site Time & Duties for the Team of IEC during the reporting month		
Works to be carried on-site	Purposes	Actual Man-hour per week
General site inspection or Monthly site inspection	<ul style="list-style-type: none"> To ensure the EIA recommendations and EP requirements are complied with To review the effectiveness of environmental mitigation measures and environmental performance of the Project To identify any environmental deficiency needs to be improved. To identify in any environmental non-compliance 	2 x 2 hours general site inspection or 1 x 4 hours monthly site inspection
Inspection of on-site ET Logbook	<ul style="list-style-type: none"> To inspect and audit the on-site logbook kept by the ET 	1 hour per week
Audit of Monitoring Works by the ET	<ul style="list-style-type: none"> To check, audit and verify the environmental monitoring equipment, procedures, data and results of the environmental monitoring works carried out by the ET 	1.5 hours per week
Meeting with the ER, ET and contractor.	<ul style="list-style-type: none"> To discuss with ER, ET and Contractor any observations that improvement works is required to enhance the overall environmental performance To discuss with ET, ET and Contractor any environmental non-compliance identified and follow up actions required 	1.5 hours per week